



Expertise

Protocol number: 41468356
Order No. / Reference: 25144539
Inspection date: 8 Sept 2025

Manufacturer: Volkswagen

Model: Passat Variant 1.4 TSI Plug-In-Hybrid DSG GTE

VIN: WVGZZZ3CZLE142402



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Passat Variant 1.4 TSI Plug-In-Hybrid DSG GTE	
Vehicle Identification number	WVGZZZ3CZLE142402
Mileage (Read)	131,491 km
First registration	4 Sept 2020
Number of holders	1
Next periodical technical inspection	09/2025
(Report on hand)	
Power / Engine displacement	115 kw / 1,395 ccm
Fuel type / Cylinder	Hybr.B/E ext. edition / 4
Gearbox / Number of gears	Automatic / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Uranograu
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	14,200 km
Last maintenance on / at	07/2025 at 131,345 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	FW944129
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	conditional: light/moisture/dirt	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BRZ 00041		
Emission standard	EURO6;WLTP;AM;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,260 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 98W	Summer tires (with run-flat tires) on Light alloy	Continental	6mm / 6mm
2)	215/55 R17 98W	Summer tires (with run-flat tires) on Light alloy	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94H	Winter tires (with run-flat tires) on Light alloy	Continental	6mm / 6mm
2)	215/55 R17 94V	Winter tires (with run-flat tires) on Light alloy	Bridgestone	7mm / 7mm

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



Equipment

Equipment

- Klimaanlage

Standard equipment

- | | |
|--|--|
| <ul style="list-style-type: none"> • Airbag for driver and front passenger • Anti-lock braking system (ABS) • Automatic distance control ACC "stop & go", including speed limiter • Hill start assist • Headlining in Mistral Grey • tachometer • Electronic parking brake including auto-hold function • Electronic stabilization program and electromechanical brake booster • Pedestrian detection • Luggage compartment floor can be raised • Interior light front and rear with switch-off delay and dimming function • Instrument cluster with electronic speedometer, odometer, trip meter, tachometer • Front headrests • LED taillights • Steering wheel: Multifunction sports steering wheel in leather, with shift paddles • Multifunction display "Premium" with multi-color display • Navigation system "Discover Media" including "Streaming & Internet" • Emergency braking assistant "Front Assist" (for automatic distance control ACC up to 210 km/h) • Upholstery: "Weave" fabric • Radio accessories: Digital radio reception DAB+ • Tire pressure monitoring indicator (passive) • LED taillights • Leather gearshift knob • Keyless start system without safe lock • Seat belts: three-point automatic seat belt • Start-stop system • Bumpers in body color • Textile floor mats • Warning sound and light for unfastened seat belts at the front and rear | <ul style="list-style-type: none"> • Airbag, head airbag system for front and rear passengers • App-Connect Wireless • Exterior mirrors electrically adjustable and heated • Cup holders (2) front • Brake light, third • Roof rails black • Parking aid - warning signals for obstacles in the front and rear areas • Remote release for the trunk lid • Front windscreen in laminated safety glass, heat and sound insulating • Transmission: 6-speed DSG • ISOFIX anchorage points • Air Care Climatronic air conditioning system with 3-zone temperature control and allergen filter • Headrests (3) rear • Paint finish: Uni • LED headlights with daytime running lights • Headlight range adjustment • Make-up mirrors in the sun visors • Fatigue detection • Mesh partition • Non-smoking version • Emergency call service • Package: Light and Vision Package "Plus" • Proactive occupant protection system in conjunction with "Front Assist" • Wheels: 4 light alloy wheels "Montpellier" 7 J x 17 • Rear seat bench undivided, backrest asymmetrically divided and foldable, with center armrest • Power steering • Seats: Front seats height adjustable • 12V socket on the rear center console • Telephone interface • First aid kit, warning triangle and safety vest • Electronic immobilizer • Black trim strips on the side windows |
|--|--|

Extra equipment

- | | |
|--|--|
| <ul style="list-style-type: none"> • Trailer hitch, foldable • Roof rails black with 2 support bars silver anodized • Cable for AC charging station • Navigation system "Discover Pro" including "Streaming & Internet" • Package: "Easy Open & Close" package including safe security • Package: Winter | <ul style="list-style-type: none"> • Trailer hitch, foldable 1M6 • Anti-theft alarm system • Steering wheel: Multifunction sports steering wheel in leather, heated, with shift paddles • Package: "Business Premium" package including navigation (from Business) |
|--|--|



- Wheels: Tire Mobility Set no longer available
- Rear side windows and rear window tinted
- Voice control
- Surrounding view "Area View" including rear view camera "Rear View" in Business Premium

- Package: Driver Assistance Package "Plus" including IQ.LIGHT - LED matrix headlights in conjunction with the Business Package
- Seats: ergoComfort seat with 14-way electric adjustment, memory and massage on the driver's seat. In conjunction with the Business Package.

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	A proper visual inspection of the paintwork and bodywork was only possible to a limited extent due to insufficient lighting conditions/wetness or dirt. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Floor mats - Holes - Replace
2	Wing mirror - right side	Cap - Scratched - Smart repair
3	Roof	Roof rail - left side - Scratched - Smart repair
4	Roof	Roof rail - right side - Scratched - Smart repair
5	Front bumper	Cover bumper - front (Materialabtrag) - Scratched - Replace
6	Side panel - rear right side	Side panel - dent(s) - Smooth repair work
7	Side panel - rear right side	Sill - dent(s) - Smooth repair work
8	Side panel - rear left side	Side panel - dent(s) - Smooth repair work
9	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work
10	Side panel - rear left side	Sill - dent(s) - Smooth repair work
11	Front bumper	Spoiler (Materialabtrag) - Scratched - Replace
12	Front bumper	Front bumper - Scratched - Paint
13	Rear bumper	Rear bumper - Scratched - Paint
14	Door - rear right side	Door - dent(s) - Repair and paint
15	Door - rear left side	Door - Dent / paintcoat damage - Repair and paint
16	Door - front right side	Door - Scratched - Paint
17	Door - front left side	Door - Scratched - Paint
18	Vehicle glazing	Rear window - Scratched - Replace
19	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Mudguard - right side	Mudguard - right side - Stone chips - No deduction
3	Tail light	Tail lamp - left side - Scratched - No deduction

The vehicle shows signs of wear commensurate with its age and use.



Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Apparently, no repaired previous damage could be found on the vehicle.

Comments

Der beiliegende Radsatz ist nicht Bestandteil der vorliegenden Fahrzeugausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

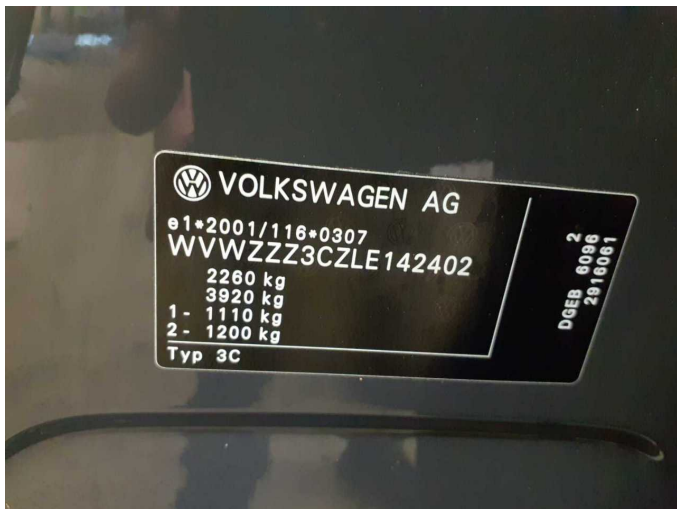


Figure 11: VIN



Figure 12: Mounted tyres

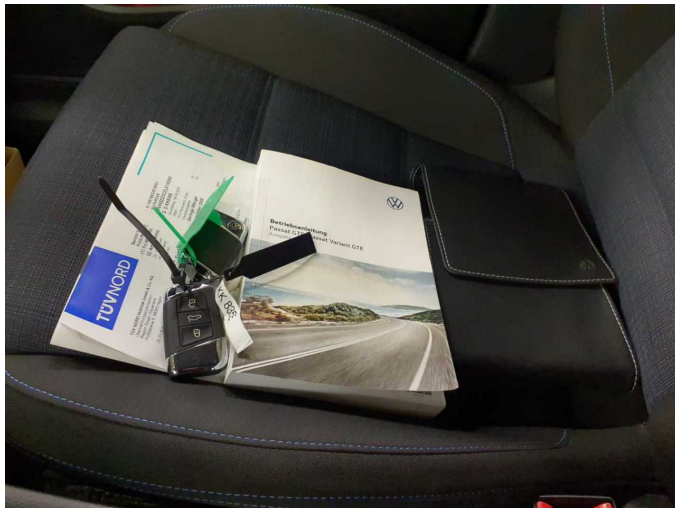


Figure 13: Documents

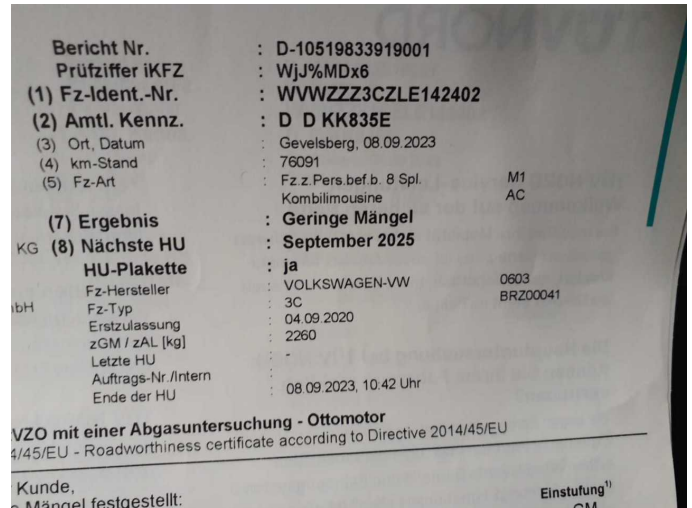


Figure 14: Documents

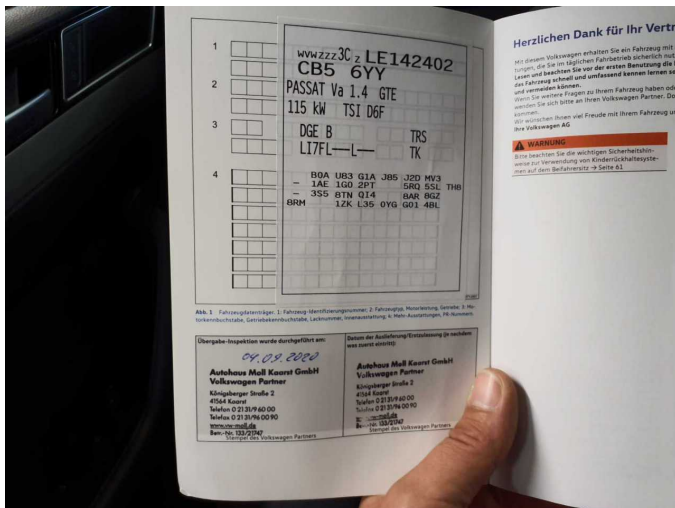


Figure 15: Documents



Figure 16: Documents

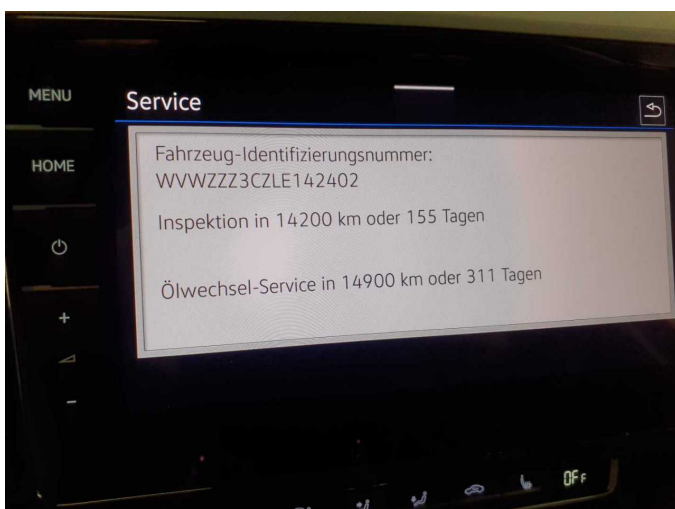


Figure 17: Documents



Figure 18: Additional tyres



Figure 19: Additional tyres



Figure 20: Navigation

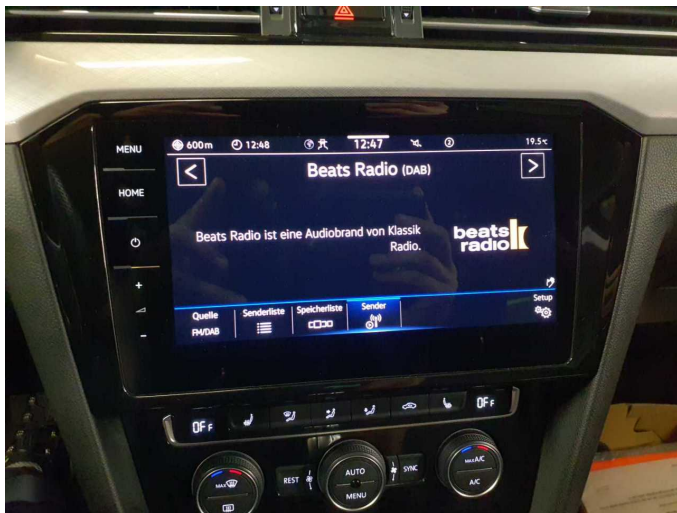


Figure 21: Misc.

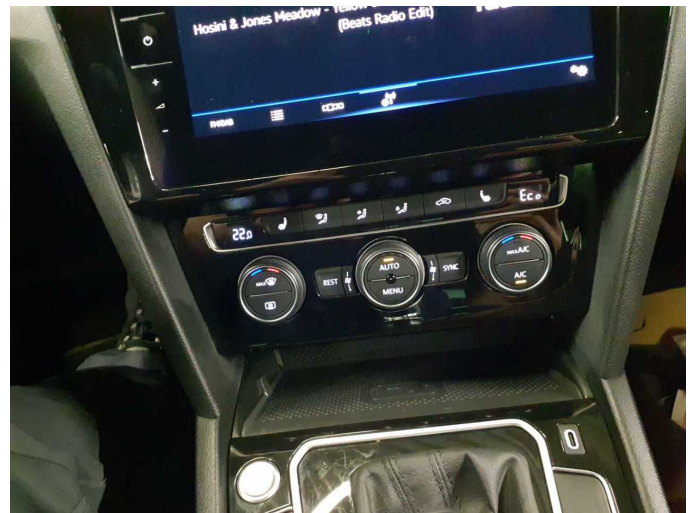


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

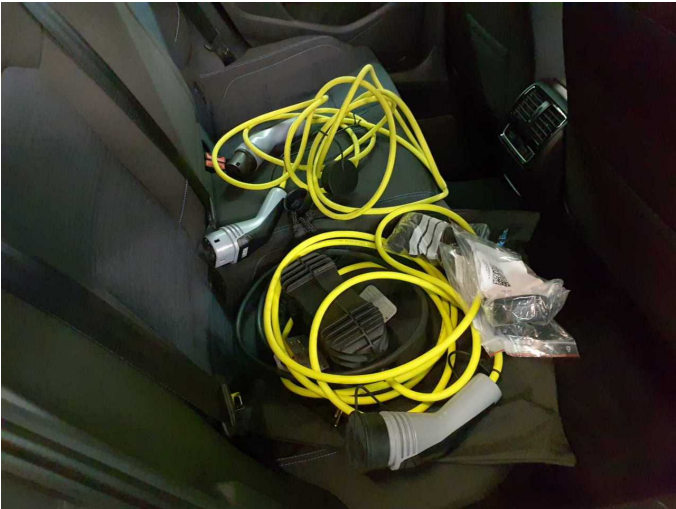


Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Figure 38: Misc.

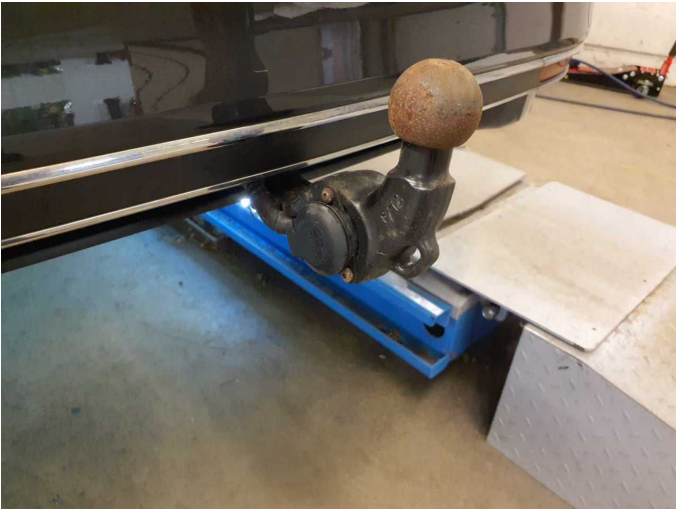


Figure 39: Misc.



Figure 40: Misc.



Figure 41: Misc.



Figure 42: Misc.



Figure 43: Misc.



Figure 44: Misc.



Figure 45: Misc.



Figure 46: Misc.




Figure 47: Misc.




Figure 48: Misc.



Figure 49: Misc.

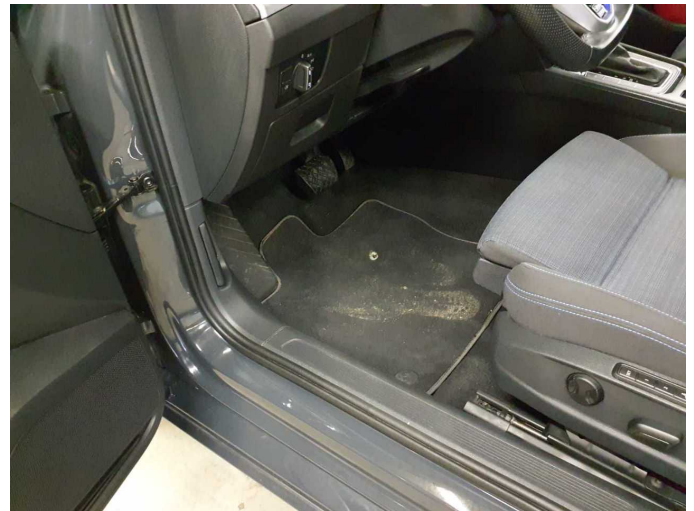

Damage 1: Trim / covers: Floor mats - Holes - Replace

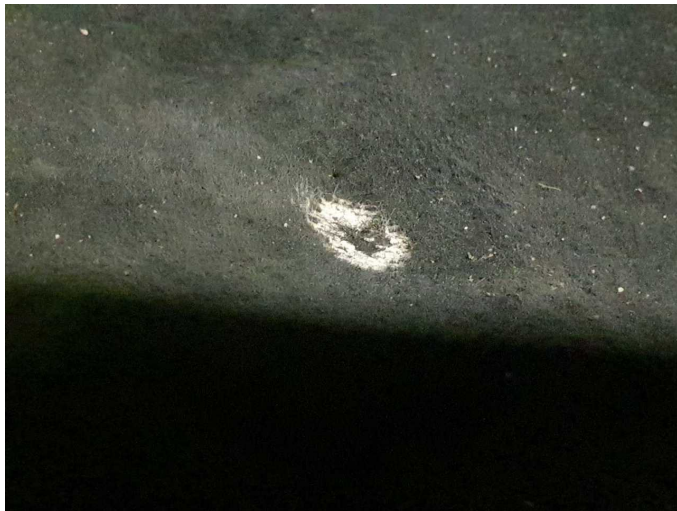


Damage 1: Trim / covers: Floor mats - Holes - Replace




Damage 1: Trim / covers: Floor mats - Holes - Replace



Damage 2: Wing mirror - right side: Cap - Scratched - Smart repair

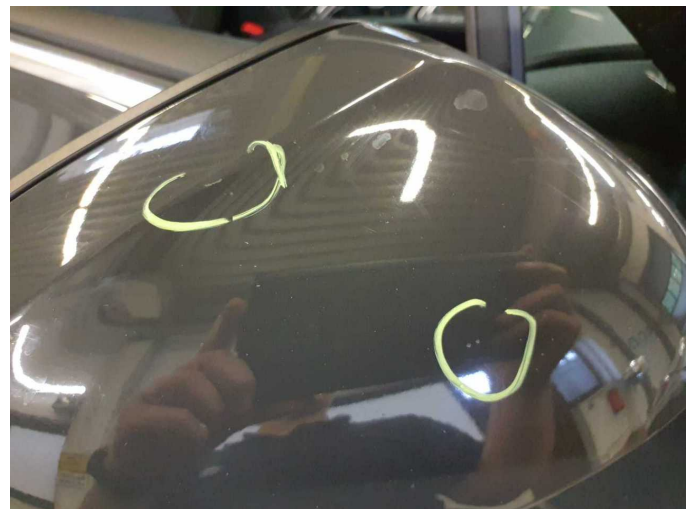

Damage 2: Wing mirror - right side: Cap - Scratched - Smart repair

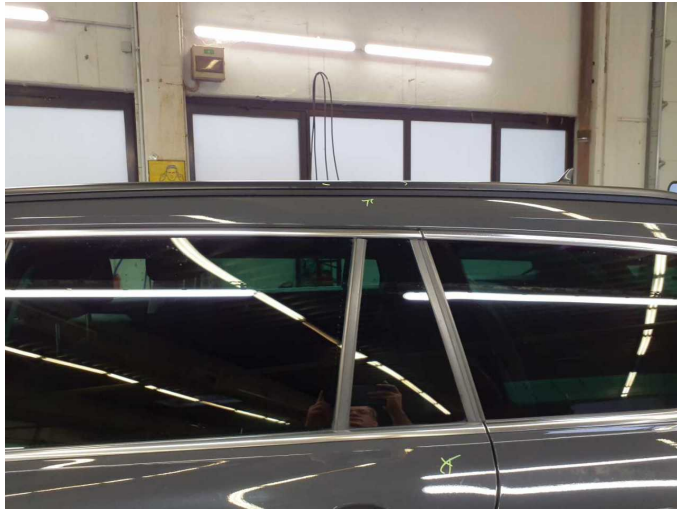

Damage 3: Roof: Roof rail - left side - Scratched - Smart repair



Damage 3: Roof: Roof rail - left side - Scratched - Smart repair



Damage 4: Roof: Roof rail - right side - Scratched - Smart repair



Damage 4: Roof: Roof rail - right side - Scratched - Smart repair




Damage 5: Front bumper: Cover bumper - front (Materialabtrag) - Scratched - Replace




Damage 5: Front bumper: Cover bumper - front (Materialabtrag) - Scratched - Replace



Damage 5: Front bumper: Cover bumper - front (Materialabtrag) - Scratched - Replace

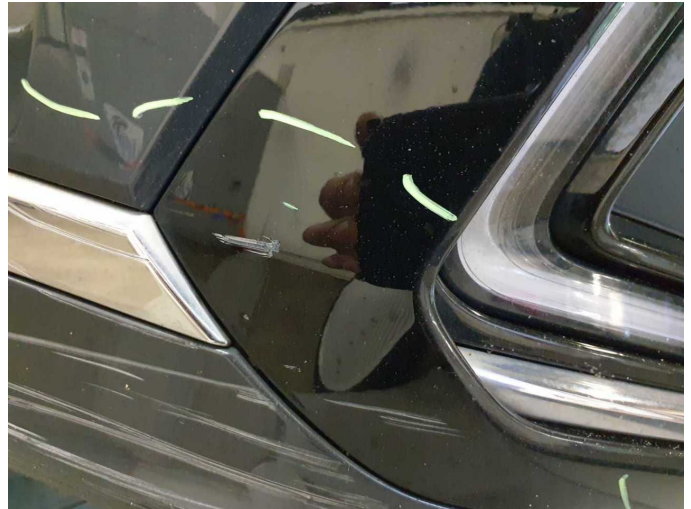


Damage 5: Front bumper: Cover bumper - front (Materialabtrag) - Scratched - Replace

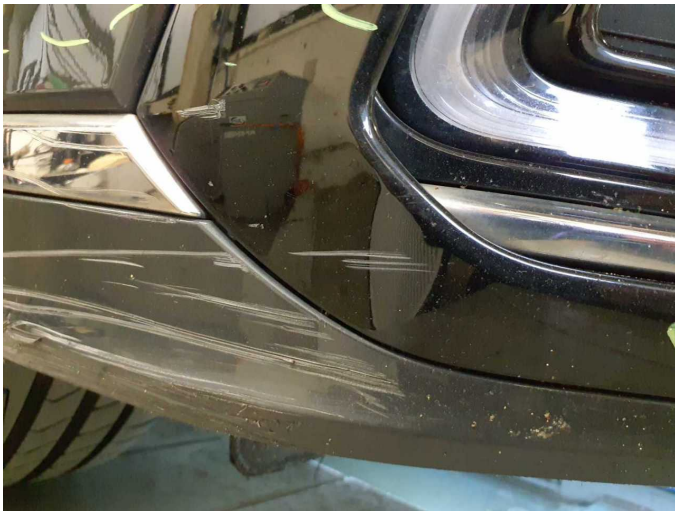


Damage 5: Front bumper: Cover bumper - front (Materialabtrag) - Scratched - Replace



Damage 6: Side panel - rear right side: Side panel - dent(s) - Smooth repair work

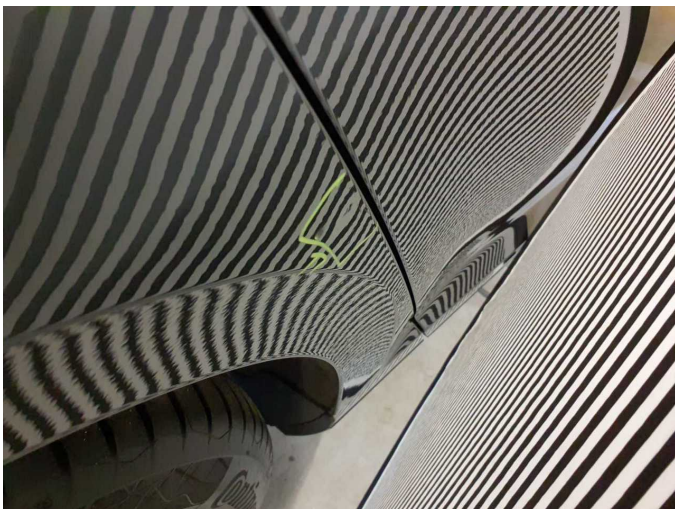

Damage 6: Side panel - rear right side: Side panel - dent(s) - Smooth repair work

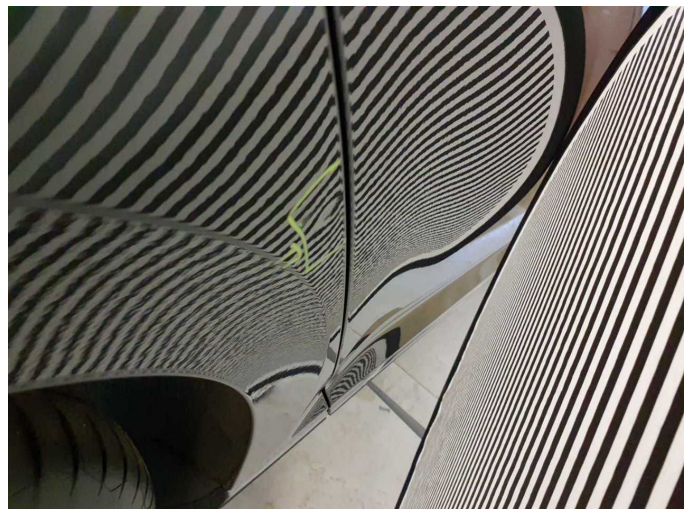

Damage 6: Side panel - rear right side: Side panel - dent(s) - Smooth repair work




Damage 7: Side panel - rear right side: Sill - dent(s) - Smooth repair work




Damage 7: Side panel - rear right side: Sill - dent(s) - Smooth repair work



Damage 8: Side panel - rear left side: Side panel - dent(s) - Smooth repair work

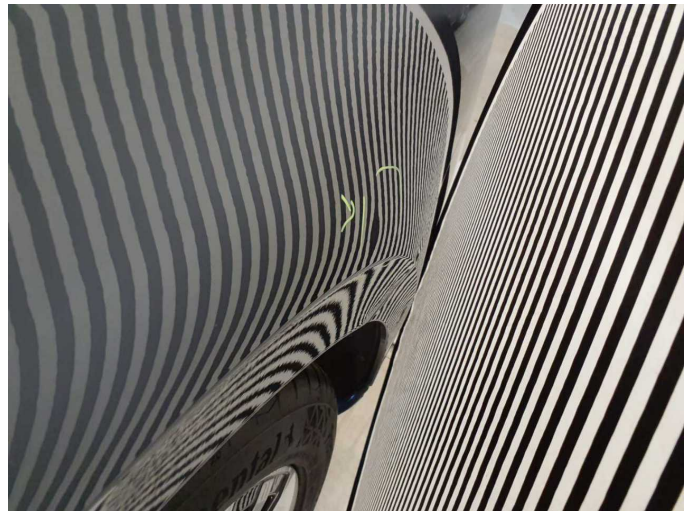


Damage 8: Side panel - rear left side: Side panel - dent(s) - Smooth repair work

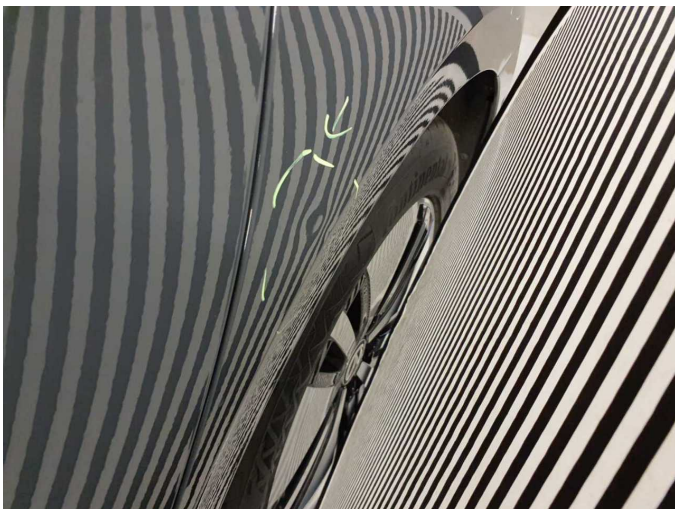


Damage 8: Side panel - rear left side: Side panel - dent(s) - Smooth repair work




Damage 8: Side panel - rear left side: Side panel - dent(s) - Smooth repair work

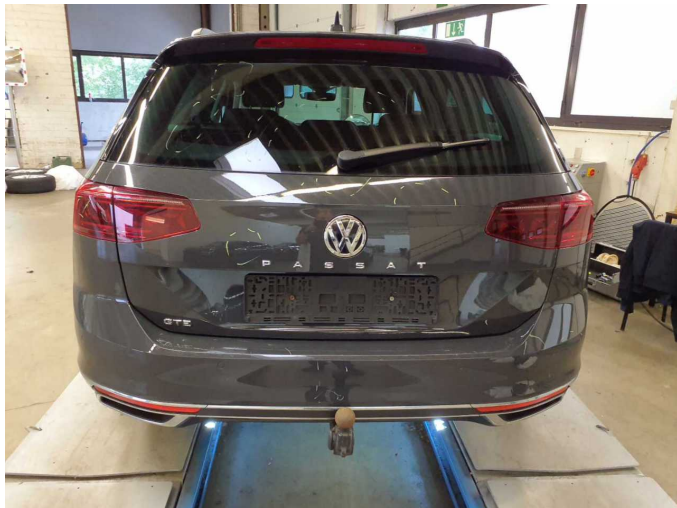


Damage 9: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

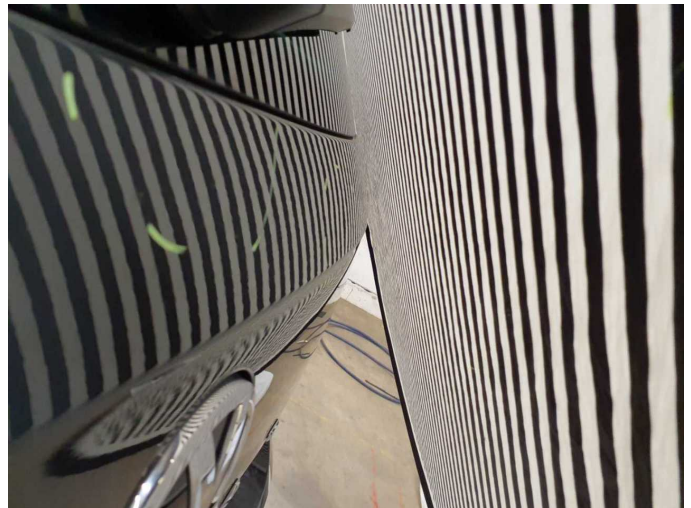


Damage 9: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

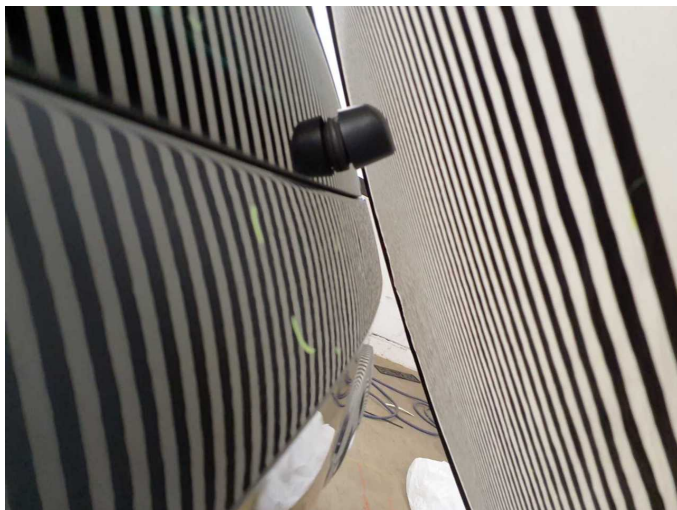


Damage 9: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

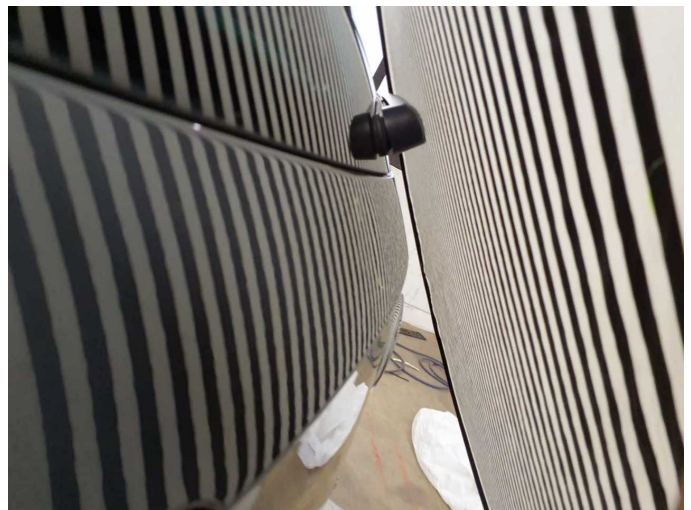

Damage 9: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

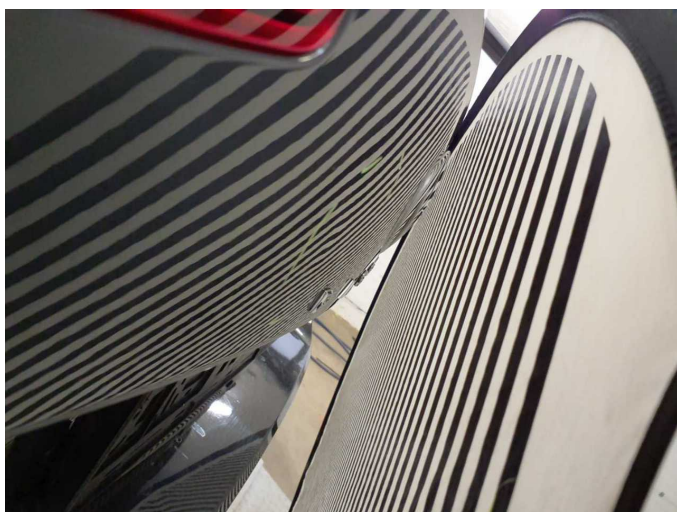


Damage 9: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

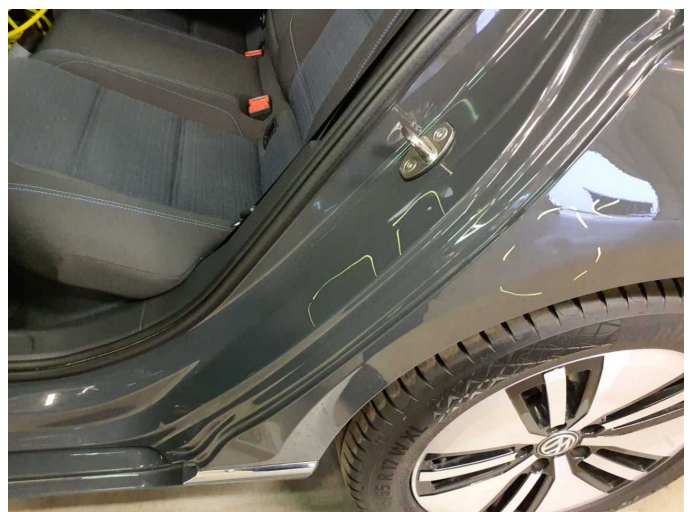


Damage 10: Side panel - rear left side: Sill - dent(s) - Smooth repair work



Damage 10: Side panel - rear left side: Sill - dent(s) - Smooth repair work

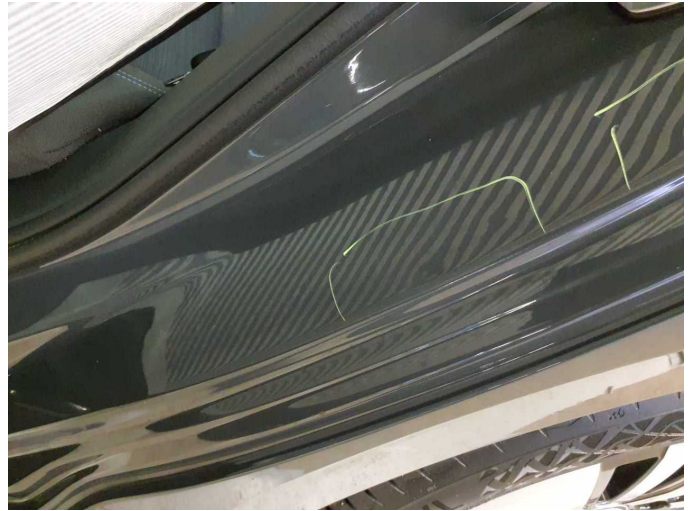

Damage 10: Side panel - rear left side: Sill - dent(s) - Smooth repair work

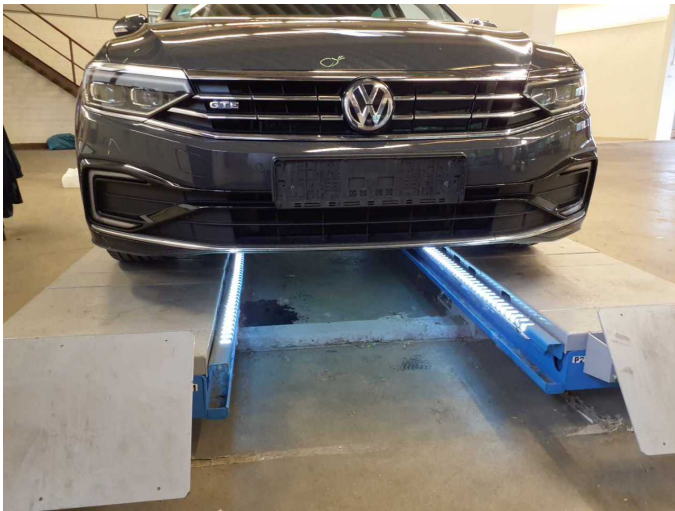

Damage 11: Front bumper: Spoiler (Materialabtrag) - Scratched - Replace



Damage 11: Front bumper: Spoiler (Materialabtrag) - Scratched - Replace




Damage 11: Front bumper: Spoiler (Materialabtrag) - Scratched - Replace



Damage 11: Front bumper: Spoiler (Materialabtrag) - Scratched - Replace



Damage 11: Front bumper: Spoiler (Materialabtrag) - Scratched - Replace

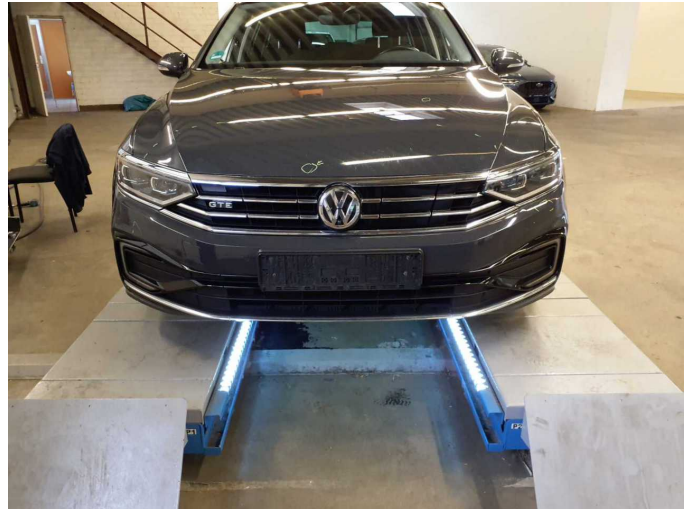

Damage 12: Front bumper: Front bumper - Scratched - Paint



Damage 12: Front bumper: Front bumper - Scratched - Paint




Damage 12: Front bumper: Front bumper - Scratched - Paint



Damage 12: Front bumper: Front bumper - Scratched - Paint



Damage 12: Front bumper: Front bumper - Scratched - Paint

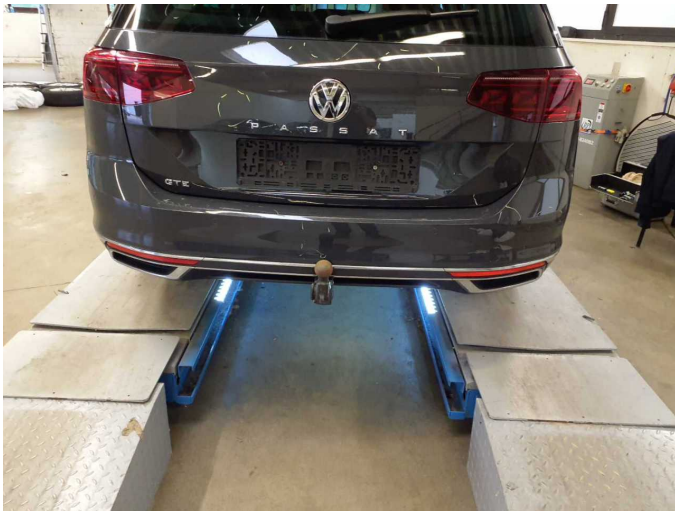

Damage 13: Rear bumper: Rear bumper - Scratched - Paint



Damage 13: Rear bumper: Rear bumper - Scratched - Paint



Damage 13: Rear bumper: Rear bumper - Scratched - Paint



Damage 13: Rear bumper: Rear bumper - Scratched - Paint



Damage 13: Rear bumper: Rear bumper - Scratched - Paint



Damage 13: Rear bumper: Rear bumper - Scratched - Paint




Damage 14: Door - rear right side: Door - dent(s) - Repair and paint



Damage 14: Door - rear right side: Door - dent(s) - Repair and paint



Damage 14: Door - rear right side: Door - dent(s) - Repair and paint

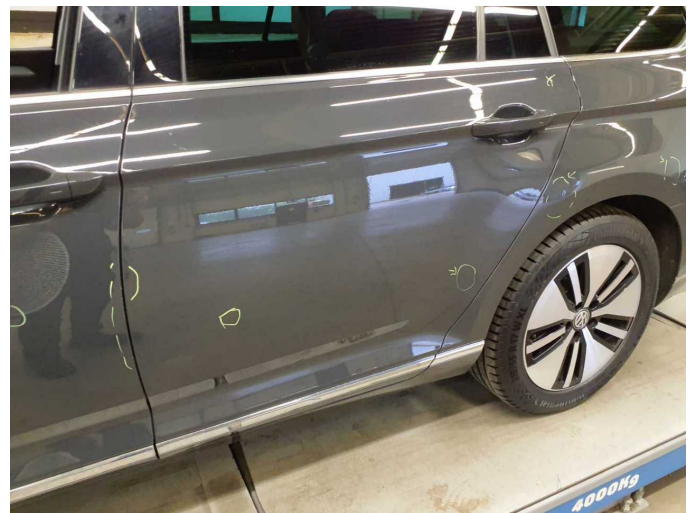

Damage 15: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 15: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint




Damage 15: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint




Damage 15: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 16: Door - front right side: Door - Scratched - Paint

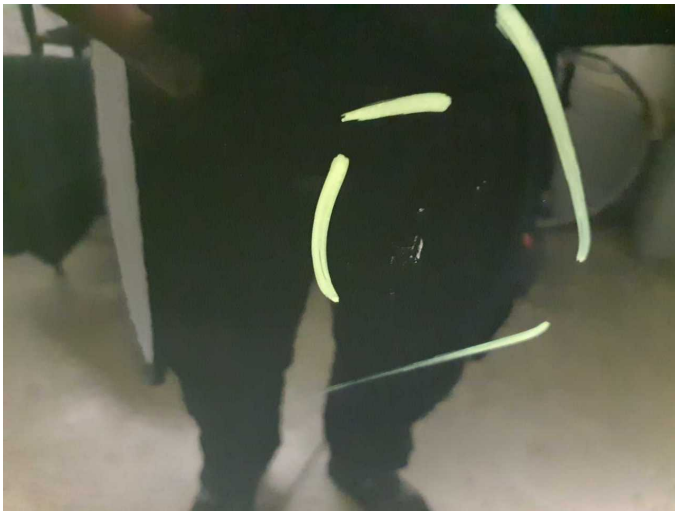

Damage 16: Door - front right side: Door - Scratched - Paint

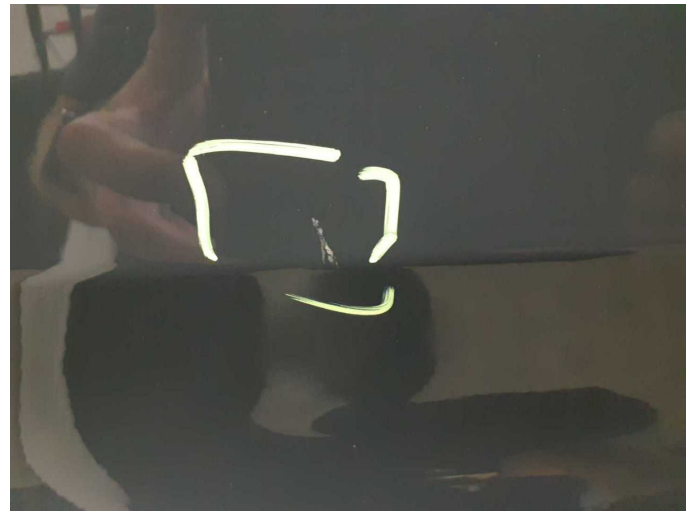

Damage 16: Door - front right side: Door - Scratched - Paint




Damage 17: Door - front left side: Door - Scratched - Paint



Damage 17: Door - front left side: Door - Scratched - Paint



Damage 17: Door - front left side: Door - Scratched - Paint

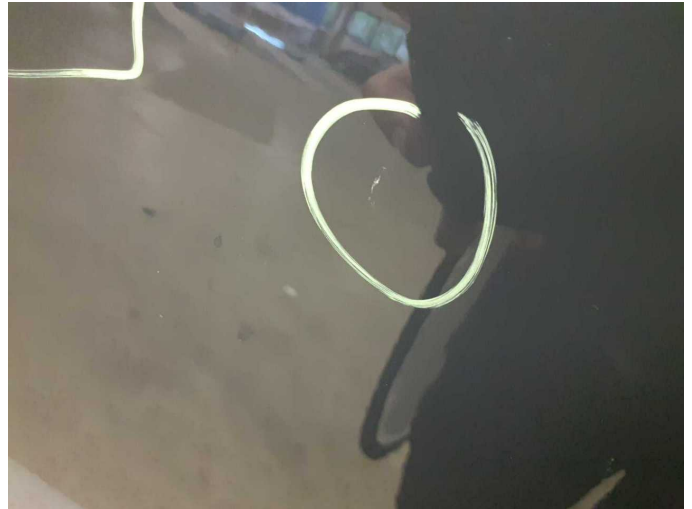


Damage 17: Door - front left side: Door - Scratched - Paint




Damage 17: Door - front left side: Door - Scratched - Paint



Damage 18: Vehicle glazing: Rear window - Scratched - Replace

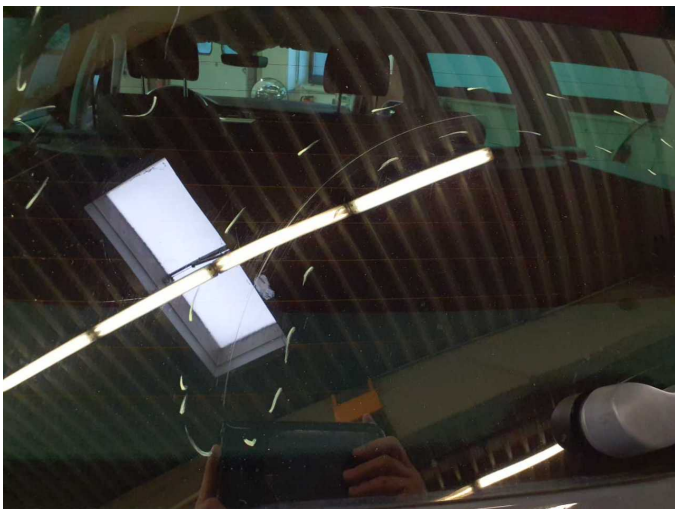

Damage 18: Vehicle glazing: Rear window - Scratched - Replace

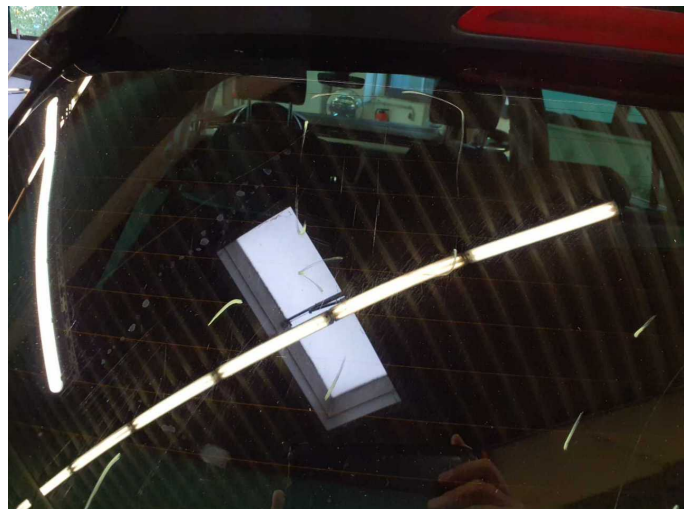

Damage 18: Vehicle glazing: Rear window - Scratched - Replace




Damage 18: Vehicle glazing: Rear window - Scratched - Replace




Damage 19: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint




Damage 19: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

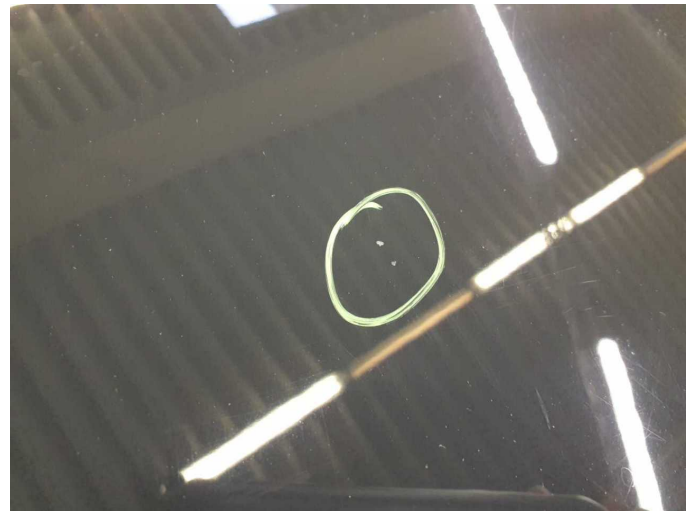

Damage 19: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

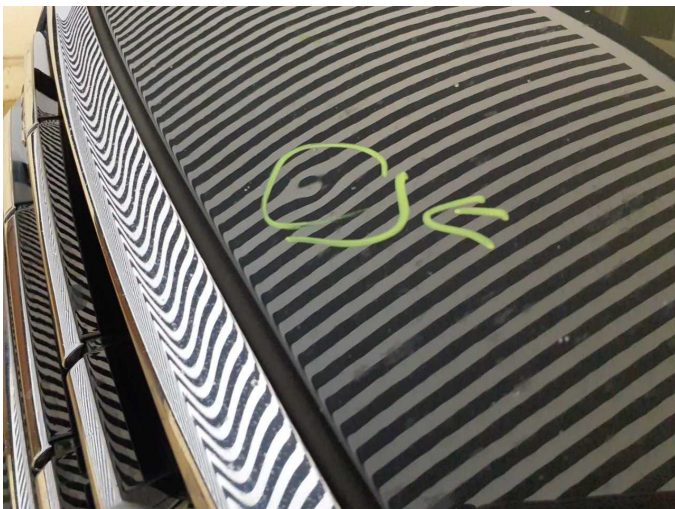

Damage 19: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

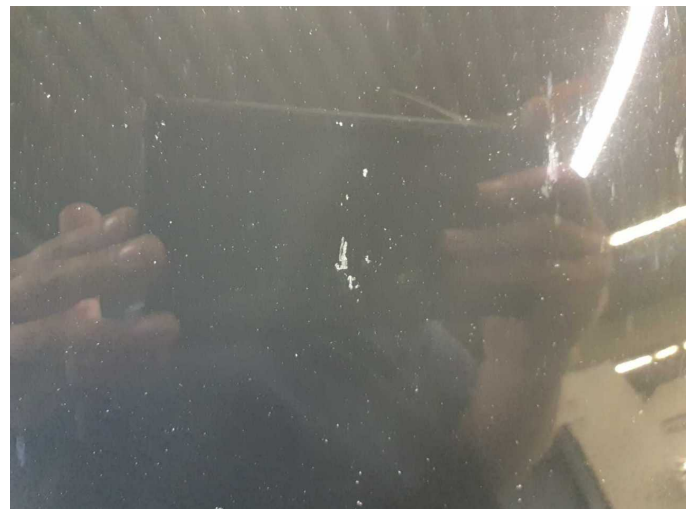

Damage 19: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Wear and tear 3: Tail light: Tail lamp - left side - Scratched - No deduction



Wear and tear 3: Tail light: Tail lamp - left side - Scratched - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVVZZZ3CZLE142402
Hersteller / Modell: VOLKSWAGEN VW Passat Variant 1.4 TSI Plug-In-Hybrid DSG
GTE

Datum	KM-Stand	Beschreibung
17.07.2025	131.345	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben hinten; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
17.02.2025	116.115	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
15.08.2024	103.173	Systemtest/Eigendiagnose
05.07.2024	98.862	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
15.03.2024	91.160	Bremse Sonstiges; Bremsscheiben + Klötze v; Bremsscheiben vorne; Luftfiltereinsatz ern; Regelwartungsdienst
30.10.2023	81.510	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
08.09.2023	76.091	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; HU + AU; Reparatur Sonstiges; Systemtest/Eigendiagnose
03.03.2023	63.533	Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Wartung Sonstiges; Zündkerzen ern
21.09.2022	48.798	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
11.03.2022	33.168	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
21.06.2021	16.102	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges