

status report

customer: Bank 11, Neuss
contract number: 922079830
reference:

vehicle data

Volkswagen up! move up!

Vehicle identification number	VWVZZZAAZED040669	mileage estimated:	999999 km
First Registration / construction year:	09.10.2013 / 2013	Visit Date / place of birth:	23.06.2025 Neuss
Bodywork:	cars	Re - import:	no
Body type:	small car	KBA no. :	0603//BGU
Fuel / emission class:	gasoline / € 5	transmission type:	manual transmission
Displacement / power:	999 ccm / 44 kW (60 PS)	Engine:	front-wheel drive
paint:	white	Number of previous owners:	2
Doors / seats:	5 / 4	number keys:	1
Next HU / AU:	- / -	cushion type:	substance
Service book available:	yes	Interior Color:	gray
smoking vehicle:	yes	Last service km / on the:	- / -
Vehicle roadworthy:	no	Vehicle roadworthy:	no
Submitted vehicle	-	state outside:	3 - Average
documents:		condition inside:	3 - Average
visit condition:	-		
state general:	3 - Average		

Accessories (presented to the visiting time)

GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
SD Card	1	yes / -	- / -

☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available** ☒ **not available**

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires		
Tyre / wheel type:	Winter tires	Steel with wheel cover
1st axis - Left / states .	Kleber	165/70/R14/81T 3 mm
1st axis - right / states .	Kleber	165/70/R14/81T 3 mm
2nd axis - Left / states .	Kleber	165/70/R14/81T 4 mm
2nd axis - right / states .	Kleber	165/70/R14/81T 4 mm
traffic Safety:	not roadworthy	
spare wheel:	-	
state spare wheel:	-	

standard equipment	
• Airbag switched off • Anti- lock braking system (ABS) • Drive Front Wheel Drive • Outside mirror mech. adjustable from the inside • Rev counter • Vehicle without start / stop system • Luggage compartment floor displaced • Glove compartment with flap • rear window wiper • Isofix admissions for child seat in back seat • Comfort Package <i>Sitz vorn links höhenverstellbar, Fensterheber elektrisch vorn, Zentralverriegelung, Fernbedienung für Zentralverriegelung, Doppeltonhorn</i> • Steering wheel (3 spoke) • Engine 1.0 ltr. - 44 kW • Rear fog light • Wheelbase 2421 mm • Tire repair kit • Split rear seat back • Windscreen wiper with interval switching • Controlled electronic power steering (Servotronic) • Sun visor with mirror right • bumper painted • Exterior door handles body color • Immobiliser (electronic)	• Airbag Driver / passenger side • Acceleration skid control (ASR) • painted mirrors • brake Assist • Electron. Stability Program (ESP) • Luggage compartment cover / shade • Transmission 5-speed • heated rear window • Interior mirror dimming • Body 4 doors <i>Ausstellfenster hinten</i> • Rear headrests (2- fold) • Steering column (steering wheel) adjustable in height • Positive Torque Regulator (MSR) • Non smoking package • Wheel Covers • Rear seat folded down • Low emissions Euro 5 emissions standard • Front side airbags with head airbag unit • Seat cover / upholstery fabric • Steel rims 5x14 • Daytime running lights • First aid kit and warning triangle • Tinted heat insulating glass green

special Features	
• Cool \u0026 Sound Package 1 <i>Audiosystem RCD 215 MP3 (Radio/CD-Player), Dachantenne, Multimediabuchse AUX-IN, Klimaanlage</i>	• GPS mobile navigation system (maps + more) • Special paint Candy-white

<i>Climatic</i>	
• Panoramic sunroof electric	

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination	
Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed.
Mileage plausible:	not testable not testable
reference:	
Note Road Safe:	Reifen Verschlissen.

Farbabweichung Plastikteile

Accident injury assessment	
Rep. Predamages / -height gross:	no detectable As part of a paint film thickness measuring the body outer skin no previous damage could be detected .
Layers of paint thickness measurement:	Within the tolerances At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were within the tolerances of original finishes . Evidence that points to a repaired accident damage or repainting carried out , were identified.
Existing collision damage:	Not established On the vehicle body shell were on visual examination found no existing accident damages (other than the usual signs of use) .
reference:	

Overview conducted technology audit			
Alternator / Generator:	✓	not possible	
oil loss:	✓	not possible	
air conditioning:	✓	not possible	
coupling:	✓	not possible	
engine running:	✓	not possible	
transmission:	✓	not possible	
Battery / accumulator:	✓	not possible	
lighting system:	✓	not possible	
exhaust System:	✓	not possible	
shock absorber:	✓	not possible	

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) could not be verified .
Battery / accumulator:	The battery (accumulator) could not be checked during the inspection .
oil loss:	The vehicle could not be checked during the inspection on oil losses.
air conditioning:	The air conditioning could not be checked during the inspection .
lighting system:	The lighting system could not be tested for visiting time . **No power supply.
coupling:	The coupling could not be checked during the inspection .
exhaust System:	The exhaust system could not be checked during the inspection .
engine running:	A field test of the engine could not be performed
shock absorber:	The shock absorber could not be checked during the inspection .
transmission:	The transmission could not be checked for visiting time .
reference:	*Das Fahrzeug ist nicht fahrbereit. Motor- oder Getriebebeschäden sind nicht auszuschließen. Alters-, Transport- und Laufleistungsbedingte Gebrauchsspuren vorhanden. Kosten- und Schadensenerweiterung möglich. Die Laufleistung wurde geschätzt. Das Fahrzeug hat trotz Überbrückung keine Bordspannung. Schäden und Folgeschäden sind nicht ausgeschlossen. Aufgrund der fehlenden Bordspannung ist der Test Diverse Bauteile nicht möglich. Schäden sind nicht ausgeschlossen.

damage



component	Damage	Rep kind
1. tire front - right	Worn	Replace
2. tire front - left	Worn	Replace
3. maintenance	Due	Replace
4. Key with remote control	Missing	Replace
5. Rear bumper	Scratch(es)	Paint
6. roof	Deformed	Refurbish and paint
7. Sidewall - Rear - Left	Damaged	Refurbish and paint
8.	Missing	Replace
9.	Missing	Replace
10. Türeinstieg Hinten - Links	Damaged	Refurbish and paint
11. Hubcap - Rear - Left	Wear and tear	acceptable
12. Front door - left	Damaged	Refurbish and paint
13. Türeinstieg Hinten - Rechts	Damaged	Paint
14. side skirt - left	Damaged	Refurbish and paint
15.	Missing	Replace
16.	Odour	Ozone treatment
17. flooring	Burn hole	Replace
18. Side window - Rear - Left	Damaged	Replace
19. Outside mirror - left	Scratch(es)	Replace
20. Radkappe - Vorne - Links	Damaged	Replace
21. Halogen headlights - left	Scratch(es)	Replace
22. hood	Scratch(es)	Paint
23. Front bumper	Scratch(es)	Paint
24. spoiler	Scrape	Replace
25. Radkappe - Vorne - Rechts	Damaged	Replace
26. Front fender - right	Scratch(es)	Paint
27. Dach Vorne	Damaged	Refurbish and paint
28. Windshield	Damaged	Replace
29.	Missing	Replace
30. Türeinstieg Vorne - Rechts	Scratch(es)	Paint
31. Door Rear - right	Scratch(es)	Paint
32. Sidewall - Rear - right	Damaged	Refurbish and paint
33. Radkappe - Hinten - Rechts	Damaged	Replace
34. Türeinstieg Hinten - Rechts	Damaged	Refurbish and paint
35. Side window - Rear - right	Damaged	Replace
36.	Dirty	
37. Front door - right	Damaged	Refurbish and paint
38. motor	Not Jumps On	Carry out a fault diagnosis
39. battery	Defective	Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims




rims



rims



engine compartment

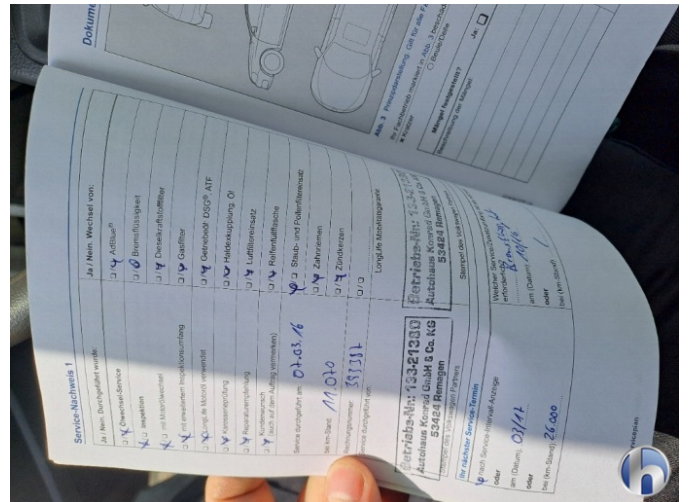

service book



Others



1. tire front - right



1. tire front - right



2. tire front - left



2. tire front - left



5. Rear bumper



5. Rear bumper




6. roof



6. roof



7. Sidewall - Rear - Left

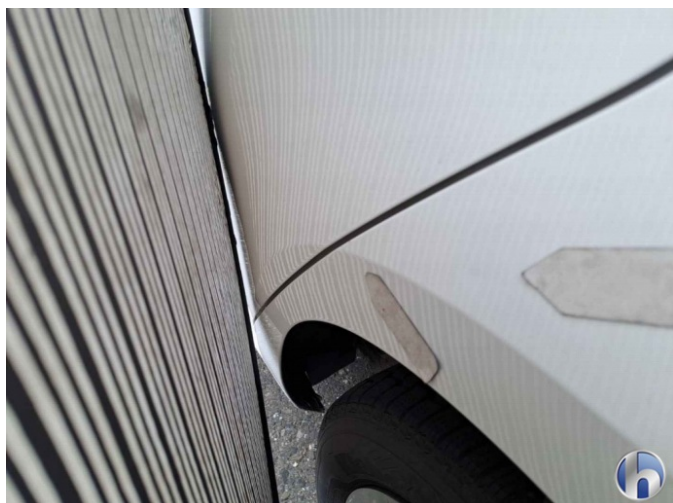

7. Sidewall - Rear - Left



7. Sidewall - Rear - Left



8.



9.



10. Türeinstieg Hinten - Links



10. Türeinstieg Hinten - Links



10. Türeinstieg Hinten - Links



11. Hubcap - Rear - Left



11. Hubcap - Rear - Left



12. Front door - left



12. Front door - left



13. Türeinstieg Hinten - Rechts



13. Türeinstieg Hinten - Rechts



14. side skirt - left



14. side skirt - left



14. side skirt - left



15.



17. flooring



17. flooring



18. Side window - Rear - Left



18. Side window - Rear - Left



19. Outside mirror - left



20. Radkappe - Vorne - Links



20. Radkappe - Vorne - Links



21. Halogen headlights - left



21. Halogen headlights - left



21. Halogen headlights - left



22. hood



22. hood



23. Front bumper



23. Front bumper



24. spoiler



24. spoiler



25. Radkappe - Vorne - Rechts



25. Radkappe - Vorne - Rechts



26. Front fender - right



26. Front fender - right



27. Dach Vorne



27. Dach Vorne



28. Windshield



28. Windshield



28. Windshield



29.



30. Türeinstieg Vorne - Rechts



30. Türeinstieg Vorne - Rechts



31. Door Rear - right



31. Door Rear - right



31. Door Rear - right



32. Sidewall - Rear - right



32. Sidewall - Rear - right



32. Sidewall - Rear - right



33. Radkappe - Hinten - Rechts



33. Radkappe - Hinten - Rechts



34. Türeinstieg Hinten - Rechts



34. Türeinstieg Hinten - Rechts



35. Side window - Rear - right



35. Side window - Rear - right



36.



36.



36.



37. Front door - right



37. Front door - right



37. Front door - right