



**VOLVO V60: 1YNF926**

Vinnnumber:	<b>YV1ZW72VDM2416178</b>	Versionname:	<b>V60 D3 Geartronic Inscription 110kW/150pk 5D/P</b>
First Registrationdate:	<b>9/10/2020</b>	Fiscalpower:	<b>Auto-8</b>
Expertise Mileage:	<b>114202</b>	Power Kw:	
Bodytype:		Body colour:	<b>Grey</b>
Gearbox:	<b>Automatic</b>	Type of rims (mounted):	<b>Aluminium</b>
Transmission:	<b>Front</b>	Parking lot:	<b>c323</b>
Fueltype:	<b>Diesel</b>		
Number of doors:	<b>5</b>		
Number of seats:	<b>5</b>		
Number head rests:	<b>5</b>		
Type of rims (mounted):	<b>Aluminium</b>		
Certificate of Conformity:	<b>Yes</b>		
Category:	<b>Passenger Car</b>		
Registration Certificate Car (BE):	<b>Yes</b>		
Bodywork:	<b>Clean</b>		
Interior:	<b>Clean</b>		

**Options**

Number of keys total:	<b>2</b>	Radio	
Number keys remote:	<b>2</b>	Lining leather	
Windows electric F:		Front parking sensors	
Windows electric R:		Rear parking sensors	
Cruise Control		Fog lights (front)	
Steering wheel multifunctional			
Seats F heated			
Alarm			
Navigation with screen			
Airco electronic			
Rims alloy			

**Limited Technical Inspection**

Idle position:	<b>OK</b>	Sound engine:	<b>OK</b>
Engine startingtime:	<b>OK</b>	Clutch test:	<b>OK</b>
Exhaust gass:	<b>OK</b>	Transmission:	<b>OK</b>

**Tyres**

235/45/18/98 V				
Summer tyres:	Fr.L.	Michelin: 3 mm	Fr.R.	Michelin: 3 mm
	Re.L.	Uniroyal: 3 mm	Re.R.	Uniroyal: 3 mm
Tyre profile depth FL				3.0
Tyre profile depth FR				3.0
Tyre profile depth RL				3.0
Tyre profile depth RR				3.0
Tyre size FL				235/45 R 18 98 V
Tyre size FR				235/45 R 18 98 V
Tyre size RL				235/45 R 18 98 V
Tyre size RR				235/45 R 18 98 V
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				261
Tyre make FR				261
Tyre make RL				265
Tyre make RR				265

**Assistance equipment**

Repair kit:	<b>Yes</b>	Compressor:	<b>Yes</b>
Number of charging cables (normal):	<b>0</b>		

Number of charging cables (rapid charge)

0

Steering wheel, Worn, Acceptable



Seat cover R, Stain, Cleaning




Ignition key, Worn, Acceptable



Floor covering FL, Burned, Smart repair



Interior covering A pillar L, Burned, Smart repair

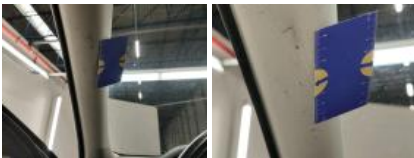


Certificate Of Conformity, Damaged, Acceptable



Interior, Smell, Ozone treatment



Bumper F, Scratch(es), Spot repair

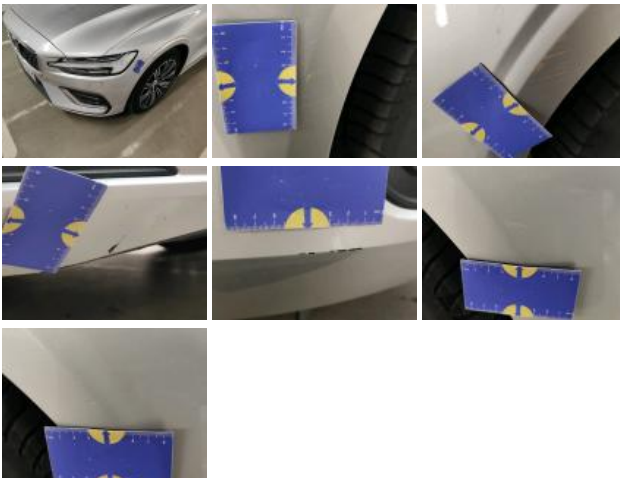

Windscreen moulding, Scratch(es), Acceptable



Alloy rim FL polished, Scratch(es), Repair and paint (complete)



Tyre FL, Worn, Acceptable




Central pillar L, Dent(s) and scratch(es), Spot repair



Roof pillar L, Scratch(es), Acceptable



Wing RL, Scratch(es), Acceptable

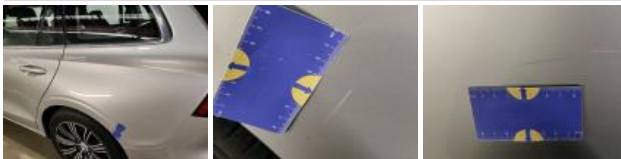

Boot lid covering R, Scratch(es), Smart repair



Tailgate / Boot, Dent(s), Repair and paint (complete)



Bumper R, Scratch(es), Spot repair



Parking sensor R, Not functioning (well), Check



Alloy rim FR polished, Scratch(es), Repair and paint (complete)



Outside rear-view mirror housing R, Scratch(es), Repair and paint (complete)



Alloy rim RR polished, Scratch(es), Repair and paint (complete)



Tyre RR, Tear, Acceptable



Tyre FR, Worn, Acceptable



Bodywork, No damage, Acceptable

