



status report

customer:	Bank 11, Neuss
contract number:	1281902630
reference:	

vehicle data			
Fiat Punto Lim. 1.4 16V Emotion			
Vehicle identification number	ZFA18800004916760	mileage read:	98964 km
∴			
First Registration / construction year:	08.03.2005 / 0	Visit Date / place of birth:	21.07.2025 Dorfmark
Bodywork:	cars	Re - import:	no
Body type:	hatchback	KBA no. :	4136//056
Fuel / emission class:	gasoline / € 4	transmission type:	manual transmission
Displacement / power:	1368 ccm / 70 kW (95 PS)	Engine:	front-wheel drive
paint:	gray	Number of previous owners:	Unbekannt
Doors / seats:	5 / 5	number keys:	2
Next HU / AU:	10.2024 / 10.2024	cushion type:	substance
Service book available:	yes	Interior Color:	blue
smoking vehicle:	yes	Last service km / on the:	68228 / 02.04.2018
Vehicle roadworthy:	yes	Vehicle roadworthy:	no
Submitted vehicle documents:	For example, I (Fzg.Schein)	state outside:	3 - Average
visit condition:	-	condition inside:	3 - Average
state general:	3 - Average		

Accessories (presented to the visiting time)			
GPS sat nav disk:	Fzg.Schlüssel:	Service book provided / maintained:	Last service at / on:
-	2	yes / -	68228 / 02.04.2018
☒ AHK key	☒ AHK removable	☒ AHK fixed	☒ AHK swivel
☒ Fernbed . entertainment	☒ Fernbed . Auxiliary heating	☒ headphone	☒ LED headlights
☒ Load compartment cover	☒ navigation system	☒ Persenning	☒ partition net
☒ Wind Deflector	☒ Xenon headlights		

☒ **available**

☒ **not available**

Hüsges GmbH
Gießerallee 23
47877 Willich
Tel.: 02154 / 9534 0
E-Mail: gutachten@huesges-group.eu

The status report was created impartially and to the best of my knowledge. The images listed in the status report are part of the vehicle description regarding the equipment and the vehicle condition.



Hüsges Gruppe®
Die Gutachter



mounted tires

Tyre / wheel type:	summer tires	Steel with wheel cover
1st axis - Left / states .	Continental	185/60/R14/82H 5 mm
1st axis - right / states .	Continental	185/60/R14/82H 5 mm
2nd axis - Left / states .	Continental	185/60/R14/82H 5 mm
2nd axis - right / states .	Continental	185/60/R14/82H 5 mm
traffic Safety:	roadworthy	
spare wheel:	Notrad	
state spare wheel:	Gebraucht	

standard equipment

special Features

standard equipment

- | | |
|-------------------|--------------------------------|
| • ABS | • ESP |
| • Power windows | • Driver and passenger airbags |
| • Climate Control | • Headlight range adjustment |
| • power steering | • immobilizer |

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General examination

Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed. Hoist or lifting means not available .
Mileage plausible:	not testable not testable
reference:	
Note Road Safe:	Kupplung verschlissen

Farbabweichung Plastikteile

Accident injury assessment

Rep. Predamages / -height gross:	Expertly repaired On a vehicle coating thickness measurement on the body outer skin were noted repaired previous damage in the frames that were repaired and apparently without disassembly of components without residual traces accident . If there is an impairment of the observed accident before it was taken into account in if conducted vehicle
---	--

**Layers of paint thickness
measurement:**

valuation.

Out of tolerance

At the vehicle , a resist layer thickness measurement was carried out on the body outer skin. The measured values ??were outside the tolerances of original finishes .

Existing collision damage:

Not established

On the vehicle body shell were on visual examination found no existing accident damages (other than the usual signs of use) .

reference:

Overview conducted technology audit							
Alternator / Generator:			examined limited	Battery / accumulator:			
oil loss:			examined limited			examined limited	
air conditioning:			examined limited	lighting system:			examined limited
coupling:			Out of order	exhaust System:			examined limited
engine running:			examined limited	shock absorber:			examined limited
transmission:			examined limited				

Performed testing technology	
Alternator / Generator:	The function of the alternator (generator) was tested using the charging indicator light in the instrument cluster .
Battery / accumulator:	The battery (accumulator) could be considered limited during the visit .
oil loss:	The vehicle could be checked only limited to oil leaks .
air conditioning:	The air conditioning system could be tested only restricted during the visit .
lighting system:	The Lichtenlange could be considered limited to the tour date .
coupling:	The clutch was wrong for visiting time . **clutch judder. Wear limit reached.
exhaust System:	The exhaust system has been tested only restricted during the visit .
engine running:	Checking the engine running was limited. Here no audible or visual abnormalities were noted .
shock absorber:	The shock absorber could be tested only restricted during the visit .
transmission:	The transmission could be examined in the context of limited test drive / pull test .
reference:	*Fahrzeug hat Alter und Laufleistungs bedingte Gebrauchsspuren innen und außen Airbag Fehlermeldung Fehlerdiagnose durchführen lassen Kupplung verschlissen Karosserie Außen teilweise Nachlackiert Marderbiss Motorraum Schaden und Kosten Erweiterung möglich

damage



component	Damage	Rep kind
1. Front fender - right	Subsequently painted	acceptable
2. Front door - right	Subsequently painted	acceptable
3. Door Rear - right	Subsequently painted	acceptable
4. Sidewall - Rear - right	Subsequently painted	acceptable
5. maintenance	Due	Replace
6.	Error message	Carry out a fault diagnosis
7. coupling	Worn	Replace
8. tailgate	Delle	Smart repair
9. Rear door - left	Deformed	Refurbish and paint
10. Sidewall - Rear - Left	Damaged	Refurbish and paint
11. side skirt - left	Rust	Smart repair
12. Front door - left	Deformed	Refurbish and paint
13. Front bumper	Scrape	Smart repair
14. Halogen headlights - left	Damaged	Replace
15. Halogen headlights - right	Damaged	Replace
16. Türgriff VR	Scrape	Smart repair
17. Door Rear - right	Damaged	Paint
18. Sidewall - Rear - right	Scrape	Smart repair
19. side skirt - right	Rust	Smart repair
20. Hubcap - Rear - right	Scratch(es)	Replace
21. exterior body	Surface scratch(es)	
22.	Wear and tear	acceptable
23.	Dirty	
24.	Odour	Ozone treatment
25. Sun visor with mirror	Missing	Replace
26. Radio	No functionality	Carry out a fault diagnosis
27. tailgate trim	Scrape	Replace
28. Door trim Rear - right	Damaged	Replace
29. motor insulation		Replace

The expert points out that the vehicle in addition to age to the damage listed in the report and may have a high mileage -related wear , as in normal use are inevitable (small bumps , dents , scratches) and thus is not entitled to change or reduction .

There shall be no liability for any defect and / or remained hidden damage in terms of electronics and mechanics accepted ,\r\nand for fraudulent misrepresentation and concealed defects .

photographic record



front Left



front Right



rear Left



rear Right



inside



inside



trunk



instrument cluster



mileage



filler cap



rims



rims




rims



rims



engine compartment

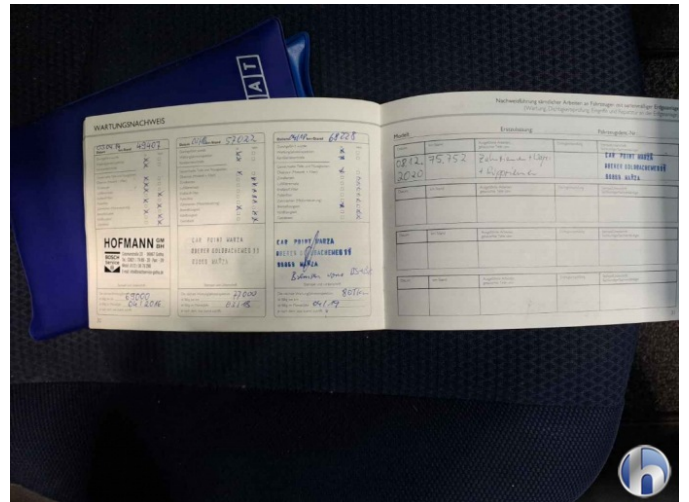

service book



Others



1. Front fender - right



2. Front door - right



3. Door Rear - right



4. Sidewall - Rear - right



6.



8. tailgate




8. tailgate



9. Rear door - left



9. Rear door - left

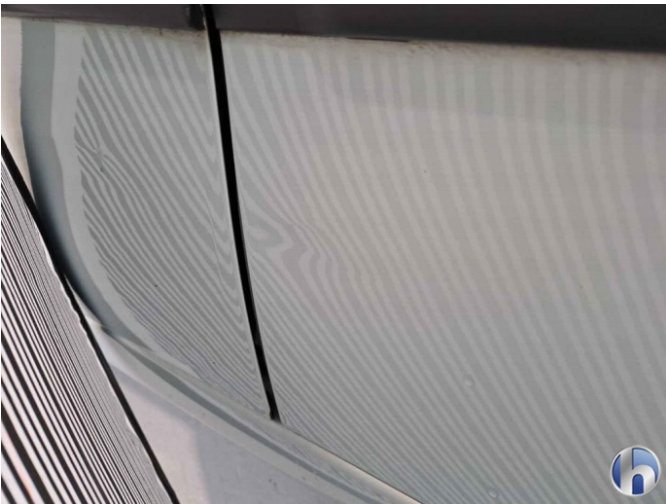

9. Rear door - left



10. Sidewall - Rear - Left



10. Sidewall - Rear - Left



10. Sidewall - Rear - Left



10. Sidewall - Rear - Left




11. side skirt - left



11. side skirt - left



12. Front door - left

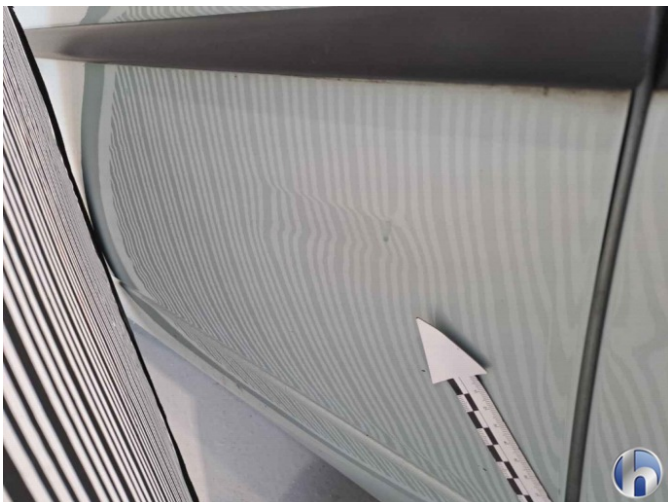

12. Front door - left



13. Front bumper



13. Front bumper



14. Halogen headlights - left



14. Halogen headlights - left



15. Halogen headlights - right



15. Halogen headlights - right



16. Türgriff VR



16. Türgriff VR



17. Door Rear - right



17. Door Rear - right



18. Sidewall - Rear - right



18. Sidewall - Rear - right



19. side skirt - right



19. side skirt - right



20. Hubcap - Rear - right



21. exterior body



22.




22.



23.



23.

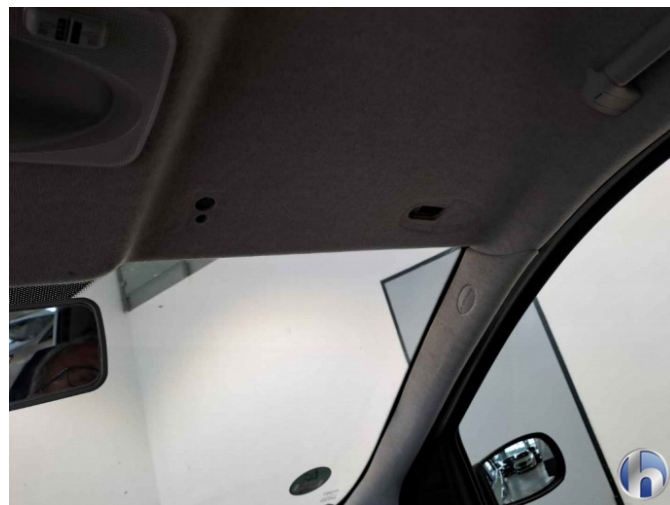

25. Sun visor with mirror



26. Radio



27. tailgate trim



27. tailgate trim



28. Door trim Rear - right



28. Door trim Rear - right



29. motor insulation



29. motor insulation