



PEUGEOT 308 SW: 1YTV287				
Vinnumber:	VF3LCYHZKLS247517	Versionname:	1.5 BlueHDi 130 S&S EAT8 Allure Pack	
First Registrationdate:	11/12/2020	Fiscalpower:		
Expertise Mileage:	139942	Power Kw:	96	
Bodytype:		Body colour	Grey	
Gearbox:	Automatic	Type of rims (mounted)	Aluminium	
Transmission:		Parking lot	2703	
Fueltype:	Diesel			
Maintenance	NOT OK			
Type of rims (mounted)	Aluminium			
Certificate of Conformity	No			
Category	Passenger Car			
Registration Certificate Car (BE)	No			
Registration Certificate Home (BE)	No			
Options				
Number of keys total	2	Luggage cover		
Cruise Control		Front parking sensors		
Steering wheel multifunctional		Rear parking sensors		
Radio multimedia		Type of Tow bar	No Tow bar	
Type of headlighting	Headlighting LED			
Type of GPS	GPS big screen color			
Type of Lining	Lining semi-artificial leather			
Type of climate control	Autom climate control			
Limited Technical Inspection				
Tyres				
Summer tyres:	205/55/16/91 H			
	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 4 mm	Re.R.	Michelin: 4 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				4.0
Tyre profile depth RR				4.0
Tyre size FL				205/55 R 16 91 H
Tyre size FR				205/55 R 16 91 H
Tyre size RL				205/55 R 16 91 H
Tyre size RR				205/55 R 16 91 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				261
Tyre make FR				261
Tyre make RL				261
Tyre make RR				261
Assistance equipment				
Emergency spare wheel	Yes	Jack		Yes
Number of charging cables (normal)	0			
Number of charging cables (rapid charge)	0			
Total cost ex VAT				5008,69
Service, Maintenance, Check				0,00



Steering wheel, Worn, Acceptable	0,00
----------------------------------	------



Registration document, Missing, Replace	187,67
---	--------



Certificate Of Conformity, Missing, Replace	187,67
---	--------



Bumper F, Scratch(es), Repair and paint (complete)	289,07
--	--------



Bonnet, Dent(s) and scratch(es), Repair and paint (complete)	395,90
--	--------




Outer sill L, Scratch(es), Acceptable	0,00
---------------------------------------	------



Alloy rim RL, Scratch(es), Repair and paint (complete)	129,66
--	--------



Door RL, Scratch(es), Acceptable	0,00
----------------------------------	------

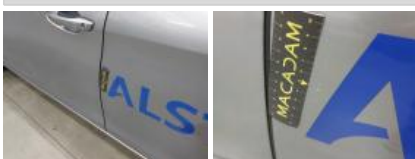

Outside rear-view mirror housing L, Scratch(es), Acceptable	0,00
---	------



Wing FL, Dent(s) and scratch(es), Repair and paint (complete)

445,51



Roof pillar L, Dent(s), Paintless dent repair

93,06




Bumper R, Scratch(es), Acceptable

0,00



Boot carpet, Damaged, Replace

407,88

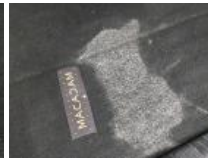

Tailgate / Boot, Scratch(es), Repair and paint (complete)

411,74



Brand badge R, Deformed / Strained, Replace

76,56



Rear window, Scratch(es), Replace

326,39



Bumper R, Scratch(es), Repair and paint (complete)

289,07






Alloy rim RR, Scratch(es), Repair and paint (complete)	129,66
--	--------



Alloy rim FR, Scratch(es), Repair and paint (complete)	129,66
--	--------

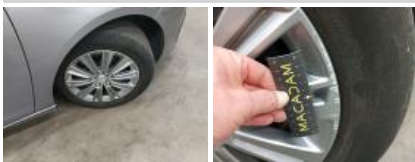

Outer sill R, Dent(s) and scratch(es), Repair and paint (complete)	539,79
--	--------



Door FR, Scratch(es), Acceptable	0,00
----------------------------------	------



Door RR, Dent(s) and scratch(es), Repair and paint (complete)	434,50
---	--------



Wing RR, Dent(s) and scratch(es), Repair and paint (complete)	507,65
---	--------



Bodywork, Not original part, Remove lettering	0,00
---	------



Aerial, Missing, Replace	27,25
--------------------------	-------

