



MAZDA CX-30: 2ADA373

Vinnumber:	JMZDM6WH600205871	Versionname:	CX-30 2.0 e-Skyactiv X Skydrive Business (Mild Hybrid) 137kW/186pk 5D/P Man-6
First Registrationdate:	24/02/2021	Fiscalpower:	
Expertise Mileage:	66587	Power Kw:	
Bodytype:		Body colour	Dark Blue
Gearbox:	MAN 6 VIT	Type of rims (mounted)	N/A
Transmission:	Front	Parking lot	b421
Fueltype:	Hybrid Petrol		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Type of rims (mounted)	N/A		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		
Bodywork	Clean		
Interior	Clean		

Options

Number of keys total	2	Radio
Number keys remote	2	Front parking sensors
Windows electric F		Rear parking sensors
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Seats F heated		
Navigation with screen		
Airco electronic		
Rims alloy		

Limited Technical Inspection

Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Degree of wear

215/65/16/98 H				
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 5 mm	Re.R.	Michelin: 5 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				5.0
Tyre profile depth RR				5.0
Tyre size FL				215/65 R 16 98 H
Tyre size FR				215/65 R 16 98 H
Tyre size RL				215/65 R 16 98 H
Tyre size RR				215/65 R 16 98 H
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				All seasons
Tyre type RR				All Seasons
Tyre make FL				261
Tyre make FR				261
Tyre make RL				261
Tyre make RR				261

Assistance equipment

Repair kit	No	Compressor	No
Number of charging cables (normal)	0		

Bumper F, Scratch(es), Acceptable



Bumper spoiler F, Scratch(es), Acceptable



Wing trim RL, Scratch(es), Smart repair



Alloy rim RL, Scratch(es), Acceptable



Door FL, Dent(s), Acceptable

Composite repair kit, max. 1 m², Missing, Replace

Compressor, Missing, Replace



Charging cable (normal), Missing, Replace



Charging cable (fast), Missing, Replace



Boot lid covering R, Scratch(es), Smart repair




Bumper R, Scratch(es), Repair and paint (complete)




Bumper moulding R, Scratch(es), Smart repair




Wing trim FR, Scratch(es), Smart repair

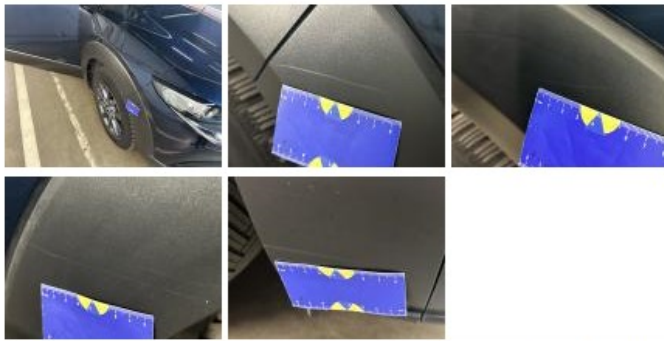

Wing FR, Scratch(es), Polish

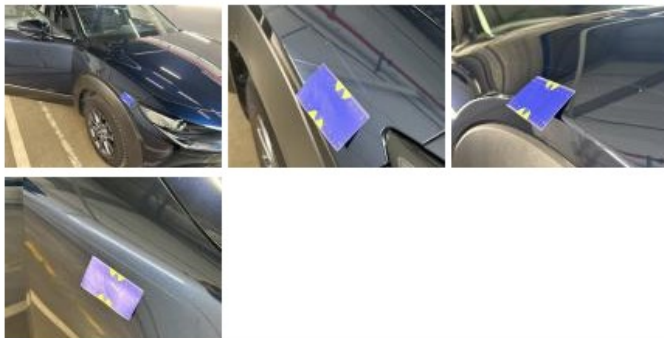


Outside rear-view mirror housing R, Scratch(es), Polish

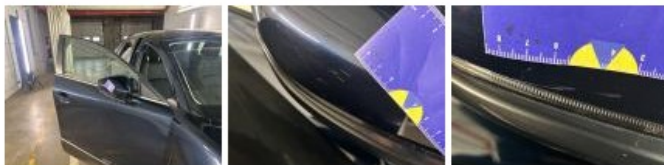

Outside rear-view mirror base R, Scratch(es), Smart repair



Door FR, Scratch(es), Polish

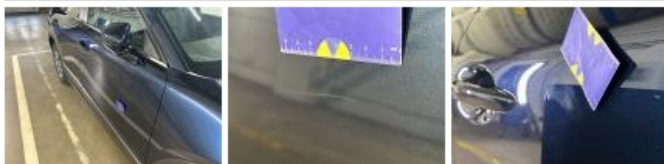


Door trim FR, Scratch(es), Acceptable



Door RR, Scratch(es), Polish



Wing RR, Dent(s) and scratch(es), Repair and paint (complete)

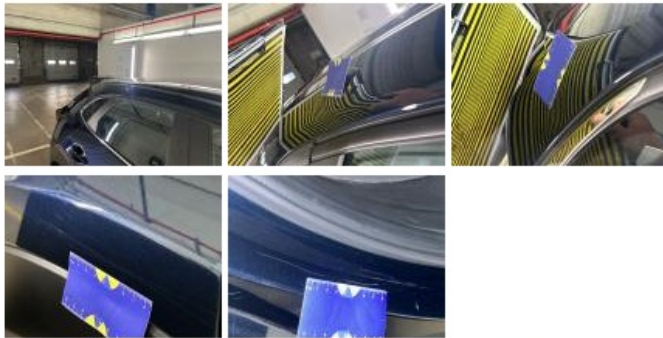

Wing trim RR, Scratch(es), Smart repair

