

Vehicle details

VIN	JTDKGNCE6 0N357481	Brand	TOYOTA	Maintenance date	-
Licence Plate	TF-41-2F	Model	Aygo 1.0 VVT-i x-fun 5d	Maintenance mileage	-
Registration date	21/08/2018	Year	2018	Exterior Color	White Solid
Odometer	44 934 km	Engine size	998	interior Color	Grey
Fuel	Petrol	Body Type	-	Next technical inspection	-
Seats	-	Transmission	Manual	CO2	-
Doors	5	Gears	5		

Inspection Details

Inspection date	03/10/2025	Inspection loc.	Dekra Ayvens
-----------------	------------	-----------------	--------------



Generic equipment

Manual air-conditioning	✓
Central locking	✓
Electric windows	✓
Audio System	✓

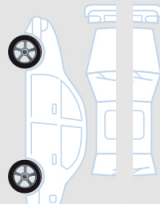

Removable element

Spare wheel kit	✓
Rear parcel shelf	✓

Technical Document

User manual	✓
Warranty booklet	✓
Key	✓
Spare key	✗

Tyres

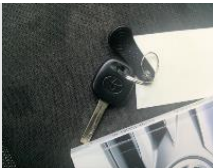
Michelin 165/65/14 All seasons 4.0 mm		Michelin 165/65/14 All seasons 4.5 mm	
Goodyear 165/65/14 All seasons 5.0 mm		Vredestein 165/65/14 All seasons 4.5 mm	

Exterior

1		Part	Wheelcap 16"	2		Part	Wing
		Position	Front right			Position	Front left
		Damages	Missing			Damages	Dent & Chips
		Severity	-			Severity	Diameter (mm) > 20
		Repair mode	For info			Repair mode	Repair

3		Part Position Damages Severity Repair mode	Reflector Front left Broken - Replace	4		Part Position Damages Severity Repair mode	Door Front left Dent & Chips Diameter (mm) > 20 Repair
6		Part Position Damages Severity Repair mode	Roof post A/B/C Left Dented Diameter (mm) > 20 Smart Repair	7		Part Position Damages Severity Repair mode	Door Back left Dent & Chips Diameter (mm) > 20 Repair
8		Part Position Damages Severity Repair mode	Sill Left Dent & Chips Diameter (mm) > 20 Repair	9		Part Position Damages Severity Repair mode	Wing Back left Dent & Chips Diameter (mm) > 20 Repair
10		Part Position Damages Severity Repair mode	Bumper Back Broken - Replace	11		Part Position Damages Severity Repair mode	Unpainted bumper Back Broken - Replace
12		Part Position Damages Severity Repair mode	Wing Back right Dented Diameter (mm) > 20 Smart Repair	13		Part Position Damages Severity Repair mode	Door Back right Scratched - Repair
14		Part Position Damages Severity Repair mode	Bumper Front Broken - Replace	15		Part Position Damages Severity Repair mode	Unpainted bumper Front Broken - Replace
16		Part Position Damages Severity Repair mode	Bonnet - Dented Diameter (mm) > 20 Smart Repair	17		Part Position Damages Severity Repair mode	Roof - Dent & Chips Diameter (mm) > 20 Repair

Interior damage

5		Part	Interior cleaning	18		Part	Spare key
		Position	Front			Position	-
		Damages	Stained/dirty			Damages	Missing
		Severity	-			Severity	-
		Repair mode	Cleaning			Repair mode	Replace