


Vehicle details

VIN	KNAB2511A LT657065	Brand	KIA	Maintenance date	-
Licence Plate	H4-74-XX	Model	Picanto 1.0 Mpi ActieAuto 4-zits 5d EconomyLine AP	Maintenance mileage	-
Registration date	25/06/2020	Year	2020	Exterior Color	White Solid
Odometer	74 619 km	Engine size	998	interior Color	Grey
Fuel	Petrol	Body Type	-	Next technical inspection	-
Seats	-	Transmission	Manual	CO2	-
Doors	5	Gears	5		

Inspection Details

Inspection date	21/07/2025	Inspection loc.	Dekra Ayvens
-----------------	------------	-----------------	--------------

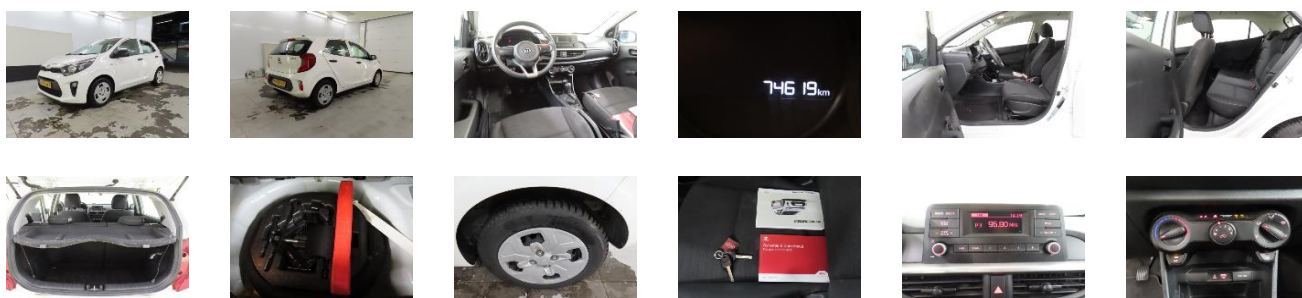

Generic equipment

Manual air-conditioning	✓
Audio System	✓

Removable element

Spare wheel (wheel & tyre)	✓
Rear parcel shelf	✓


Technical Document

User manual	✓
Warranty booklet	✓
Spare key	✓
Key	✓

Tyres

Winter kit

Michelin 175/65/14 Winter 4.0 mm

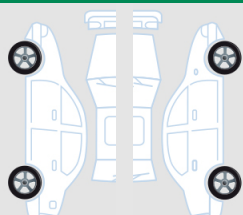

Michelin 175/65/14 Winter 4.0 mm



Michelin 175/65/14 Winter 6.0 mm

Michelin 175/65/14 Winter 6.0 mm

Exterior

3		Part	Door	4		Part	Door
		Position	Front left			Position	Back left
5		Damages	Dented	6		Damages	Dented
		Severity	Diameter (mm) > 20			Severity	Diameter (mm) > 20
		Repair mode	Repair			Repair mode	Smart Repair
5		Part	Bumper	6		Part	Wing
		Position	Back			Position	Back right
		Damages	Scratched			Damages	Dented
		Severity	Length (cm) > 10			Severity	Diameter (mm) > 20
5		Repair mode	Repair	6		Repair mode	Repair

7



Part	Door
Position	Front right
Damages	Dented
Severity	Diameter (mm) > 20
Repair mode	Repair

●●

8



Part	Bumper
Position	Front
Damages	Scratched
Severity	Length (cm) > 10
Repair mode	Repair

●●●●

9



Part	Wing
Position	Front right
Damages	Chemical deposit
Severity	-
Repair mode	Lumpsum repair

●●

Interior damage

1



Part	Fabric seat
Position	Front left
Damages	Stained/dirty
Severity	-
Repair mode	Cleaning

2



Part	Fabric seat
Position	Back
Damages	Stained/dirty
Severity	-
Repair mode	Cleaning