



HYUNDAI i20

i20 1.2

VIN NO NLHBA51BACZ124971

Registration Number BACZ124971



MOT Date

2025-12-01

Last Service

2025-05-21

Number of Owners

1

Last Service Mileage

145611

Number of Keys

2

First Registration Date

2012-08-30

Odometer Reading

148165 km

Country First Registered

Germany

Inspection Report Summary

Customer	BCA Online	Report Number	P20251006133617
Inspection Date / Place	2025-10-06 / ARS Altmann AG Wolnzach	Cosmetic Grade	9


Vehicle Summary


Vehicle Condition	Runner	VAT Type	Margin
Fuel Type	Petrol	Road Worthy	Yes
Colour	Grey	Engine Size (cc)	1248
Engine Size	1.2	No of Doors	5
Body Type	Sedan	Drive Train	Front
Seat Colour		No of Seats	5
Seat Covering Name		Seat Covering	Cloth
Charging Cables		NEDC CO2 Rating (q/km)	119
Gearbox Type	Manual		

Vehicle History & Documents

Service Book Available	Present	Next Service Mileage	km
Previous Usage		Imported	No
Manufacturer Warrenty			



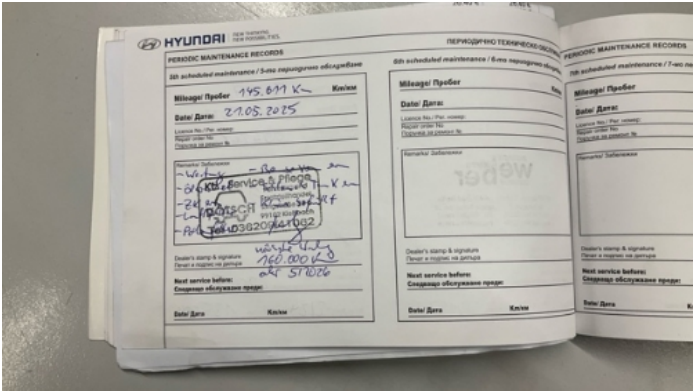

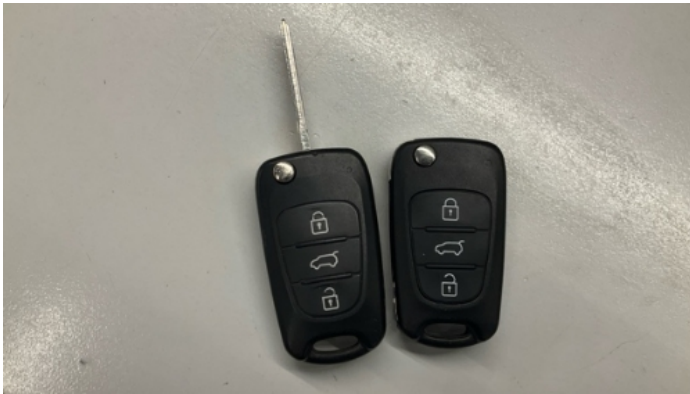

Equipment

Airbag Status	Auxiliary Socket	Stability control	Central locking
Radio	Anti-lock braking	Remote central locking	CD Player
Leather steering wheel			

Equipment Details


Air Conditioning	Yes	Extra Wheel / Tyre Set	Winter Tyres - Steel
Seat Heating	No		

Wheels & Tyres


Extra Wheel - 1 Tyre Depth	4	Extra Wheel - 2 Tyre Depth	4
Extra Wheel - 3 Tyre Depth	4	Extra Wheel - 4 Tyre Depth	4
Right Front Tyre Depth	5	Left Front Tyre Depth	5
Right Rear Tyre Depth	5	Left Rear Tyre Depth	5

Cosmetic Damage

23 Schäden

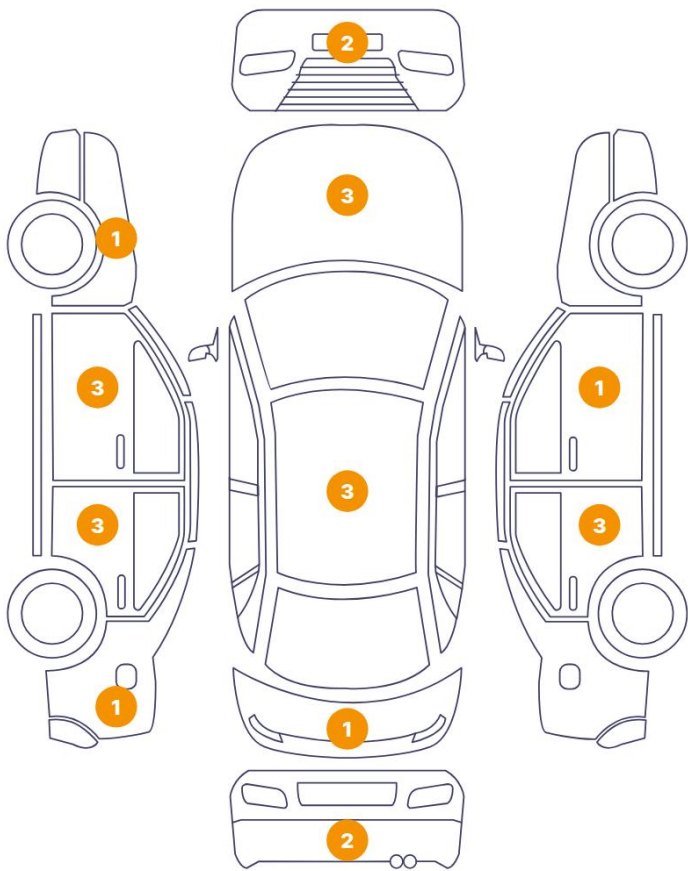

3 Schäden

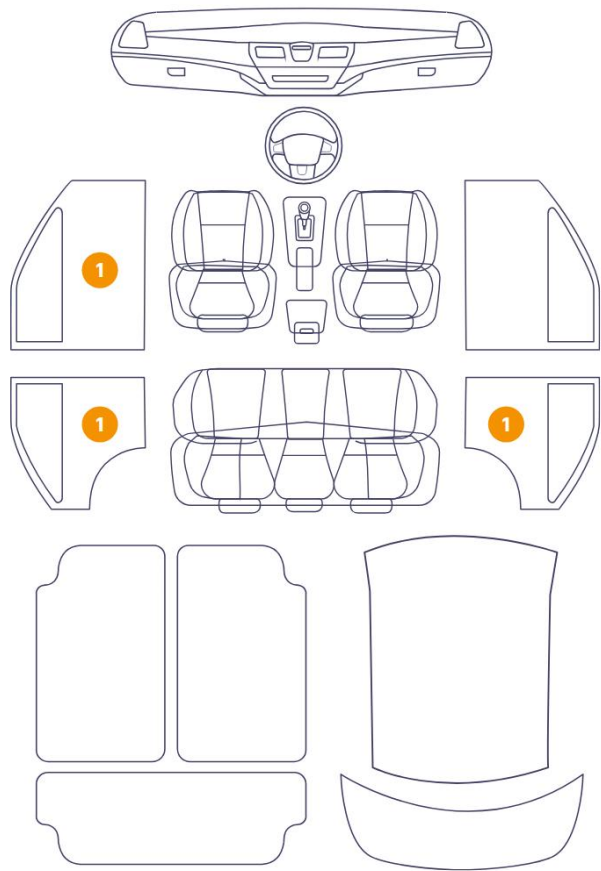


Component		Damage	Comments
1	Hood	Bodywork / Dent / Dent	
2	Door / Back Left	Bodywork / Dent / Dent	
3	Side Panel / Back Left	Bodywork / Dent / Dent	
4	Roof	Bodywork / Dent	
5	Roof	Bodywork / Dent	
6	Pillar / Front Left	Bodywork / Dent	
7	Pillar / Back Right	Bodywork / Dent / Dent	
8	Bumper / Front	Paint / Scratch / Scuff	
9	Wing Repeater / Left	Paint / Scratch / Scuff	
10	Mirror Shell / Front Left	Paint / Scratch / Scuff	
11	Door / Front Left	Paint / Scratch / Scuff	
12	Panel Filling / Front Left	Interior / Scratched	


13	Door / Back Left	Paint / Scratch / Scuff
14	Pillar / Back Left	Bodywork / Dent / Dent
15	Panel Filling / Back Left	Interior / Scratched
16	Bumper / Back	Paint / Scratch / Scuff
17	Bumper / Back	Paint / Scratch / Scuff
18	Tailgate	Paint / Corrosion
19	Door / Back Right	Paint / Scratch / Scuff
20	Pillar / Back Right	Bodywork / Dent / Dent
21	Panel Filling / Back Right	Interior / Scratched
22	Door / Front Right	Paint / Scratch / Scuff
23	Hood	Bodywork / Breakage / Hole
24	Bumper / Front	Paint / Scratch / Scuff
25	Antenna Rod	Missing Part
26	Hood	Bodywork / Dent




1. Hood
Bodywork / Dent / Dent -

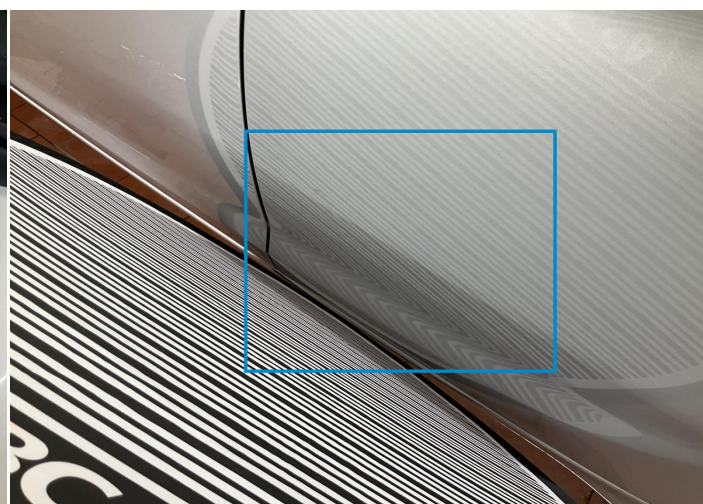


2. Door / Back Left
Bodywork / Dent / Dent -

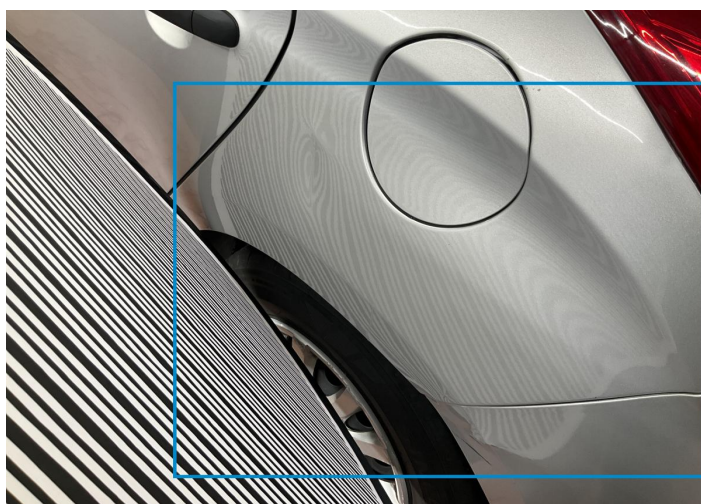

3. Side Panel / Back Left
Bodywork / Dent / Dent -

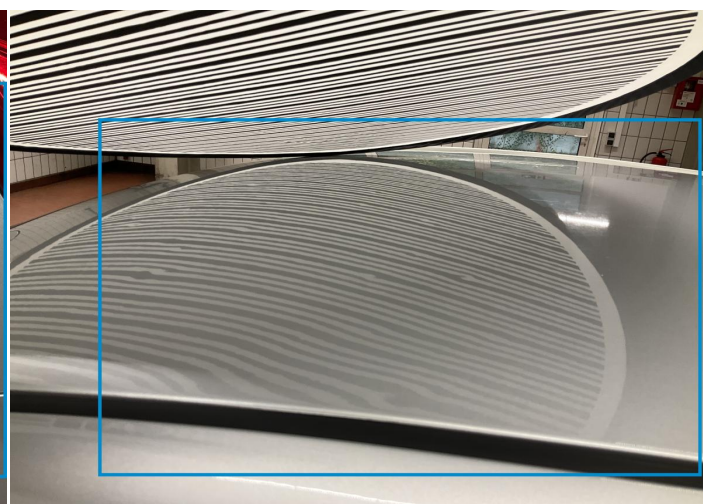

4. Roof
Bodywork / Dent -

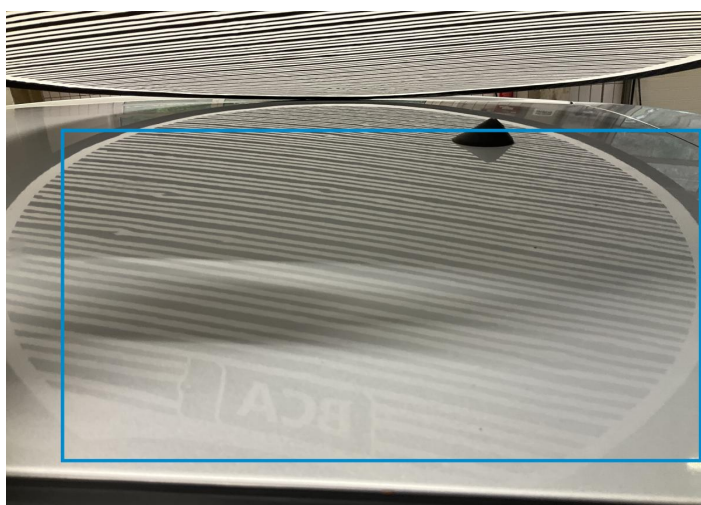

5. Roof
Bodywork / Dent -



6. Pillar / Front Left
Bodywork / Dent -



7. Pillar / Back Right
Bodywork / Dent / Dent -



8. Bumper / Front
Paint / Scratch / Scuff -



9. Wing Repeater / Left
Paint / Scratch / Scuff -



10. Mirror Shell / Front Left
Paint / Scratch / Scuff -



11. Door / Front Left
Paint / Scratch / Scuff -



12. Panel Filling / Front Left
Interior / Scratched -



13. Door / Back Left
Paint / Scratch / Scuff -



14. Pillar / Back Left
Bodywork / Dent / Dent -



15. Panel Filling / Back Left
Interior / Scratched -



16. Bumper / Back
Paint / Scratch / Scuff -



17. Bumper / Back
Paint / Scratch / Scuff -



18. Tailgate
Paint / Corrosion -



19. Door / Back Right
Paint / Scratch / Scuff -



20. Pillar / Back Right
Bodywork / Dent / Dent -



21. Panel Filling / Back Right
Interior / Scratched -



22. Door / Front Right
Paint / Scratch / Scuff -



23. Hood
Bodywork / Breakage / Hole -



24. Bumper / Front
Paint / Scratch / Scuff -



25. Antenna Rod
Missing Part -



26. Hood
Bodywork / Dent -

Mechanical Condition

Control Lights

ABS Warning Light	✓	ESP Fault/Traction Control Malfunction Light	✓
Airbag Warning Light	✓	Oil Pressure Warning Light	✓
Brake Warning Light	✓	Power Steering Warning Light	✓
Alternator / Battery	✓	No Dashboard Lights	✓
Display Defect	✓	Service Light	✓

Engine

Engine Status / EML	✓	Engine Leak Visible	✓
Engine Starts	✓		

Gearbox

Gear Box	✓
----------	---

Equipments Test

Central Locking	✓	Main & Spare Keys Functioning	✓
Electric Windows	✓	Audio Equipment	⚠
AC / Heating System	✓		

Levels

Brakes Fluid	✓	Coolant Fluid	⚠
--------------	---	---------------	---

Test Drive Inspection

Engine			
Engine Noise	✓	The Gears Scratch / Skip / Abnormal Operation	✓
Fume Quantity	✓	Power Loss	✓
Brake			
Brake System Anomaly	✓		
Steering Wheel			
Steering Noise / Anomaly	✓		
Clutch			
Clutch Functioning	✓		
General			
Test Driven Status	✓		

- ✓ *No troubles detected, good condition or correct tests, according to vehicle age and mileage*
- ! *Damages or malfunction detected that requires repairs by the buyer*
- NA *Not applicable*
- ☐ *Not tested*

Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description.

[User Guide](#)