



TOYOTA COROLLA TOURING SPORTS: 1YMT951

Vinnumber:	SB1Z53BE80E052227	Versionname:	2.0 Hybrid Premium e-CVT
First Registrationdate:	22/10/2020	Fiscalpower:	
Expertise Mileage:	168519	Power Kw:	
Bodytype:		Parking lot	2828
Gearbox:	Automatic	Type of rims (mounted)	Aluminium
Transmission:		Body colour	Green
Fueltype:	Hybrid Petrol		
Certificate of Conformity	Yes		
Type of rims (mounted)	Aluminium		
Category	Passenger Car		
Registration Certificate Home (BE)	No		
Registration Certificate Car (BE)	Yes		

Options

Steering wheel multifunctional		Luggage cover	
Seats F heated		Rear parking sensors	
Type of GPS	GPS big screen color	Front parking sensors	
Cruise Control		Type of Tow bar	Tow bar removable
Type of climate control	Autom climate control		
Number of keys total	2		
Type of headlighting	Headlighting LED		
Type of Lining	Lining fabrics		

Limited Technical Inspection

Tyres

Tyre size RL	225/40 R 18 92 W
Tyre type FL	Summer
Tyre type RL	Summer
Tyre profile depth FR	2.0
Tyre profile depth RR	2.0
Tyre make FR	261
Tyre size FR	225/40 R 18 92 W
Tyre make RR	1957074
Tyre size RR	225/40 R 18 92 W

225/40/18/92 W			
Fr.L.	Michelin: 3 mm	Fr.R.	Michelin: 2 mm
Re.L.	Michelin: 3 mm	Re.R.	Falken: 2 mm

Tyre profile depth FL	3.0
Tyre make FL	261
Tyre size FL	225/40 R 18 92 W
Tyre type FR	Summer
Tyre profile depth RL	3.0
Tyre type RR	Summer
Tyre make RL	261

Assistance equipment

Number of charging cables (normal)	0	Compressor	Yes
Number of charging cables (rapid charge)	0		
Repair kit	Yes		

Total cost ex VAT	2763,63
Interior, Dirty, Cleaning	170,61



Bonnet, Dent(s), Paintless dent repair 217,14



Alloy rim FL polished, Scratch(es), Repair and paint (complete) 199,04



Door FL, Dent(s), Acceptable 0,00



Step L, Scratch(es), Acceptable 0,00



Wing RL, Dent(s) and scratch(es), Repair and paint (complete) 420,65



Door RL, Dent(s) and scratch(es), Repair and paint (complete) 434,50



Roof pillar L, Dent(s), Acceptable 0,00




Side window trim FL, Dent(s), Acceptable 0,00



Bumper R, Dent(s) and scratch(es), Repair and paint (complete) 289,07




Rear window, Scratch(es), Replace 0,00

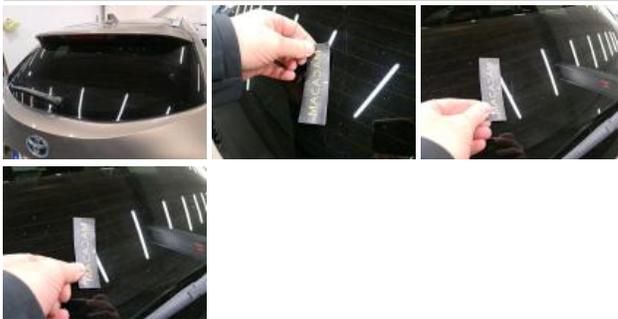

Alloy rim FR polished, Scratch(es), Repair/replace (lump sum) 0,00



Door FR, Scratch(es), Polish 0,00

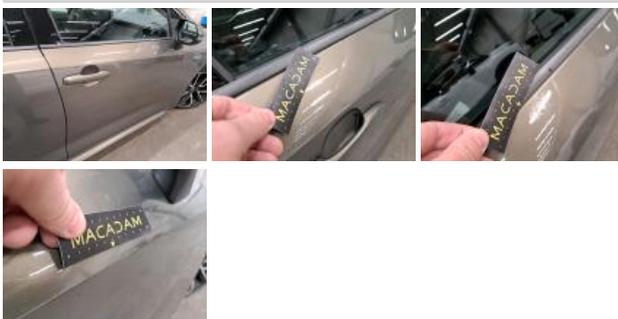

Alloy rim RR polished, Scratch(es), Repair and paint (complete) 199,04



Tyre RR, Tear, Replace

176,40



Wing RR, Scratch(es), Acceptable

0,00



Door RR, Dent(s), Acceptable

0,00



Roof, Dent(s) and scratch(es), Repair and paint (complete)

657,18

