



NISSAN Qashqai Benzina  
qashqai 1.6 16v Visia

VIN NO SJNFAAJ10U1233086

Registration Number DR183GW



MOT Date

2024-12-20

Last Service



Number of Owners



Last Service Mileage



Number of Keys



First Registration Date

2008-07-23

Odometer Reading

141816 km

Country First Registered

Italy

Inspection Report Summary

Customer	BCA Lodi	Report Number	P20250924153856
Inspection Date / Place	2025-09-24 / BCA Lodi	Cosmetic Grade	5

Vehicle Summary


Vehicle Condition	Runner	VAT Type	Margin
Fuel Type	Petrol	Gearbox Type	Manual
Colour	Black	Engine Size (cc)	1598
Engine Size	1.6	No of Doors	5
Body Type	SUV	Drive Train	Front
Seat Colour	Black	No of Seats	5
Seat Covering Name		Seat Covering	Cloth
Charging Cables		NEDC CO2 Rating (q/km)	159

Vehicle History & Documents

Service Book Available	-	Next Service Mileage	km
Previous Usage	Normal Use	Imported	No
Manufacturer Warrenty			





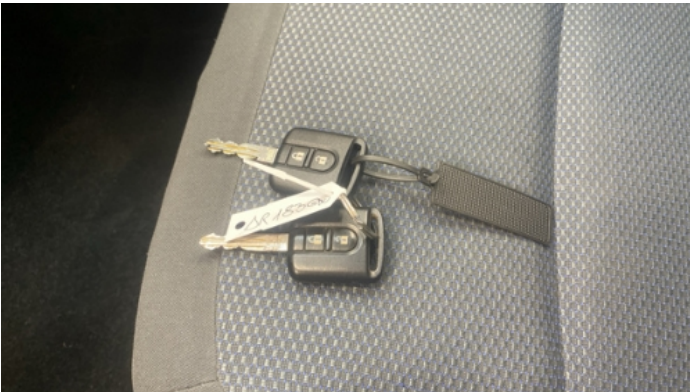

Equipment

Central locking	Digital Radio	Parcel Shef	Remote central locking
Tyre Mobility Kit	Power assisted steering	Volante multifuncion	Remote adjusting wing mirrors
Trip Computer	Stability control		


Wheels & Tyres

Mounted Tires


Tyre / Wheel Type	Four Seasons
	PIRELLI PIRELLI-SCORPION VERDE ALL SEASON 215/65//R16 - 98H / 2 mm
	PIRELLI PIRELLI-SCORPION VERDE ALL SEASON 215/65//R16 - 98H / 2 mm
	PIRELLI PIRELLI-SCORPION VERDE ALL SEASON 215/65//R16 - 98H / 2 mm
	PIRELLI PIRELLI-SCORPION VERDE ALL SEASON 215/65//R16 - 98H / 2 mm

Cosmetic Damage

17 Danni

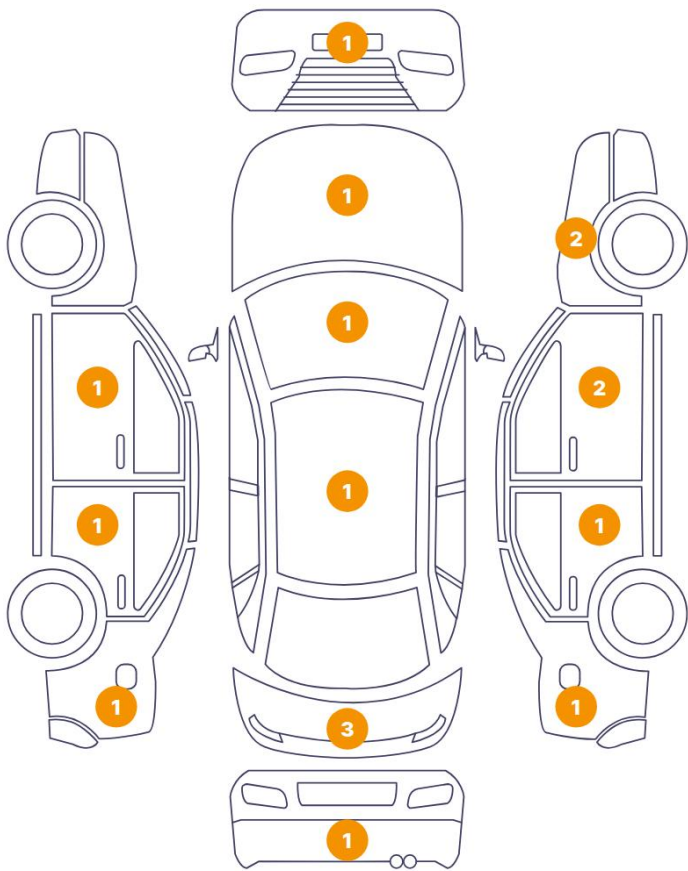

13 Danni

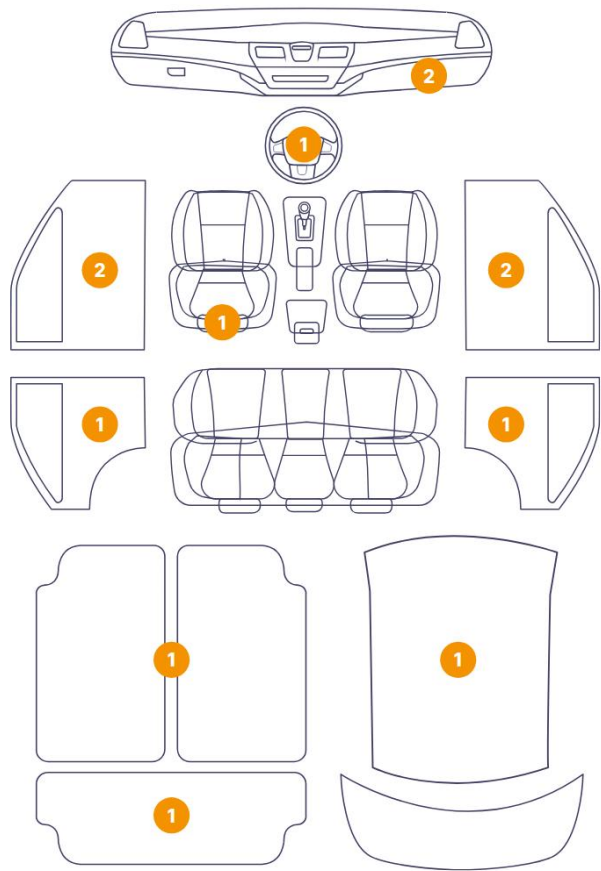

Component		Damage	Comments
1	Panel Filling / Front Right	Interior / Worn - out	
2	Panel Filling / Front Right	Interior / Broken	
3	Panel Filling / Back Right	Interior / Broken	
4	Luggage Space Cover / Back	Interior / Broken	
5	Panel Filling / Back Left	Interior / Broken	
6	Interior door handle Front left	Interior / Worn - out	
7	Panel Filling / Front Left	Interior / Broken	
8	Seat / Front Left	Interior / Broken	
9	Steering Wheel / Front	Interior / Worn - out	
10	Center Console	Interior / Broken	
11	Rearview Mirror / Front Center	Interior / Broken	
12	Dashboard / Front	Interior / Distorted	

13	Floor Carpet	Interior / Worn - out
14	Mirror Shell / Front Right	Paint / Scratch / Line
15	Fender / Front Right	Paint / Chipping
16	Wing Expander / Front Right	Paint / Scratch / Line
17	Bumper / Front	Bodywork / Dent
18	Hood	Paint / Scratch / Line
19	Windshield / Front	Glass Break / Impact
20	Door / Front Left	Bodywork / Dent
21	Door / Back Left	Bodywork / Dent
22	Fender / Back Left	Paint / Scratch / Line
23	Tailgate	Bodywork / Breakage
24	Tailgate	Paint / Scratch / Line
25	Rear Window / Back	Glass Break / Scratch
26	Bumper / Back	Paint / Scratch / Line
27	Fender / Back Right	Bodywork / Dent
28	Door / Back Right	Bodywork / Dent
29	Door / Front Right	Bodywork / Dent
30	Roof	Bodywork / Dent





1. Panel Filling / Front Right  
Interior / Worn - out -



2. Panel Filling / Front Right  
Interior / Broken -



3. Panel Filling / Back Right  
Interior / Broken -



4. Luggage Space Cover / Back  
Interior / Broken -



5. Panel Filling / Back Left  
Interior / Broken -




6. Interior door handle Front left  
Interior / Worn - out -





7. Panel Filling / Front Left  
Interior / Broken -

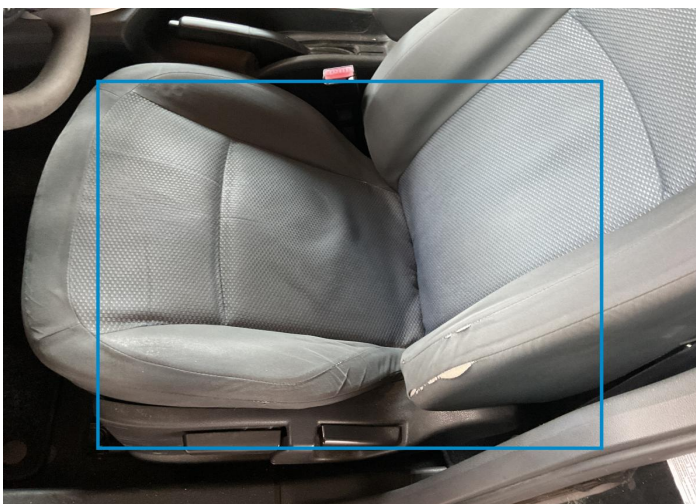


8. Seat / Front Left  
Interior / Broken -



9. Steering Wheel / Front  
Interior / Worn - out -



10. Center Console  
Interior / Broken -

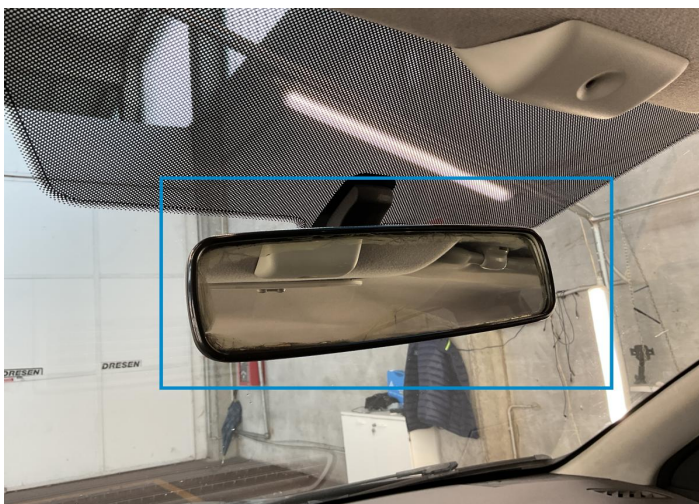


11. Rearview Mirror / Front Center  
Interior / Broken -



12. Dashboard / Front  
Interior / Distorted -



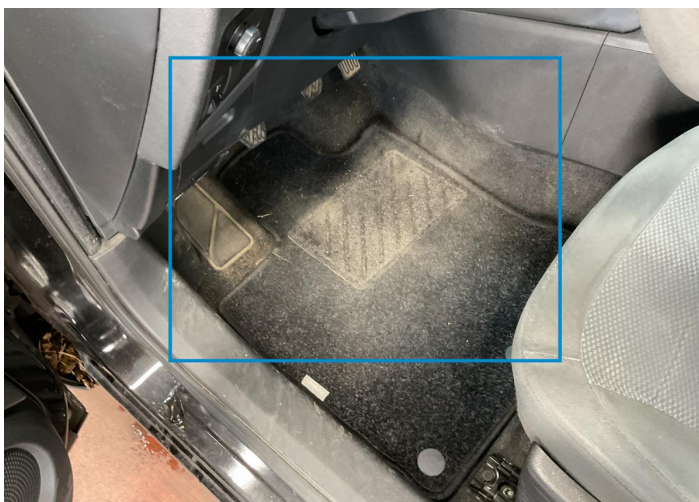

13. Floor Carpet  
Interior / Worn - out -



14. Mirror Shell / Front Right  
Paint / Scratch / Line -



15. Fender / Front Right  
Paint / Chipping -



16. Wing Expander / Front Right  
Paint / Scratch / Line -



17. Bumper / Front  
Bodywork / Dent -




18. Hood  
Paint / Scratch / Line -





19. Windshield / Front  
Glass Break / Impact -

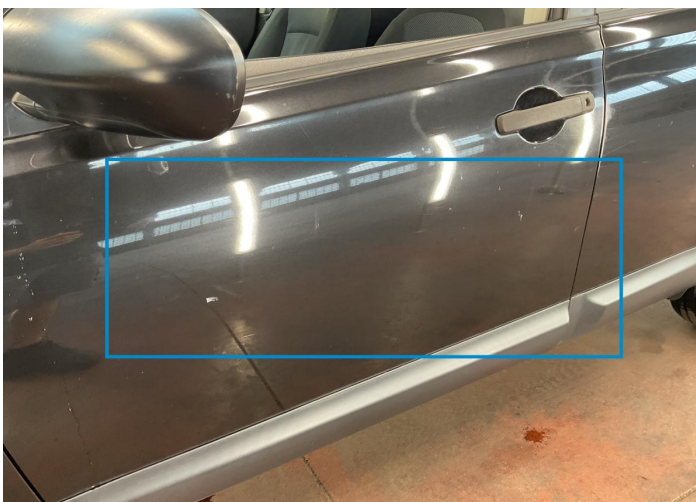

20. Door / Front Left  
Bodywork / Dent -



21. Door / Back Left  
Bodywork / Dent -



22. Fender / Back Left  
Paint / Scratch / Line -



23. Tailgate  
Bodywork / Breakage -



24. Tailgate  
Paint / Scratch / Line -





25. Rear Window / Back  
Glass Break / Scratch -



26. Bumper / Back  
Paint / Scratch / Line -




27. Fender / Back Right  
Bodywork / Dent -



28. Door / Back Right  
Bodywork / Dent -



29. Door / Front Right  
Bodywork / Dent -

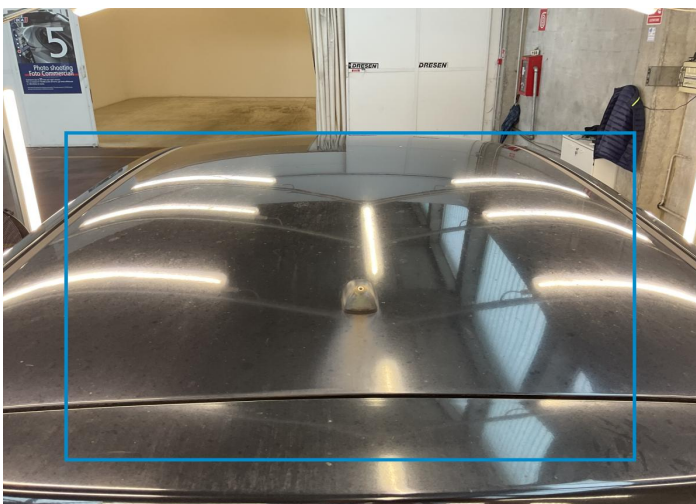

30. Roof  
Bodywork / Dent -



## Mechanical Condition

Engine			
Vehicle Start - up	✓	Engine Starts	✓
Engine Leak Visible	✓		
Clutch			
Clutch Functioning	!		
Equipments Test			
Other Equipments	✓	AC / Heating System	✓
Levels			
Brakes Fluid	✓	Coolant Fluid	✓

## Test Drive Inspection

Other Checks			
Steering	✓	Brakes	✓
Suspension	!		
Gearbox			
Manual Gearbox	✓		
General			
Test Driven Status	✓		
Equipments Test			
Steering   Noise / Anomaly	✓		
Engine			
Power Loss	✓	Fume Quantity	✓
Engine Noise	!		
✓ No troubles detected, good condition or correct tests, according to vehicle age and mileage			
! Damages or malfunction detected that requires repairs by the buyer			
NA Not applicable			
☐ Not tested			