



HYUNDAI ix35

ix35 2.0 2WD

VIN NO TMAJU81BACJ321790

Registration Number BACJ321790



MOT Date

2025-08-01

Last Service

2024-08-24

Number of Owners

-

Last Service Mileage

164214

Number of Keys

2

First Registration Date

2012-06-18

Odometer Reading

172305 km

Country First Registered

-

Inspection Report Summary

Customer	BCA Online	Report Number	P20250519141803
Inspection Date / Place	2025-05-19 / BCA Heidenheim	Cosmetic Grade	5

Vehicle Summary


Vehicle Condition	Runner	VAT Type	Margin
Fuel Type	Petrol	Road Worthy	Yes
Colour	Black	Engine Size (cc)	1998
Engine Size	2.0	No of Doors	5
Body Type	SUV	Drive Train	Front
Seat Colour		No of Seats	5
Seat Covering Name	Schwarz	Seat Covering	Cloth/Synthetic Leather
Charging Cables		NEDC CO2 Rating (q/km)	177
Gearbox Type	Manual		

Vehicle History & Documents

Service Book Available	Present	Next Service Mileage	km
Previous Usage		Imported	Yes
Manufacturer Warrenty			





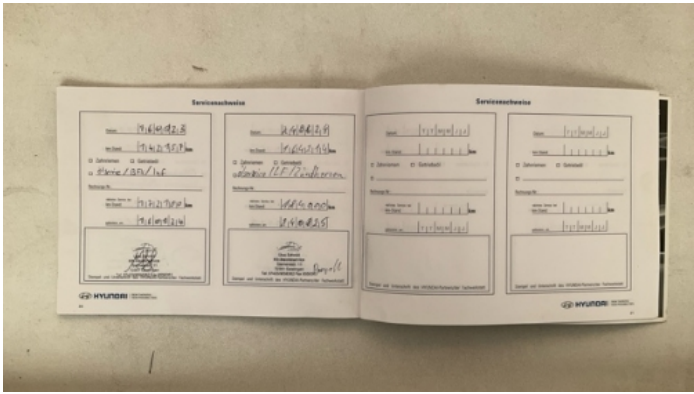

Equipment

Tow ball	Airbag Status	Anti-lock braking	Cruise control
Remote adjusting wing mirrors	Roof rails	CD Player	Leather steering wheel
Radio	USB Socket	Alloys wheels	Auxiliary Socket
Front fog lamps	Remote central locking	Stability control	Electrically folding wing mirrors
Privacy glass			

Equipment Details

Tow Ball Type	Detachable	Air Conditioning	Dual Zone Climate Control
Alloy Wheel Size	18	Extra Wheel / Tyre Set	Winter Tyres - Alloy
Seat Heating	Front		


Wheels & Tyres

Right Front Tyre Depth	5	Left Front Tyre Depth	5
Right Rear Tyre Depth	3	Left Rear Tyre Depth	2
Extra Wheel - 1 Tyre Depth	2	Extra Wheel - 2 Tyre Depth	2
Extra Wheel - 3 Tyre Depth	3	Extra Wheel - 4 Tyre Depth	3

Cosmetic Damage


18 Schäden

3 Schäden

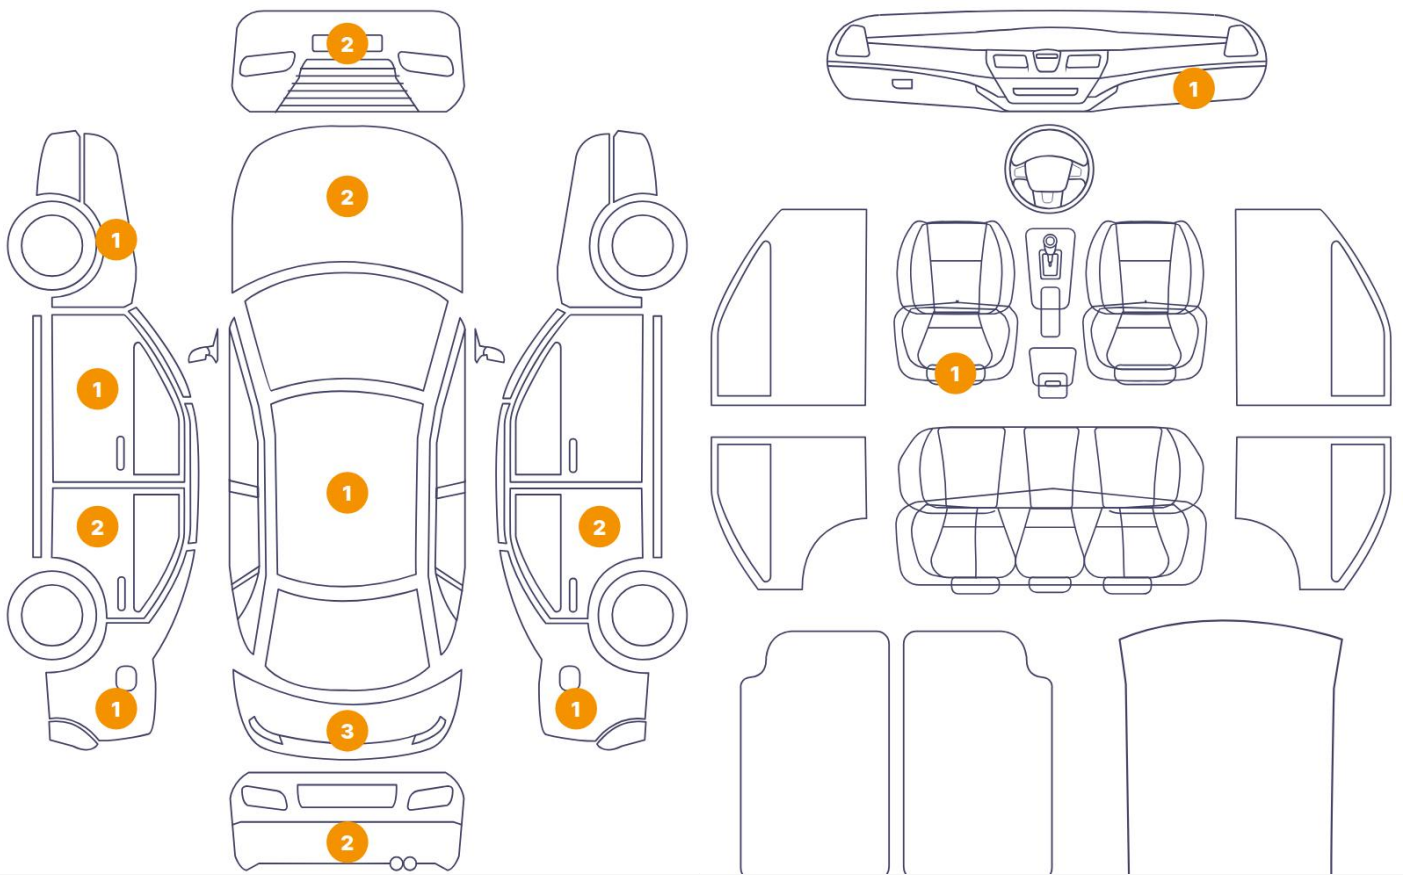


Component		Damage	Comments
1	Fender / Front Left	Paint / Scratch / Scuff	
2	Bumper / Front	Paint / Scratch / Scuff	
3	Bumper / Front	Paint / Scratch / Scuff	
4	Hood	Paint / Scratch / Scuff	
5	Hood	Paint / Scratch / Scuff	
6	Door / Back Right	Bodywork / Dent / Dent	
7	Door / Back Right	Paint / Scratch / Scuff	
8	Side Panel / Back Right	Bodywork / Dent / Dent	
9	Bumper / Back	Bodywork / Breakage / Hole	
10	Tailgate	Bodywork / Dent / Dent	
11	Tailgate	Bodywork / Dent / Dent	
12	Tailgate	Bodywork / Dent / Dent	
13	Bumper / Back	Bodywork / Breakage / Hole	

14	Side Panel / Back Left	Bodywork / Dent / Dent
15	Door / Back Left	Paint / Scratch / Scuff
16	Door / Back Left	Paint / Scratch / Scuff
17	Door / Front Left	Paint / Scratch / Scuff
18	Seat Cushion / Front Left	Interior / Holed
19	Tailgate Upholstery / Back	Interior / Scratched
20	Dashboard / Front	Interior / Scratched
21	Roof	Paint / Scratch / Scuff

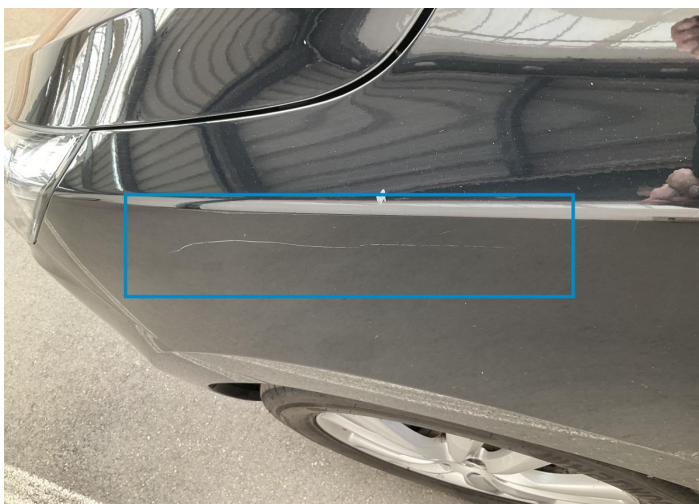

1. Fender / Front Left
Paint / Scratch / Scuff -

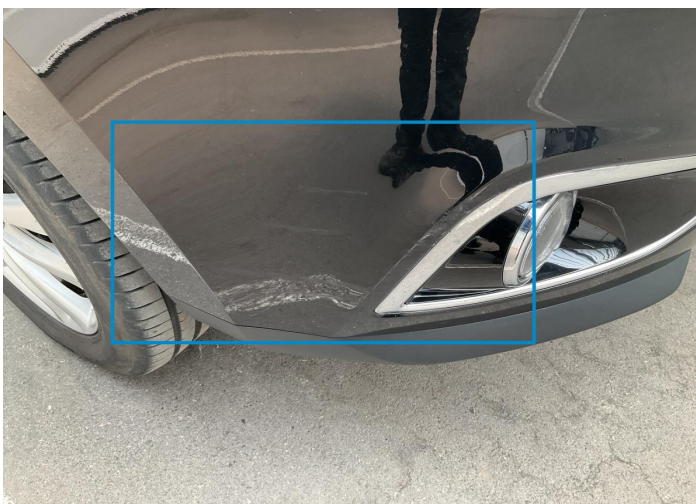

2. Bumper / Front
Paint / Scratch / Scuff -



3. Bumper / Front
Paint / Scratch / Scuff -



4. Hood
Paint / Scratch / Scuff -




5. Hood
Paint / Scratch / Scuff -



6. Door / Back Right
Bodywork / Dent / Dent -




7. Door / Back Right
Paint / Scratch / Scuff -

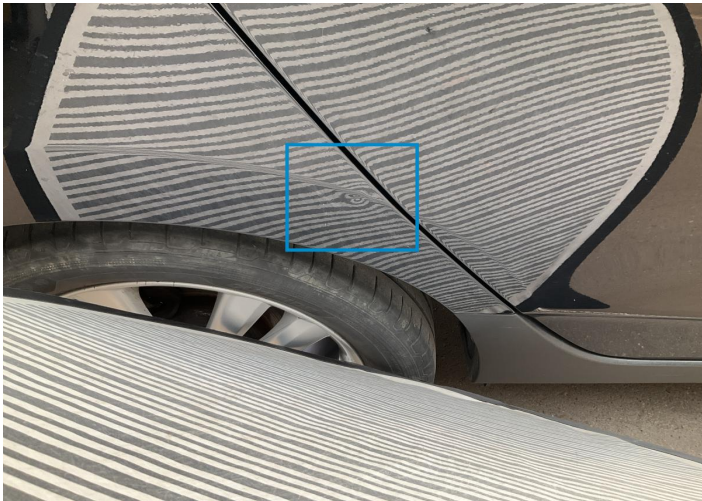

8. Side Panel / Back Right
Bodywork / Dent / Dent -



9. Bumper / Back
Bodywork / Breakage / Hole -

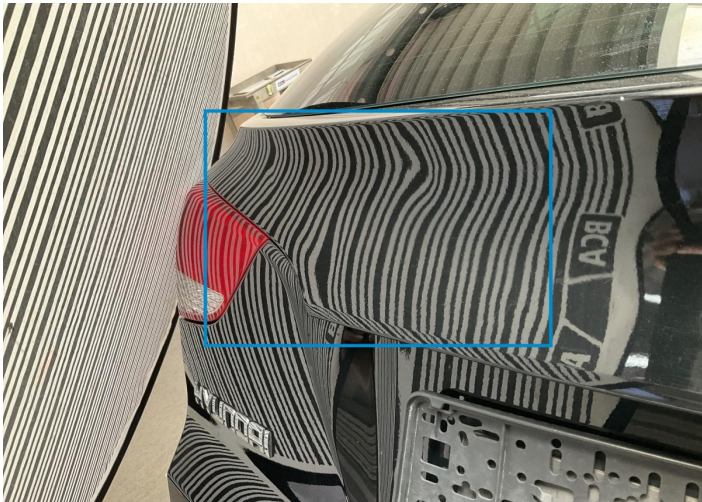


10. Tailgate
Bodywork / Dent / Dent -




11. Tailgate
Bodywork / Dent / Dent -



12. Tailgate
Bodywork / Dent / Dent -

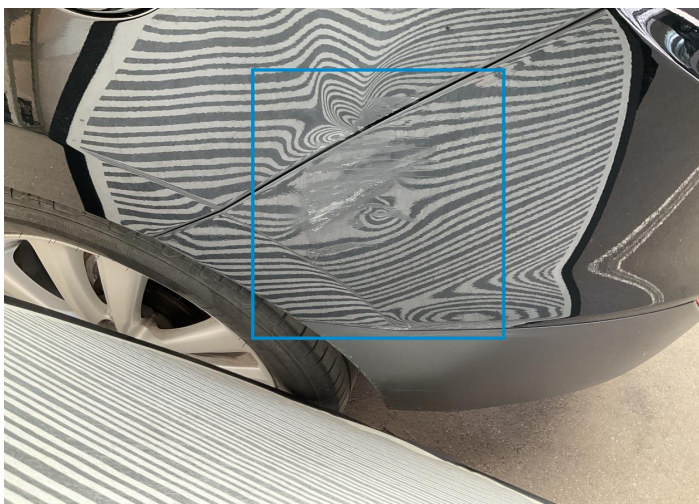


13. Bumper / Back
Bodywork / Breakage / Hole -

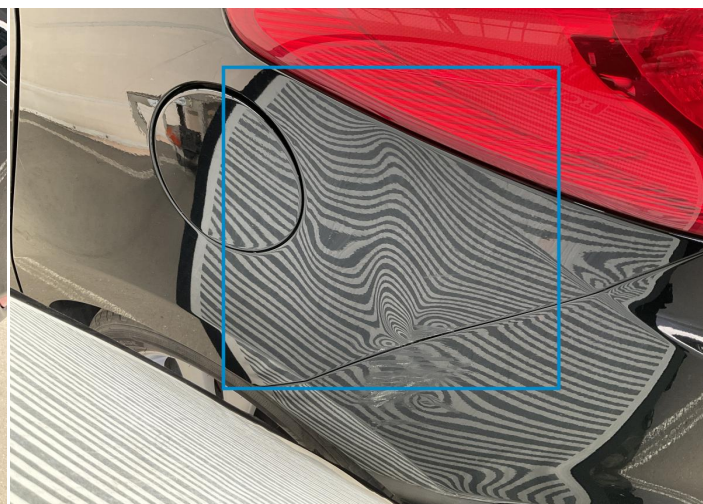

14. Side Panel / Back Left
Bodywork / Dent / Dent -




15. Door / Back Left
Paint / Scratch / Scuff -

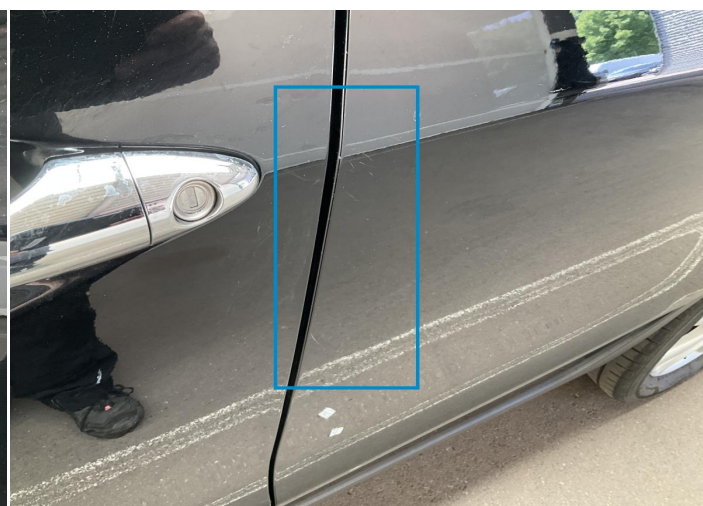

16. Door / Back Left
Paint / Scratch / Scuff -



17. Door / Front Left
Paint / Scratch / Scuff -

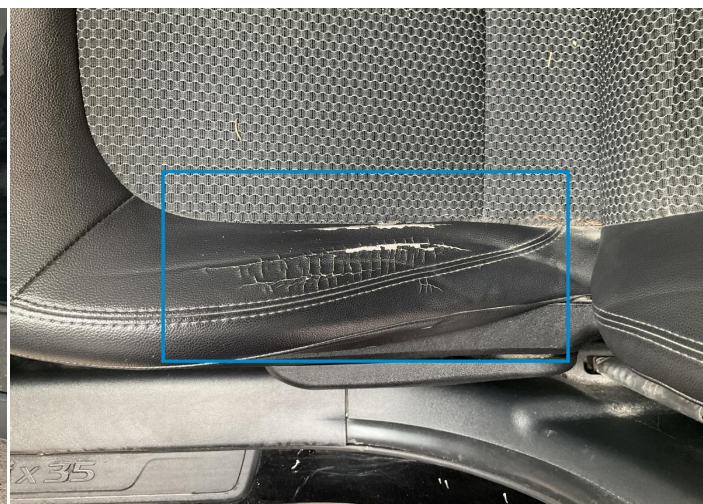

18. Seat Cushion / Front Left
Interior / Holed -



19. Tailgate Upholstery / Back Interior / Scratched -



20. Dashboard / Front Interior / Scratched -



21. Roof
Paint / Scratch / Scuff -

Mechanical Condition

Control Lights

Display Defect	✓	ABS Warning Light	✓
ESP Fault/Traction Control Malfunction Light	✓	Airbag Warning Light	✓
Oil Pressure Warning Light	✓	Brake Warning Light	✓
Power Steering Warning Light	✓	Alternator / Battery	✓
No Dashboard Lights	✓		

Equipments Test

Central Locking	✓	Main & Spare Keys Functioning	✓
Electric Windows	✓	Audio Equipment	✓
AC / Heating System	✓	Other Equipments	✓

Engine

Engine Status / EML	✓	Engine Leak Visible	NA
Engine Starts	✓		

Levels

Brakes Fluid	✓	Coolant Fluid	✓
--------------	---	---------------	---

Test Drive Inspection

Steering Wheel			
Steering Noise / Anomaly		✔	
Engine			
Engine Noise	✔	The Gears Scratch / Skip / Abnormal Operation	✔
Fume Quantity	✔	Power Loss	✔
Clutch			
Clutch Functioning		✔	
Brake			
Brake System Anomaly		✔	
General			
Test Driven Status		✔	
✔ No troubles detected, good condition or correct tests, according to vehicle age and mileage			
! Damages or malfunction detected that requires repairs by the buyer			
NA Not applicable			
= Not tested			

Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description. [User Guide](#)