



status report

Customer:	Allane SE HCBE	Off. Mark :	NF-TS 108E
Report number:	0000000841933-EN968		
reference number:	30946403		

Vehicle Data

Hyundai Kona (OS)(2017->) Edition 30+ Elektro 2WD

Vehicle identification number .:	TMAK281HFNJ053795	mileage read:	57132 km
First Registration / construction Year:	13.04.2022 / 2022	Inspection date/place:	13.05.2025 25813 HUSUM
Bodywork:	Cars	Body type:	hatchback
fuel:	Electric	Transmission type:	Automatic
GPS sat nav disk:	-	Displacement / power:	0 ccm / 100 kW (136 PS)
Drive type:	front-wheel drive	Paint:	Polar White / SOL
Type of paint:	Uni (2 layer)	Doors / seats:	5 / 5
Number of keys:	2	Next HU / AU:	5-20 / 5-20
cushion type:	Substance	Service book available:	Yes
Interior Color:	Black	Maintained service book:	-
smoking vehicle:	No	Last service km / on the:	37629 / 2024-03-21
Vehicle roadworthy:	Yes	Submitted vehicle documents:	Registration Certificate
State outside:	2 - Good	condition inside:	2 - Good

The status Report was created impartially and to the best of my knowledge. The images listed in the status Report are part of the vehicle description regarding the equipment and the vehicle condition.



Mounted tires

	All weather tire	Aluminium original
Tyre / wheel type:		
1st axis - Left / states .	-	215/55/R17/-- 3 mm
1st axis - right / states .	-	215/55/R17/-- 3 mm
2nd axis - Left / states .	-	215/55/R17/-- 4 mm
2nd axis - right / states .	-	215/55/R17/-- 4 mm
Traffic Safety:	Not roadworthy	

Series

- Storage bag on front seat backrests
- Airbag front passenger side can be switched off
- Active brake light (ESS)
- Anti-lock braking system (ABS)
- Audio system: Radio RDS
- Exterior mirror painted
- Roof rails
- Digital Cockpit (Instrumentenanzeige Digital)
- Automatic switch-on for driving lights / light sensor
- Elektromotor 100 kW (cont. 26 kW)
- Fahrassistenz-System: aktiver Spurhalteassistent (LKAS, Lane Keep Assist System)
- Driving assistance system: Autonomous emergency braking function including front collision warning (FCA)
- Driver assistance system: Driving profile selection (Drive Mode)
- Fahrassistenz-System: Sicherheitssystem mit automatischem Notruf (ERA GLONASS / eCall)
- Driving assistance system: lane departure warning system (LDWS, Lane Departure Warning System)
- Electric window lift at the front
- Handsfree Bluetooth
- Countersteering support (Vehicle Stability Management, VSM)
- Luggage net in the luggage / loading space
- Cruise control system (tempomat) with distance control ACC
- Cup holder in front
- Rear window heatable
- Body: 5-door
- Airbag passenger side
- Airbag driver side
- Alarm system
- Drive type: front-wheel drive
- Outside mirror electr. adjustable and heated, both
- Brake Assist
- Roof spoiler
- Rear Parking Sensors
- Electr. Brake force distribution
- Electron. Stability control (ESC) with brake assistant
- Fahrassistenz-System: Aufmerksamkeits-Assistent
- Driver assistance system: hill start assist
- Fahrassistenz-System: Insassenalarm (ROA)
- Fahrassistenz-System: Spurfolgeassistent (Lane Following Assist, LFA)
- Electric window rear
- Fensterheber elektrisch vorn, mit Auf-/Ab-Automatik
- Windscreen with band filter on top
- Gepäck-/Laderaumleuchte
- Luggage compartment cover / roller blind
- Getriebe für Elektrofahrzeug
- Pretensioners
- Isofix seats for child seat
- Climate

- | | |
|---|---|
| <ul style="list-style-type: none"> • Head airbag system • Kühlergrill Wagenfarbe • Ladevorrichtung On-Board-Lader (3-Phasen) • Steering wheel (leather) with multifunction • Steering wheel with paddle shifters • Steering column (steering wheel) longitudinally adjustable • LM rims • Facelift • Notladekabel (ICCB) • Radio reception digital (DAB +) • Tire repair kit • Backup camera • Schalt-/Wählhebel (Shift by Wire) • Window fogging detection / control • Power steering • Seat front left height adjustable • Smart key • Sonderlackierung Dive in Jeju Uni • Start-stop button • Daytime running light LED • Door handles outside body color • USB port + AUX-IN port • Verglasung hinten abgedunkelt (Privacy Glass) • Immobilizer (electronic) • Wärmeschutzverglasung | <ul style="list-style-type: none"> • Headrests adjustable at the back • Charging cable with Type 2 plug • Lumbar support seat front left, electr. adjustable • Steering wheel with multifunction • Steering column (steering wheel) height adjustable • Reading light • Center armrest front with compartment • Navigations-Paket • Parking brake electric (EPB) • Radstand 2600 mm • Tire pressure monitoring system • Rear seat back divided / foldable • Shift / selector lever handle leather • Side airbag in front • Seatbelts height adjustable • Seat cover / upholstery: fabric • Smartphone Schnittstelle (Apple CarPlay & Android Auto) • Sun visors with mirror (illuminated) • Start / Stop system • Touchscreen-Farbdisplay (8,0 Zoll) • Türgriffe innen silber • Glazed tinted • Seat belt warning system, driver / passenger side • Heat pump for heating/air conditioning • Central locking with remote control |
|---|---|

We remind you that the data provided were taken from the DAT database. No liability can be assumed for the completeness and correctness.

General exam

test drive:	Conducted limited Because of the conditions a short test drive could be performed only at a moderate speed . As part of the test drive further tests were carried out. The results are documented later in the report .
Subfloor Inspection:	not possible A visit to the underside of your vehicle could not be performed.
Mileage plausible:	Not testable Not testable
reference:	

Note Road Safe:

Accident claims investigation

Rep. Predamages / -height gross:
Layers of paint thickness
measurement:
Existing collision damage:
reference:

Overview of technical examination

Air conditioning:	Examined limited	✗	Lighting system:	examined limited	✗
Sunroof / convertible:	unavailable	✗	Seat heating:	Examined limited	✗

Damage



Exterior and Styling

	Component	Damage	Rep kind
1.	Front bumper	Wear and tear	Without repair
2.	Front bumper	Wear and tear	Without repair
3.	Roof	Deep scratch	Smart repair
4.	Windshield	Wear and tear	Without repair
5.	Sidewall - Rear - Left	Deep scratch	Smart repair
6.	Rim front - left	Damaged	Smart repair
7.	Rear Door - Right	Dented	Gentle refurbishing
8.	Hood	Wear and tear	Without repair
9.	Front door - left	Deep scratch	Smart repair
10.	Front door - left	Wear and tear	Without repair
11.	Rear Bumper	Deep scratch	Smart repair
12.	Rim rear - right	Damaged	Smart repair
13.	Outside mirror - left	Chipping from stones	Smart repair
14.	Rim front - right	Damaged	Smart repair



Inner body

	Component	Damage	Rep kind
15.	covering	Wear and tear	Without repair
16.	covering	Wear and tear	Without repair
17.	Steering wheel (leather)	Deep scratch	Replace
18.	tailgate trim	Damaged	Replace



Others

Component	Damage	Rep kind
-----------	--------	----------

19.	Sitz Innenraum rechts vorne	Dirty	cleaning
20.	Verlust der Herstellergarantie und jeglicher Kulanz möglich.		
21.	maintenance	Missing	Replace
22.	4 Reifen	Not safe for road traffic	Replace
23.	hand tools	Missing	Replace
24.	main inspection	Missing	Replace

A Pre Damage check is being made solely in the context and the possibilities of a visual inspection and measurement of paint layers without a Disassembly of components. A possible existence of pre-damages is unknown.

The expert points out that the vehicle in addition to the age- damage listed in the report and may have a high mileage - related wear , as in normal use are inevitable (small bumps , dents , scratches) .

There shall be no liability accepted for any defect and / or remained hidden damage in terms of electronics and mechanics, as well as for fraudulent misrepresentation and concealed defects .



Hüsge Gruppe®
Die Gutachter

Photo documentation



front Left



front Right



rear Left



rear Right



trunk



Inside



instrument cluster



mileage




center console



key



key

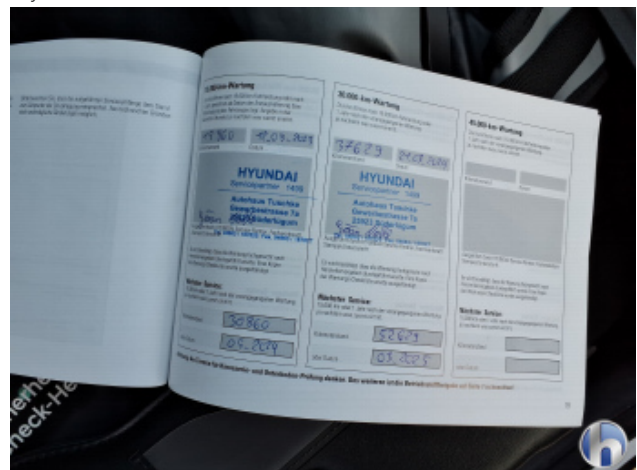

Service book / proof



Others



Others



Others



engine compartment



rims



tires



tires



tires



tires



1. Front bumper
Wear and tear - Without repair



2. Front bumper
Wear and tear - Without repair



3. Roof
Deep scratch - Smart repair



4. Windshield
Wear and tear - Without repair




5. Sidewall - Rear - Left
Deep scratch - Smart repair



6. Rim front - left
Damaged - Smart repair



7. Rear Door - Right
Dented - Gentle refurbishing

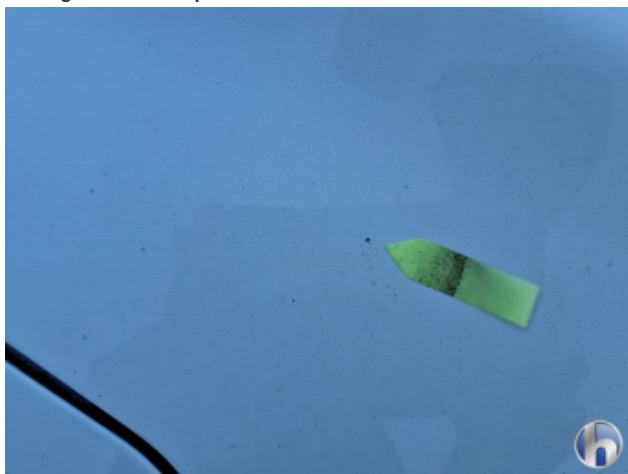

8. Hood
Wear and tear - Without repair



9. Front door - left
Deep scratch - Smart repair



10. Front door - left
Wear and tear - Without repair



11. Rear Bumper
Deep scratch - Smart repair



12. Rim rear - right
Damaged - Smart repair



13. Outside mirror - left
Chipping from stones - Smart repair



14. Rim front - right
Damaged - Smart repair



15. covering
Wear and tear - Without repair



16. covering
Wear and tear - Without repair



17. Steering wheel (leather)
Deep scratch - Replace



18. tailgate trim
Damaged - Replace



19. Sitz Innenraum rechts vorne
Dirty - cleaning



19. Sitz Innenraum rechts vorne
Dirty - cleaning



19. Sitz Innenraum rechts vorne
Dirty - cleaning



19. Sitz Innenraum rechts vorne
Dirty - cleaning



19. Sitz Innenraum rechts vorne
Dirty - cleaning



19. Sitz Innenraum rechts vorne
Dirty - cleaning