



SKODA Octavia
Octavia Combi 2.0 TSI (Green tec) DSG

VIN NO TMBJE7NE0G0105490
Registration Number E0G0105490



MOT Date

2026-11-01

Last Service

2020-12-03

Number of Owners

2

Last Service Mileage

96448

Number of Keys

2

First Registration Date

2015-12-14

Odometer Reading

128233 km

Country First Registered

Germany

Inspection Report Summary

Customer	BCA Online	Report Number	P20250926085904
Inspection Date / Place	2025-09-26 / ARS Altmann AG Riedstadt	Cosmetic Grade	3


Vehicle Summary


Vehicle Condition	Runner	VAT Type	Margin
Fuel Type	Petrol	Road Worthy	Yes
Colour	Blue	Engine Size (cc)	1984
Engine Size	2.0	No of Doors	5
Body Type	Stationwagon / Estate	Drive Train	Front
Seat Colour		No of Seats	5
Seat Covering Name		Seat Covering	Synthetic Leather
Charging Cables		NEDC CO2 Rating (q/km)	149
Gearbox Type	Automatic		

Vehicle History & Documents

Service Book Available	Computer Print Out Available	Next Service Mileage	km
Previous Usage		Imported	No
Manufacturer Warrenty			



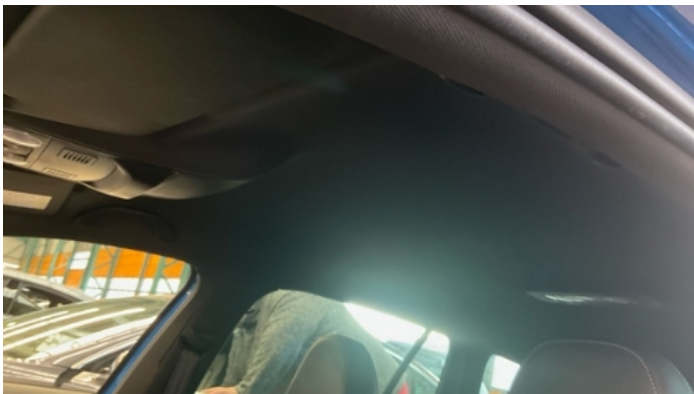

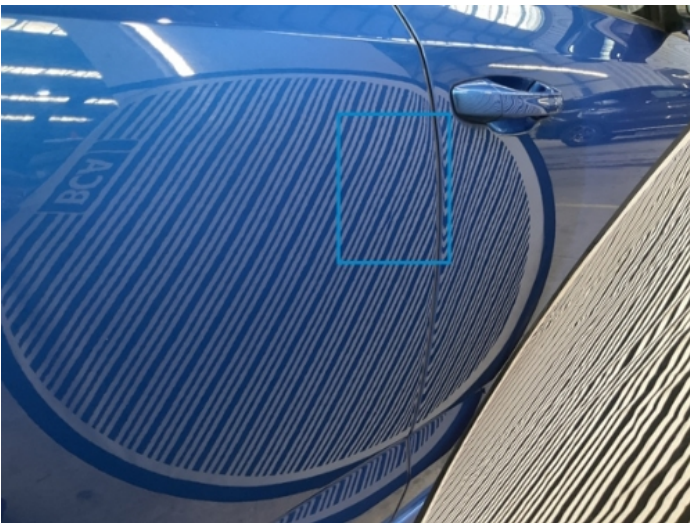

Equipment

Trip Computer	Airbag Status	Anti-lock braking	Bluetooth telephone interface
Headlamp wash/wipe	Remote adjusting wing mirrors	Roof rails	Stability control
Electrically folding wing mirrors	Radio	USB Socket	Alloys wheels
Auxiliary Socket	Cruise control	Heated wing mirrors	Remote central locking
Satellite navigation	Xenon headlamps	Leather steering wheel	Rear parking sensors

Equipment Details


Air Conditioning	Dual Zone Climate Control	Alloy Wheel Size	18
Extra Wheel / Tyre Set	Winter Tyres - Alloy	Seat Heating	Front

Wheels & Tyres


Extra Wheel - 1 Tyre Depth	7	Extra Wheel - 2 Tyre Depth	7
Extra Wheel - 3 Tyre Depth	6	Extra Wheel - 4 Tyre Depth	6
Right Front Tyre Depth	5	Left Front Tyre Depth	5
Right Rear Tyre Depth	5	Left Rear Tyre Depth	5

Cosmetic Damage

18 Schäden

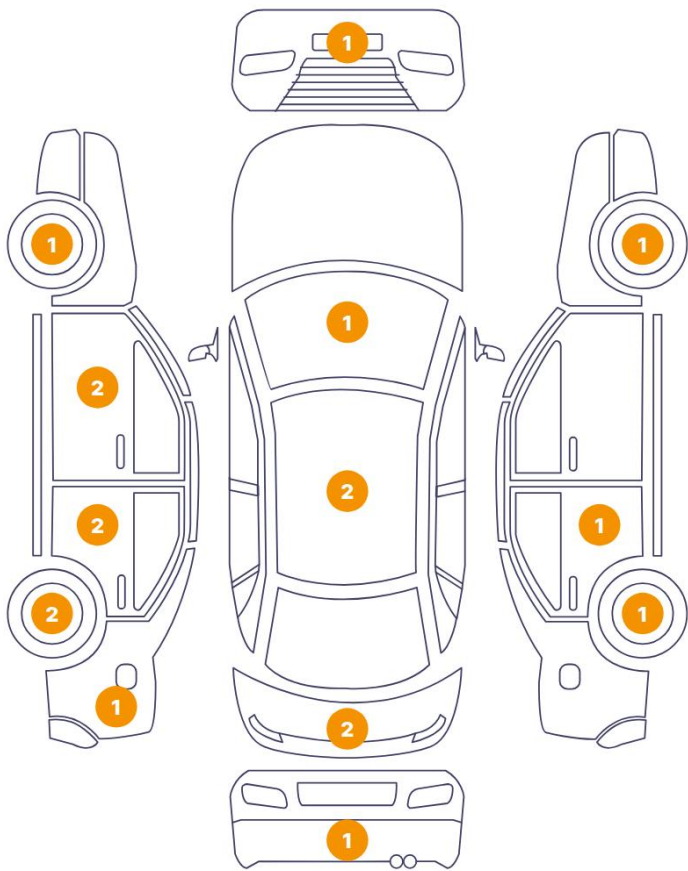

1 Schäden

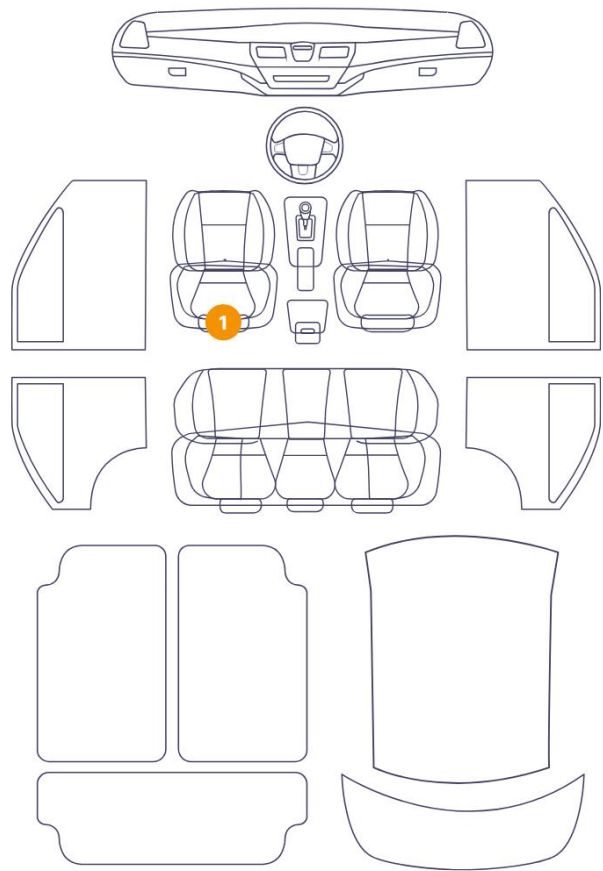

Component		Damage	Comments
1	Windshield / Front	Paint / Chipping	
2	Bumper / Front	Paint / Scratch / Scuff	
3	Rim / Front Left	Out of Bodywork / Scratch	
4	Seat / Front Left	Interior / Scratched	
5	Door / Front Left	Bodywork / Dent / Dent	
6	Roof	Bodywork / Dent / Dent	
7	Roof	Bodywork / Dent / Dent	
8	Door / Front Left	Bodywork / Dent / Dent	
9	Door / Back Left	Paint / Scratch / Scuff	
10	Window Cover / Back Left	Paint / Scratch / Scuff	
11	Rim / Back Left	Out of Bodywork / Scratch	
12	Fender / Back Left	Paint / Scratch / Scuff	


13	Bumper / Back	Bodywork / Dent / Dent
14	Rear Window / Back	Glass Break / Scratch / Scratch
15	Tailgate	Paint / Scratch / Scuff
16	Rim / Back Left	Out of Bodywork / Scratch
17	Tire / Back Right	Tire
18	Door / Back Right	Bodywork / Dent / Dent
19	Rim / Front Right	Out of Bodywork / Scratch




1. Windshield / Front
Paint / Chipping -




2. Bumper / Front
Paint / Scratch / Scuff -

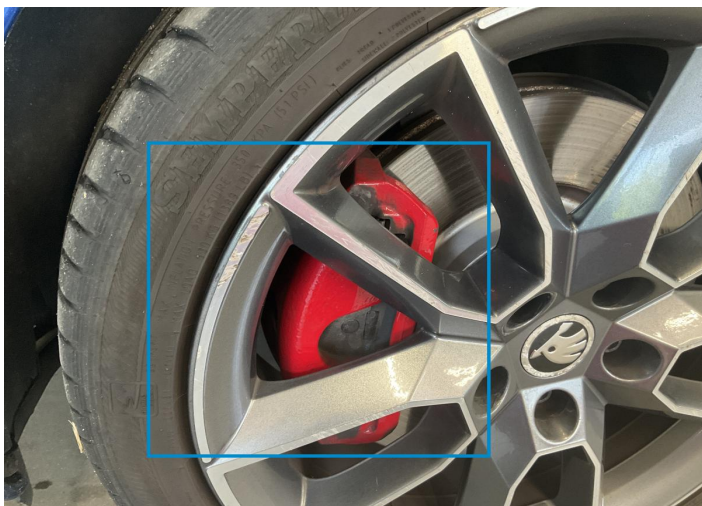

3. Rim / Front Left
Out of Bodywork / Scratch -

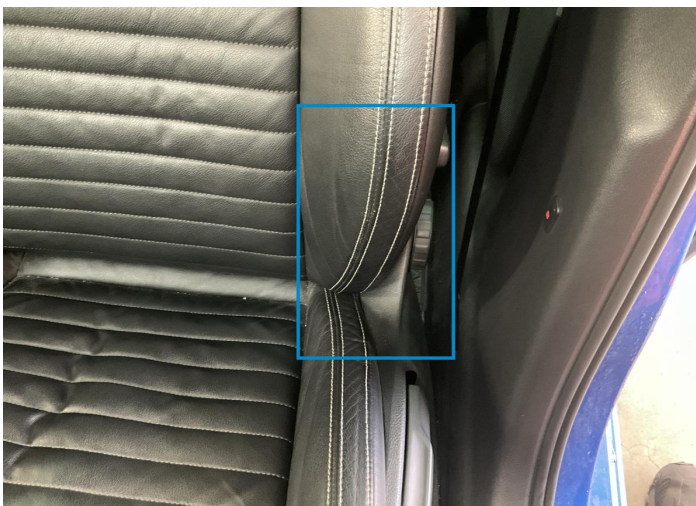


4. Seat / Front Left
Interior / Scratched -

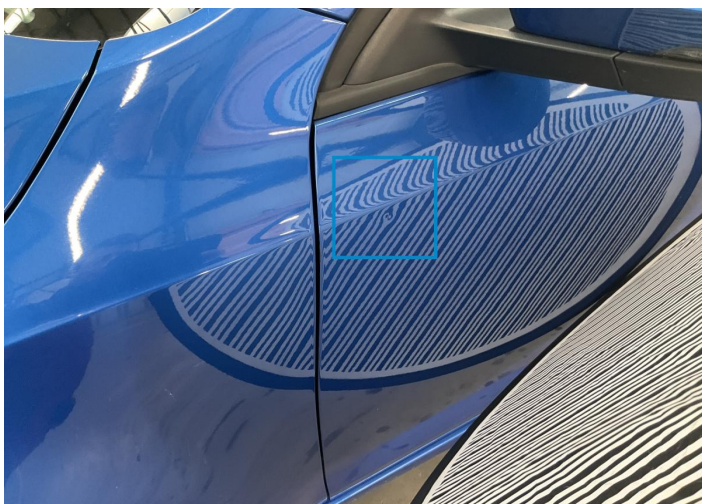


5. Door / Front Left
Bodywork / Dent / Dent -



6. Roof
Bodywork / Dent / Dent -

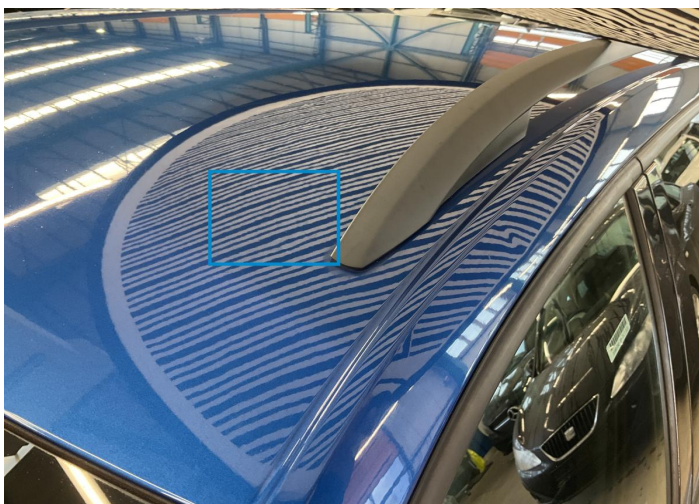

7. Roof
Bodywork / Dent / Dent -

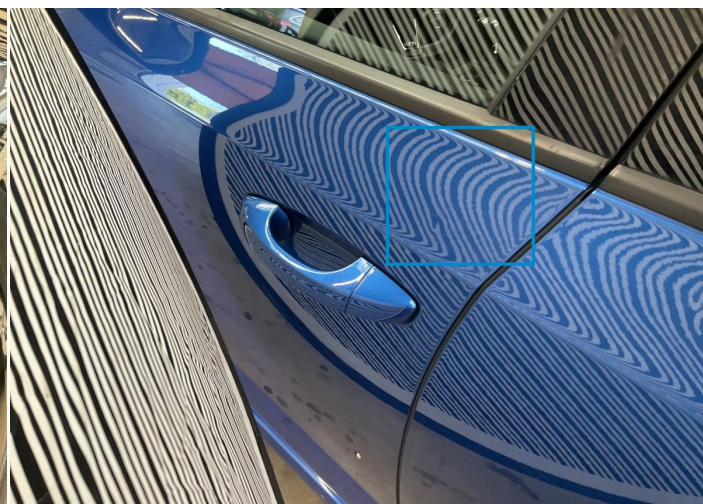

8. Door / Front Left
Bodywork / Dent / Dent -




9. Door / Back Left
Paint / Scratch / Scuff -



10. Window Cover / Back Left
Paint / Scratch / Scuff -




11. Rim / Back Left
Out of Bodywork / Scratch -

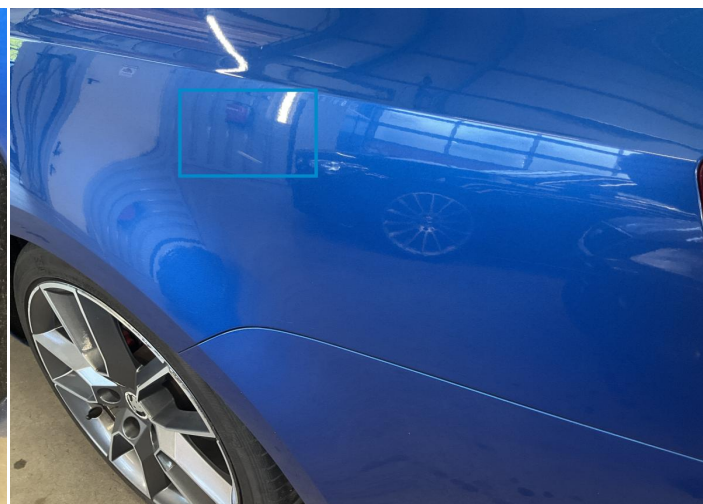

12. Fender / Back Left
Paint / Scratch / Scuff -



13. Bumper / Back
Bodywork / Dent / Dent -

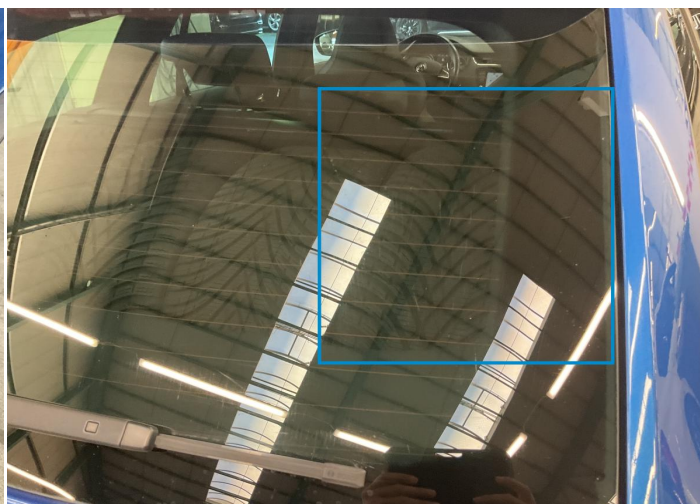


14. Rear Window / Back
Glass Break / Scratch / Scratch -




15. Tailgate
Paint / Scratch / Scuff -



16. Rim / Back Left
Out of Bodywork / Scratch -

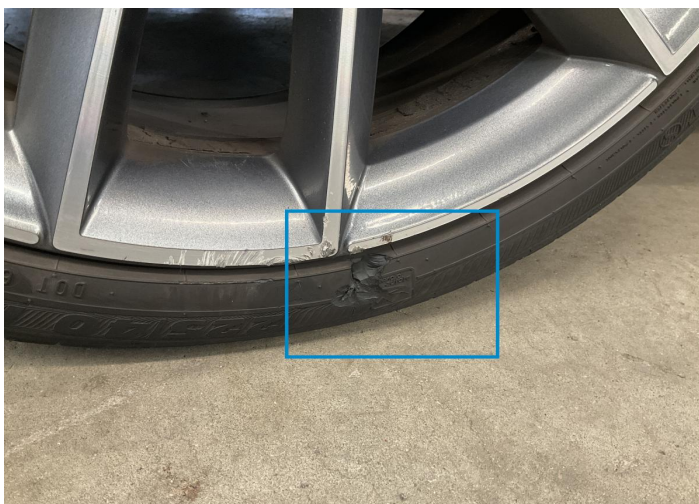

17. Tire / Back Right
Tire -

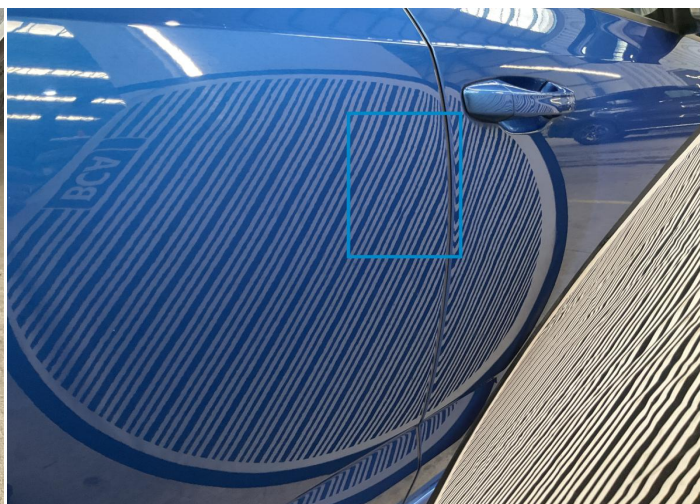

18. Door / Back Right
Bodywork / Dent / Dent -



19. Rim / Front Right
Out of Bodywork / Scratch -

Mechanical Condition

Control Lights

ABS Warning Light	✓	ESP Fault/Traction Control Malfunction Light	✓
Airbag Warning Light	✓	Oil Pressure Warning Light	✓
Brake Warning Light	✓	Power Steering Warning Light	✓
Alternator / Battery	✓	No Dashboard Lights	✓
Display Defect	✓	Service Light	✓
Tire Pressure Monitoring System	✓		

Engine

Engine Status / EML	✓	Engine Starts	✓
Engine Leak Visible	✓		

Gearbox

Gear Box	✓
----------	---

Equipments Test

Other Equipments	✓	Central Locking	✓
Main & Spare Keys Functioning	✓	Electric Windows	✓
Navigation System	✓	Audio Equipment	✓
Parking Sensors / Cameras Functioning	✓	AC / Heating System	✓

Levels

Brakes Fluid	✓	Coolant Fluid	✓
--------------	---	---------------	---

Test Drive Inspection

Brake			
Brake System Anomaly		✓	
Steering Wheel			
Steering Noise / Anomaly		✓	
Engine			
Engine Noise	✓	The Gears Scratch / Skip / Abnormal Operation	✓
Fume Quantity	✓	Power Loss	✓
General			
Test Driven Status		✓	
✓ No troubles detected, good condition or correct tests, according to vehicle age and mileage			
! Damages or malfunction detected that requires repairs by the buyer			
NA Not applicable			
= Not tested			

Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description.

[User Guide](#)