



SKODA Octavia Combi: 1WUF485

Vinnnumber:	TMBJG7NE8K0227078	Versionname:	Octavia Combi 1.6 CRTDI GreenTec DSG7 Ambition
First Registrationdate:	17/09/2019	Fiscalpower:	85kW/115pk 5D/P Auto-7
Expertise Mileage:	99137	Power Kw:	
Bodytype:		Body colour	Grey
Gearbox:	Automatic	Type of rims (mounted)	Steel
Transmission:	Front	Parking lot	b212
Fueltype:	Diesel		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Type of rims (mounted)	Steel		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		
Bodywork	Clean		
Interior	Dirty		

Options

Number of keys total	2	Radio
Number keys remote	2	Front parking sensors
Windows electric F		Rear parking sensors
Windows electric R		Fog lights (front)
Cruise Control		
Steering wheel multifunctional		
Navigation with screen		
Airco electronic		

Limited Technical Inspection

Airco functioning	Yes	Sound engine	NOT OK
Idle position	OK	Clutch test	OK
Engine startingtime	OK	Transmission	OK
Exhaust gass	OK		

Degree of wear

205/55/16/91 H				
Winter tyres:	Fr.L.	Continental: 2 mm	Fr.R.	Continental: 2 mm
	Re.L.	Firestone: 2 mm	Re.R.	Firestone: 2 mm
Tyre profile depth FL				2.0
Tyre profile depth FR				2.0
Tyre profile depth RL				2.0
Tyre profile depth RR				2.0
Tyre size FL				205/55 R 16 91 H
Tyre size FR				205/55 R 16 91 H
Tyre size RL				205/55 R 16 91 H
Tyre size RR				205/55 R 16 91 H
Tyre type FL				Winter
Tyre type FR				Winter
Tyre type RL				Winter
Tyre type RR				Winter
Tyre make FL				256
Tyre make FR				256
Tyre make RL				258
Tyre make RR				258

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Interior, Damaged, Acceptable



Floor covering FL, Hole, Smart repair



Seat cover FL, Stain, Cleaning



Bumper F, Scratch(es), Acceptable



Windscreen, Stone chip(s), Replace



Bonnet, Scratch(es), Repair and paint (complete)



Wheel cover FL, Scratch(es), Replace




Outside rear-view mirror housing L. Scratch(es), Acceptable



Door RL, Dent(s) and scratch(es), Acceptable



Wing RL, Dent(s) and scratch(es), Repair and paint (complete)

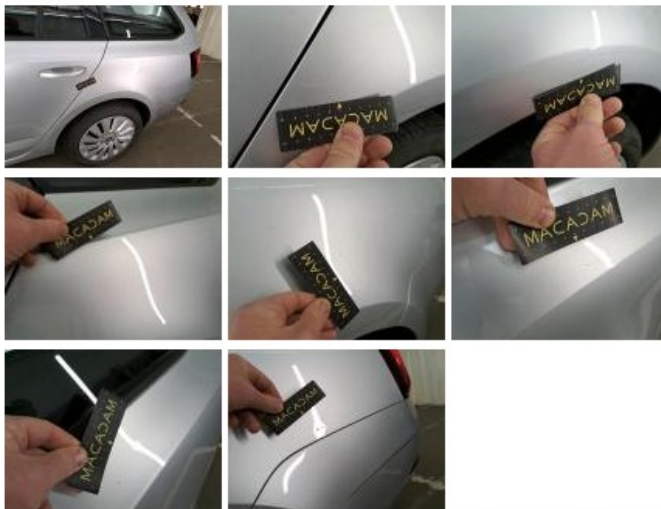

Wheel cover RL, Scratch(es), Replace



Step L, Dent(s) and scratch(es), Spot repair



Door RL, Dent(s) and scratch(es), Spot repair



Rear window, Scratch(es), Acceptable





Reflector, Broken, Replace



Bumper R, Scratch(es), Acceptable



Boot moulding, Deformed / Strained, Acceptable



Wheel cover FR, Scratch(es), Replace



Wing FR, Scratch(es), Polish



Door RR, Dent(s), Acceptable



Wing RR, Dent(s) and scratch(es), Acceptable



Wheel cover RR, Scratch(es), Replace

