



Expertise

Protocol number: 41495666  
Order No. / Reference: 25195469  
Inspection date: 10 Sept 2025

Manufacturer: Skoda  
VIN: TMBJJ0NX3MY157004

Model: Octavia Combi 2.0 TDI Style



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Octavia Combi 2.0 TDI Style	
Vehicle Identification number	TMBJJ0NX3MY157004
Mileage (Read)	130,173 km
First registration	17 Jun 2021
Number of holders	1
Next periodical technical inspection	07/2026
(Report on hand)	
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Lava-Blau Metallic (W5Q)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



## Vehicle details

<b>Maintenance booklet / proof</b>	digital proof / complete	<b>Next maintenance in</b>	3,400 km
<b>Last maintenance on / at</b>	05/2025 at 120,093 km		
<b>Key is / should be</b>	2 / 2	<b>FZG documents</b>	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		<b>Letter No.</b>	GD042731
<b>Previous damage / Accident</b>	Detectable	<b>Repainting</b>	Detectable
<b>Inspection conditions</b>	sufficient	<b>Lifting equipment / pit</b>	yes
<b>Test drive</b>	Not performed	<b>Engine function test</b>	Performed
<b>Manufacturer key number/ type code number</b>	8004 / AWL 00069		
<b>Emission standard</b>	EURO6;WLTP;AP;PI/CI; M, N1 I	<b>Fine dust sticker</b>	
<b>Permitted total weight</b>	1,960 kg	<b>Empty weight</b>	

## Tyres

### Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R17 95V	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	205/55 R17 95V	Summer tyres on Light alloy	Continental	6mm / 6mm

### Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92H	Winter tyres on Light alloy	Continental	7mm / 7mm
2)	205/60 R16 92H	Winter tyres on Light alloy	Continental	7mm / 7mm

### Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2029		

**Legend:** Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



## Equipment

### Standard equipment

- Storage compartment in the luggage compartment with cargo element
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Dashboard center section with fabric cover
- Exterior mirrors electrically adjustable and heated
- Exterior mirrors, electrically folding
- Hill start assist including auto-hold function
- Hydraulic brake assist (HBA)
- Grey headliner
- diesel particulate filter
- tachometer
- Electronic parking brake
- Electronic Stabilization Control (ESC)
- Driving profile selection
- Front radar assistant including city emergency braking function and person and cyclist detection
- Transmission: 6-speed manual transmission
- Green tec: Automatic start/stop system including brake energy recovery
- Rear window wiper including windscreen washer system
- ISOFIX preparations on the front passenger seat and the outer rear seats including top tether anchorage
- Climatronic air conditioning (2 zones)
- Headrests (5) front and rear height adjustable
- LED rear lights
- LED headlights with LED daytime running lights
- Steering wheel: height and length adjustable
- Manual headlight range adjustment
- Rear center armrest with through-loading option
- Engine drag torque control (MSR)
- Upholstery: Cloth
- Radio accessories: 2 USB-C ports at the front
- Radio accessories: 8 speakers
- Radio accessories: voice control
- Tire pressure monitoring
- Wheels: 17" Rotare AERO alloy wheels
- Seat belts
- Seats: Heated front seats
- Seats: Height-adjustable driver and passenger seats
- Seats: Rear seat backrest 60:40 split folding
- Speed limiter
- Lane change and rear parking assistant
- Telephone: Phonebox with inductive charging function (connection via the external antenna)
- Bluetooth hands-free phone system
- Shelves
- Airbag, driver and passenger
- Airbag, head airbags
- Ambient lighting
- Traction control (ASR)
- Automatically dimming exterior mirror (driver's side)
- Exterior mirrors with memory function
- Heated windscreen washer nozzles including 5l washer fluid reservoir
- Glasses compartment on the roof lining
- Roof rails, anodized
- Digital instrument cluster (Virtual Cockpit) 10.2"
- Third brake light
- Electronic transverse differential lock (XDS+)
- Driving light assistant
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Cruise control system
- Tinted windows
- Taillights in crystal glass look and animated indicators
- Heated rear window
- Interior mirror automatically dimming
- Kessy, keyless entry and start-stop system
- Electronic child lock
- Removable trunk cover
- LED fog lights
- LED license plate lighting
- Remote release of the rear seat backrests in the trunk
- Steering wheel: Leather steering wheel with multifunction buttons
- Front center armrest, including storage compartment
- Parking sensors front and rear
- Radio: Bolero music system with capacitive 10" color display
- Radio accessories: Digital radio reception DAB+
- Rain sensor
- Tire mobility set
- Power steering, electromechanical
- Safety lights in the front side doors
- Seats: Electrically adjustable front seats with memory function
- SKODA Care Connect
- Lane keeping assistant (Lane Assist)
- 12-V socket in the trunk
- Phone: SmartLink (MirrorLink, Apple CarPlay, Android Auto)
- Phone: Wireless SmartLink for Apple CarPlay
- Lashing eyes in the trunk
- Central locking including remote control integrated in the key and EASY Start



- Immobiliser

### Extra equipment

- Trailer coupling, pivoting including trailer stabilization and adapter
- Package: Lights & Vision (cornering light in the fog lights - headlight cleaning system - LED ambient lighting - LED main headlights matrix and dynamic high beam assistant (AFS) - taillights in crystal glass look and animated indicators)
- Package: Safety (Style) (Drowsiness detection - Center airbag front - Side airbags rear - Proactive occupant protection with rear impact detection)
- Heated windshield
- Paint finish: metallic
- Package: Infotainment Columbus Plus (Combi) (Columbus navigation system - Infotainment Online (3-year term) - Head-Up Display - Luggage net partition)
- Package: Travel & Comfort (Traveler assistance system: - Traffic sign recognition - Predictive and adaptive cruise control (pACC) - Adaptive lane keeping assist - Capacitive steering wheel with hands-off detection - Adaptive cruise control (ACC) (control range 210 km/h) - Drowsiness detection - Driving profile selection - Adaptive chassis (DCC) - Automatically dimming exterior mirror (driver's side))

### Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

### Value reducing factors

No.	Component group	Description
1	Trim / covers	Floor mats (Vorne links) - Holes - Replace
2	Interior	Rear shelf - Soiled - Clean
3	Seat - front	Seat cover - left side - Soiled - Clean
4	Rear bumper	Bumper - rear centre - Scratch(es) - Smart repair
5	Trim / covers	Carpet - front left side - Holes - Smart repair
6	Equipment	Vehicle key (Abdeckung fehlt) - Incomplete - Replace
7	Side panel - rear right side	Side panel - Dent / paintcoat damage - Repair and paint

### Wear and tear

No.	Component group	Description
1	Body	Underbody panelling - Scratch(es) - No deduction
2	Front bumper	Front bumper - Scratch(es) - No deduction
3	Side panel - rear left side	Side panel (1) - dent(s) - Smart repair
4	Door - rear left side	Door (1) - dent(s) - Smart repair

The vehicle shows signs of wear commensurate with its age and use.

### Missing parts

#### Description

Equipment - Umbrella (1 von 2)



## Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer	1.404,20 €

## Repainting

### No. Repainting

1	Side panel - rear left side, Door - rear left side, Professionally carried out, Invoice of repair done Non-existent
---	---

## Paint coat thickness measurement

Side panel - rear left side	259 µm	Door - rear left side	180 µm
-----------------------------	--------	-----------------------	--------

## Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features  
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.  
(Functional tests of driver assistance systems are not included in the scope of services!)
- a photo documentation of the vehicle

## Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

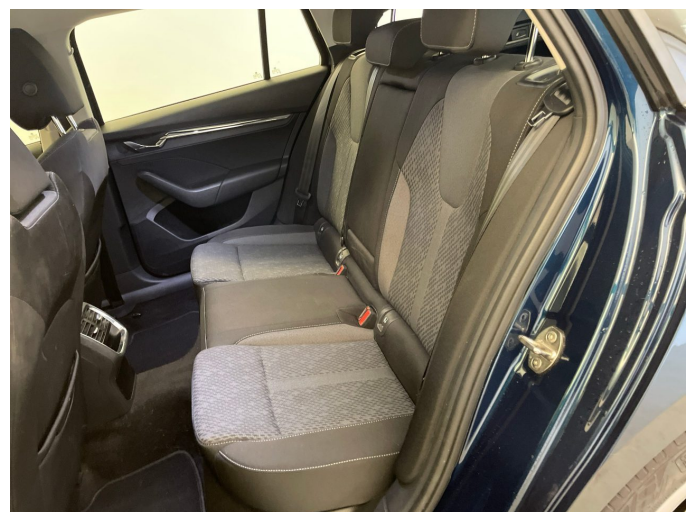


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

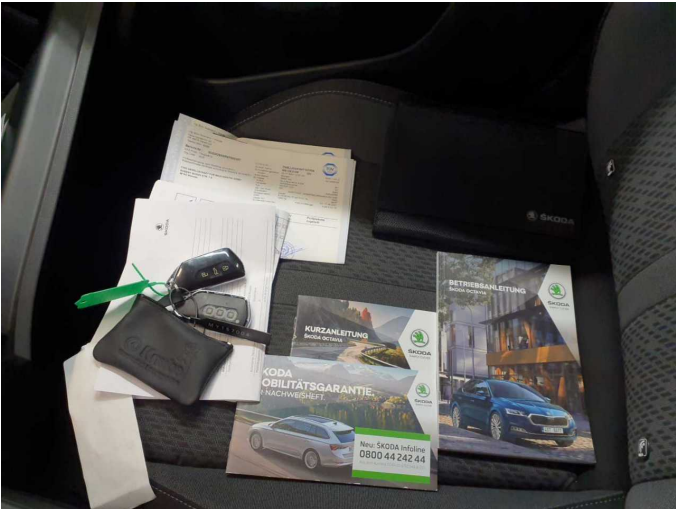


Figure 13: Documents

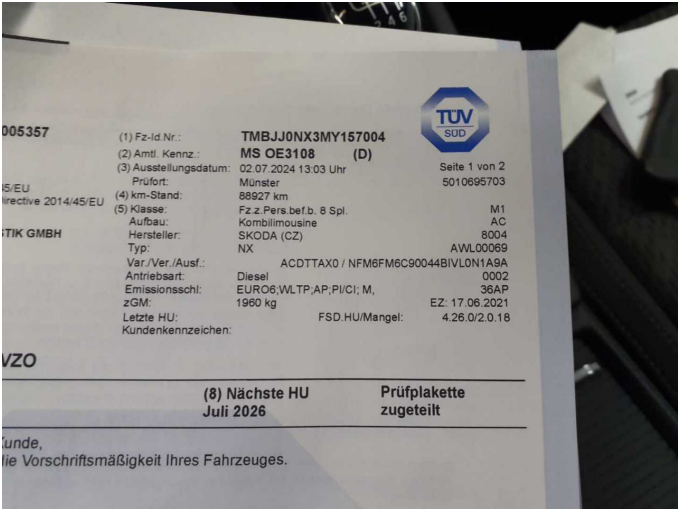


Figure 14: Documents

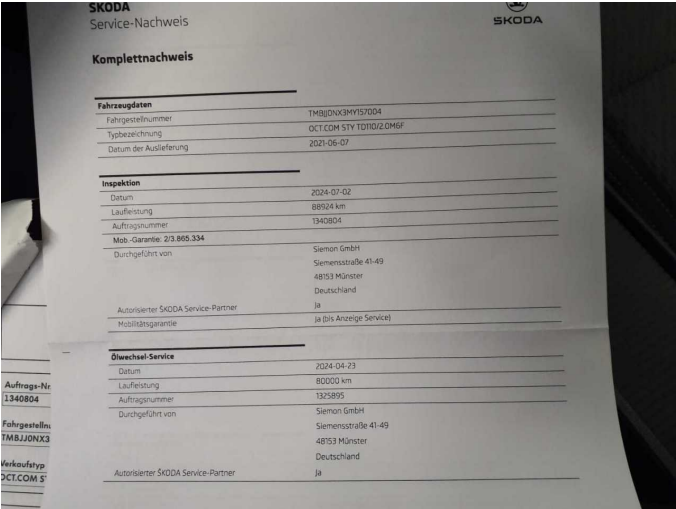


Figure 15: Documents

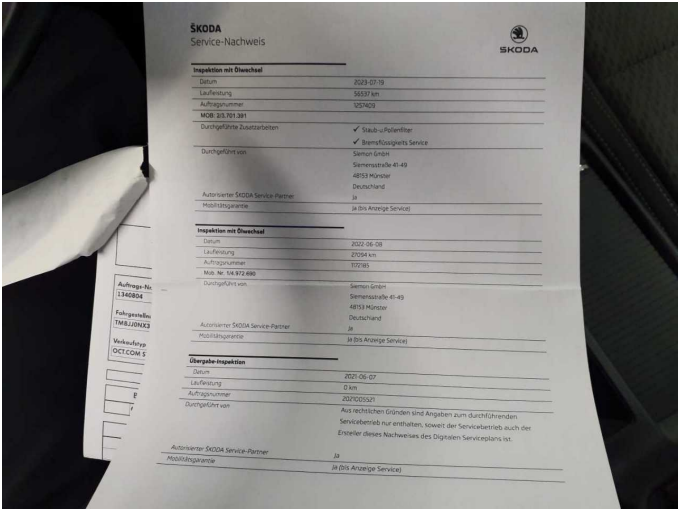


Figure 16: Documents

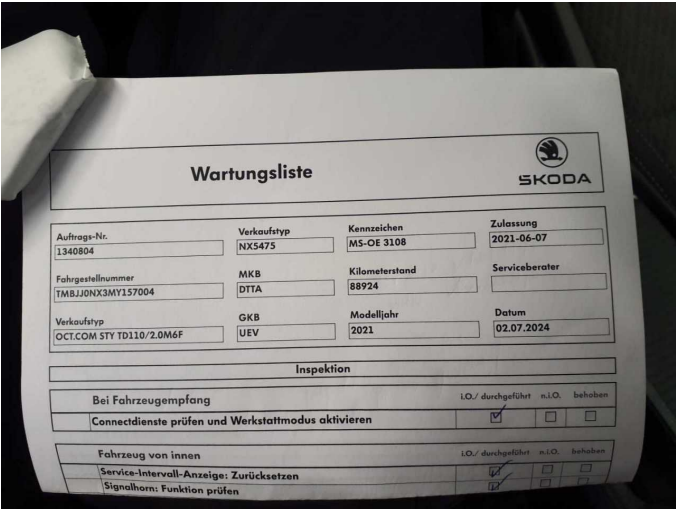


Figure 17: Documents



Figure 18: Additional tyres



Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

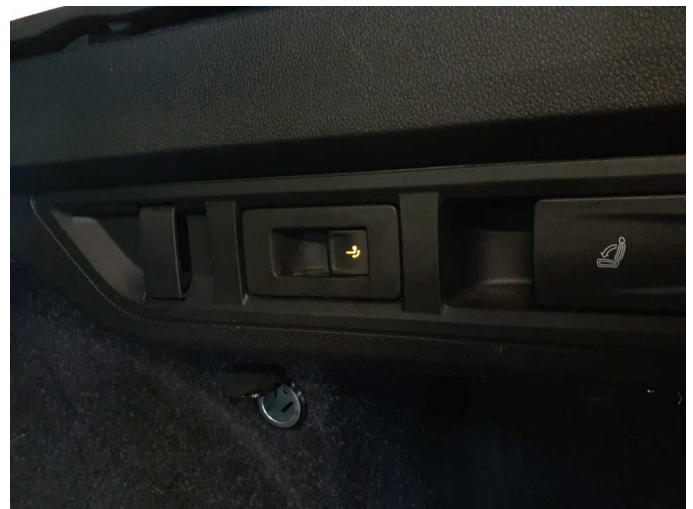


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Damage 1: Trim / covers: Floor mats (Vorne links) - Holes - Replace



**Damage 1:** Trim / covers: Floor mats (Vorne links) - Holes - Replace




**Damage 2:** Interior: Rear shelf - Soiled - Clean




**Damage 2:** Interior: Rear shelf - Soiled - Clean




**Damage 2:** Interior: Rear shelf - Soiled - Clean

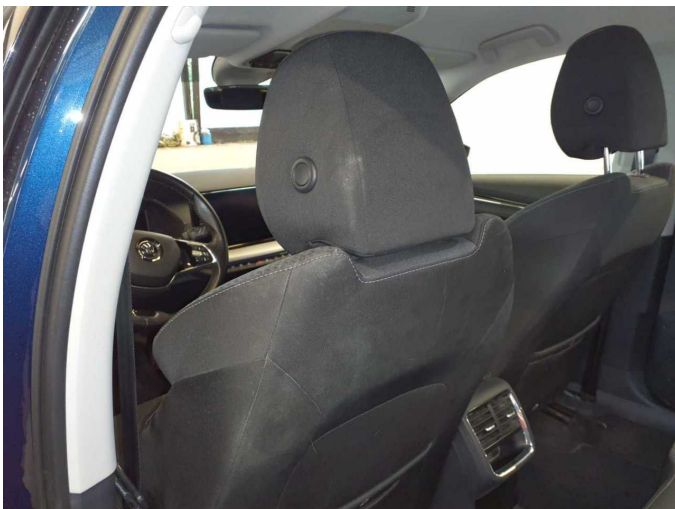

**Damage 3:** Seat - front: Seat cover - left side - Soiled - Clean

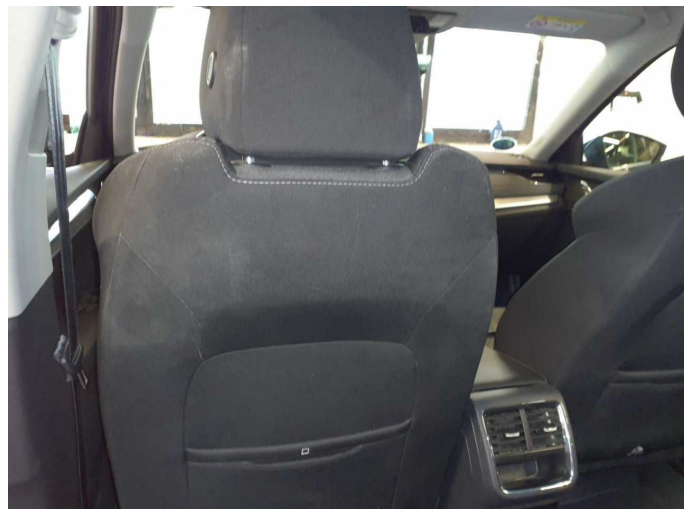

**Damage 3:** Seat - front: Seat cover - left side - Soiled - Clean

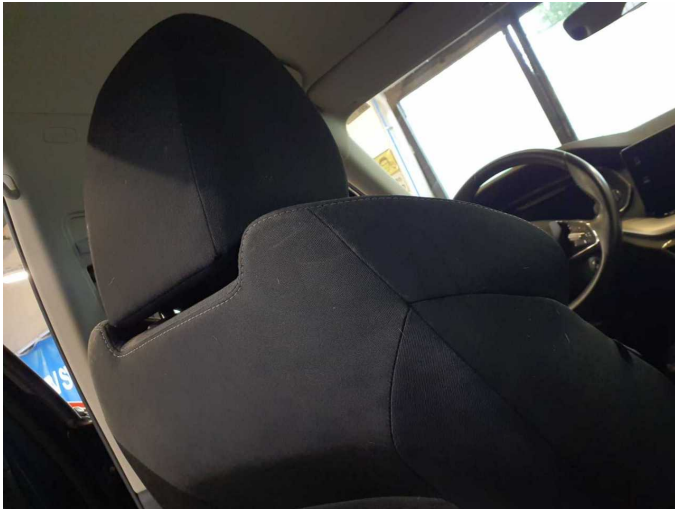

**Damage 3:** Seat - front: Seat cover - left side - Soiled - Clean



**Damage 4:** Rear bumper: Bumper - rear centre - Scratch(es) - Smart repair



**Damage 4:** Rear bumper: Bumper - rear centre - Scratch(es) - Smart repair



**Damage 4:** Rear bumper: Bumper - rear centre - Scratch(es) - Smart repair



**Damage 4:** Rear bumper: Bumper - rear centre - Scratch(es) - Smart repair




**Damage 4:** Rear bumper: Bumper - rear centre - Scratch(es) - Smart repair



**Damage 5:** Trim / covers: Carpet - front left side - Holes - Smart repair



**Damage 5:** Trim / covers: Carpet - front left side - Holes - Smart repair

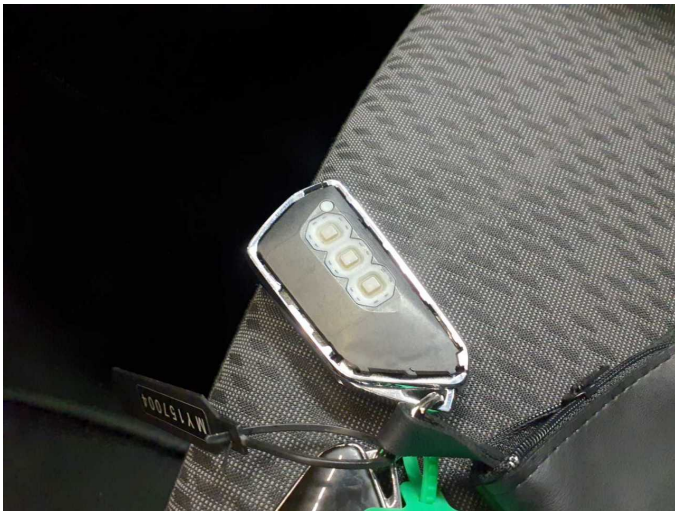

**Damage 6:** Equipment: Vehicle key (Abdeckung fehlt) - Incomplete - Replace



**Damage 7:** Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



**Damage 7:** Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



**Damage 7:** Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



**Damage 7:** Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint




**Damage 7:** Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint




**Damage 7:** Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



**Damage 7:** Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

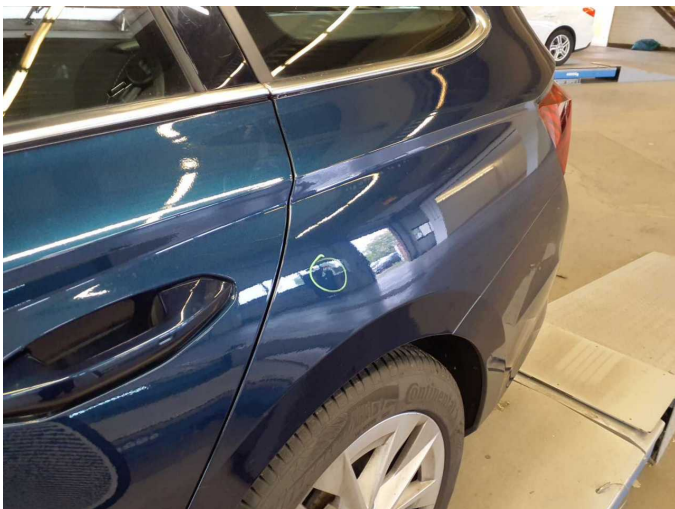

**Wear and tear 3:** Side panel - rear left side: Side panel (1) - dent(s) - Smart repair

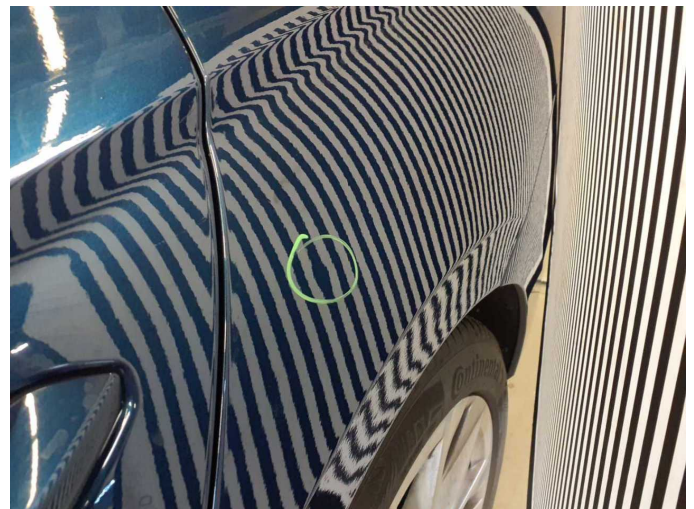

**Wear and tear 3:** Side panel - rear left side: Side panel (1) - dent(s) - Smart repair



**Wear and tear 4:** Door - rear left side: Door (1) - dent(s) - Smart repair



**Wear and tear 4:** Door - rear left side: Door (1) - dent(s) - Smart repair



**Missing part 1:** Equipment: Umbrella (1 von 2) - Missing - Replace



**Repainting 1:** Side panel - rear left side, Door - rear left side



**Repainting 1:** Side panel - rear left side, Door - rear left side