



Expertise

Protocol number: 41306892  
Order No. / Reference: 25149995  
Inspection date: 1 Sept 2025

Manufacturer: Skoda  
VIN: TMBJJ7NS9N8057357

Model: KODIAQ 2.0 TDI DSG Clever



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda KODIAQ 2.0 TDI DSG Clever	
Vehicle Identification number	TMBJJ7NS9N8057357
Mileage (Read)	96,200 km
First registration	5 Jul 2022
Number of holders	1
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic transmission / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	moonweiss-metallic (S9R)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



## Vehicle details

<b>Maintenance booklet / proof</b>	digital proof / complete	<b>Next maintenance in</b>	15,000 km
<b>Last maintenance on / at</b>	08/2025 at 96,123 km		
<b>Key is / should be</b>	2 / 2	<b>FZG documents</b>	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		<b>Letter No.</b>	GJ927983
<b>Previous damage / Accident</b>	Detectable	<b>Repainting</b>	None detectable
<b>Inspection conditions</b>	sufficient	<b>Lifting equipment / pit</b>	yes
<b>Test drive</b>	Not performed	<b>Engine function test</b>	Performed
<b>Manufacturer key number/ type code number</b>	8004 / ART 02725		
<b>Emission standard</b>	EURO6;WLTP;AP;PI/CI; M, N1 I	<b>Fine dust sticker</b>	
<b>Permitted total weight</b>	2,350 kg	<b>Empty weight</b>	

## Tyres

### Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 99V	Summer tyres on Light alloy	Hankook	3mm / 3mm
2)	235/50 R19 99V	Summer tyres on Light alloy	Hankook	5mm / 5mm

### Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Continental	7mm / 7mm

### Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2026		

**Legend:** Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

## Equipment

### Standard equipment

- 12V socket in the center console and trunk
- Storage compartments behind the wheel arch in the trunk
- Aero wipers front
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Dashboard in black / black, door trim in black
- Electrically folding exterior mirrors including interior and driver's mirror with automatic dimming
- Hill start assist
- Care Connect: Proactive Services (10-year term)
- Roof rails, black
- Decorative inlay CLEVER
- diesel particulate filter
- Third brake light
- eCall
- Electric tailgate operation with comfort opening
- Electronic transverse differential lock (XDS+)
- Headlight assistant and rain sensor
- High beam assistant (Light Assist)
- Floor mats front and rear
- Closed storage compartment on the driver's side
- Tinted windows
- Isofix anchorage on the outer rear seats including top tether
- Trunk cover, rollable and removable
- LED ambient lighting
- LED taillights in crystal glass look & LED license plate lighting
- Steering wheel: Sport leather steering wheel with multifunction buttons including shift paddles
- Rear center armrest with cup holders and through-loading option
- Multifunction display in the instrument cluster, color
- Fog lights with integrated LED daytime running lights
- Parking steering assistant
- Upholstery: Cloth
- Radio: Amundsen infotainment system (Clever)
- Radio accessories: 8 speakers
- Radio accessories: SmartLink
- Tire pressure monitoring
- Wheels: 19" Procyon Aero alloy wheels in grey-gloss
- Rear seat backrest 60:40 split folding, longitudinally adjustable, backrest angle
- Power steering, electromechanical
- Seats: Heated front and outer rear seats
- Seats: Height-adjustable front seats
- Skoda Infotainment Online
- Sun blind for the rear side windows
- Sunset
- Storage compartment on the left wheel house
- deselecting the standard extended warranty
- Airbag, driver and passenger
- Airbag, head airbags
- Allergen filter
- Traction control (ASR)
- Traveller Plus assistance system (DSG)
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Hydraulic brake assist (HBA)
- Grey headliner
- Anodized Cross decorative insert
- Anti-theft alarm system
- tachometer
- Easy Start (start-stop button)
- Electric tailgate operation including comfort opening
- Electronic parking brake including auto-hold function
- ESC Electronic Stabilization Control
- Electric windows front and rear
- Front radar assistant including city emergency braking function with person detection
- Transmission: 7-speed dual-clutch transmission (DSG)
- Illuminated glove compartment
- Kessy - keyless entry and start-stop system
- Climatronic air conditioning (2 zones)
- Headrests height adjustable front and rear
- LED matrix headlights and dynamic high beam assistant (Light Assist)
- Steering wheel: Leather steering wheel with multifunction buttons including shift paddles
- Reading lights on the front roof lining
- Front center armrest, including storage compartment
- Engine drag torque control (MSR)
- Multi-collision brake
- Package: Family
- Parking sensors front & rear
- wheel arch cover
- Radio: Amundsen infotainment system (tour)
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Wireless SmartLink
- Wheels: 19" Aronia AERO Platinum alloy wheels
- Wheels: RunFlat tires with Seal technology
- Heated windscreen washer nozzles, front
- Headlights washer / wiper system
- Seat belts Kodiaq
- Seats: Adjustable lumbar supports in the front seats
- Skoda Care Connect



- Telephone: Comfort hands-free telephone system including phone box
- Lashing eyes in the trunk
- Central locking with radio remote control

- Sun visor on driver and passenger side with vanity mirror (illuminated)
- Tablet holder in the rear
- Front door sills
- Variable fastening concept in the trunk
- Immobiliser

#### Extra equipment

- 17" light alloy winter wheels Premium price incl. E
- Paint finish: metallic / pearl effect
- Luggage net partition
- Electric panoramic sliding roof including sun blind (no glasses compartment on the roof lining)

#### Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

#### Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Boot lid - dent(s) - Smart repair
2	Door - front left side	Door - dent(s) - Smart repair
3	Side panel - rear right side	Side panel - Scratch(es) - Paint

#### Wear and tear

No.	Component group	Description
1	Door - front right side	Door - Scratch(es) - No deduction
2	Front bumper	Front bumper - Scratch(es) - No deduction

The vehicle shows signs of wear commensurate with its age and use.

#### Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer	
2	Rear, Side right, Provided by user / customer	



## Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features  
*(Delivery by third-party service providers)*
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.  
*(Functional tests of driver assistance systems are not included in the scope of services!)*
- a photo documentation of the vehicle

## Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

## Comments

Das Fahrzeug befand sich zum Besichtigungszeitpunkt in beschädigten, nicht demontierten Zustand. Schadenausweitung möglich, Zusatzkosten können entstehen.





Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

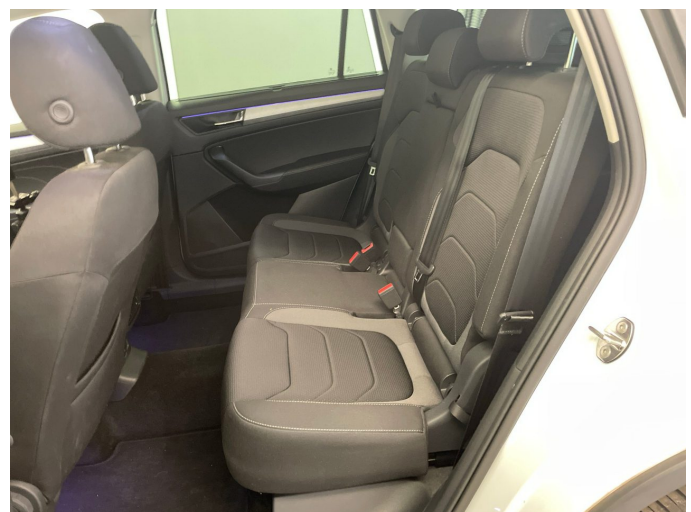


Figure 6: Interior - rear





Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.





Figure 19: Misc.

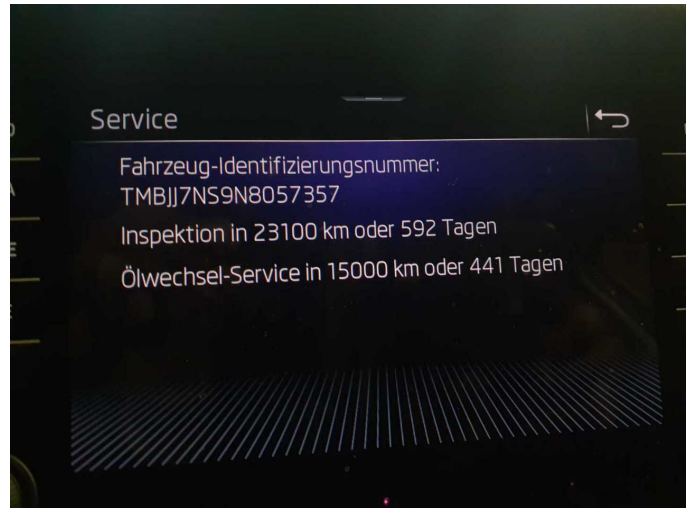


Figure 20: Misc.



Figure 21: Misc.

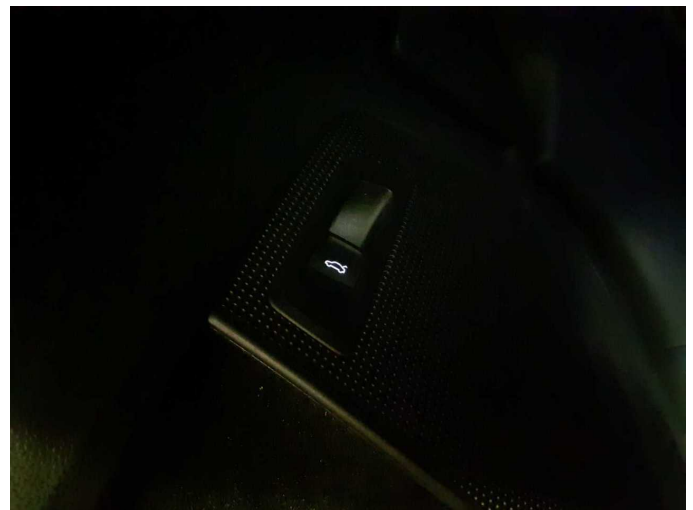


Figure 22: Misc.

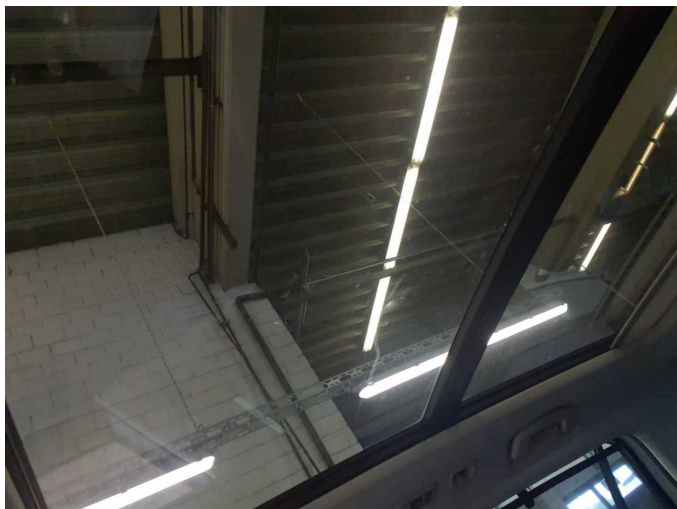


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

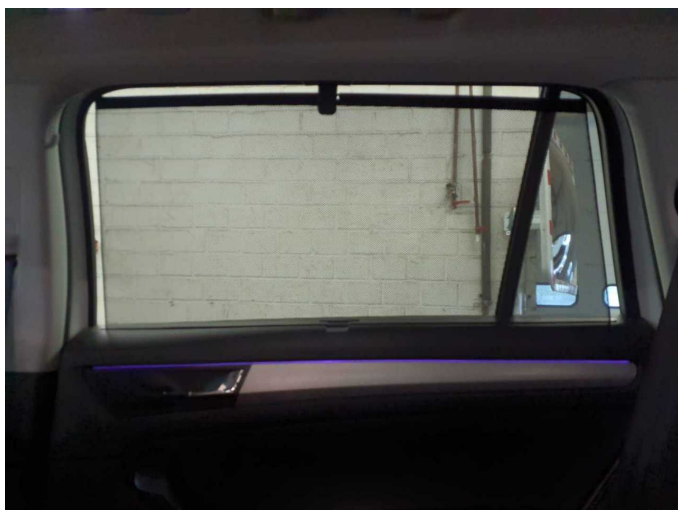


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.





Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Damage 1: Boot lid / rear door: Boot lid - dent(s) - Smart repair





**Damage 1:** Boot lid / rear door: Boot lid - dent(s) - Smart repair



**Damage 1:** Boot lid / rear door: Boot lid - dent(s) - Smart repair



**Damage 2:** Door - front left side: Door - dent(s) - Smart repair



**Damage 2:** Door - front left side: Door - dent(s) - Smart repair



**Damage 3:** Side panel - rear right side: Side panel - Scratch(es) - Paint



**Damage 3:** Side panel - rear right side: Side panel - Scratch(es) - Paint



**Damage 3:** Side panel - rear right side: Side panel - Scratch(es) - Paint



**Damage 3:** Side panel - rear right side: Side panel - Scratch(es) - Paint



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJJ7NS9N8057357  
Hersteller / Modell: SKODA SKODA Kodiaq 2.0 TDI DSG Clever

Datum	KM-Stand	Beschreibung
13.08.2025	96.123	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne
16.04.2025	89.179	Kraftstofffilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
28.02.2025	85.435	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
07.03.2024	57.504	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.04.2023	30.366	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges