



Expertise

Protocol number: 41238227  
Order No. / Reference: 25087567  
Inspection date: 25 Aug 2025

Manufacturer: Skoda  
VIN: TMBJJ7NX8NY117334

Model: Octavia Combi 2.0 TDI DSG Ambition



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Octavia Combi 2.0 TDI DSG Ambition	
Vehicle Identification number	TMBJJ7NX8NY117334
Mileage (Read)	90,205 km
First registration	7 Jul 2022
Number of holders	2
Next periodical technical inspection	08/2027
(Report on hand)	
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic transmission / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Reflexsilber metallic (A7W)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	500 km
Last maintenance on / at	08/2024 at 77,449 km		
Key is / should be	1 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	GJ937384
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AWL 00128		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	1,980 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92V	Summer tyres on Light alloy	Kumho	4mm / 4mm
2)	205/60 R16 92V	Summer tyres on Light alloy	Kumho	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2026		

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

## Equipment

### Standard equipment

- Storage compartment in the luggage compartment with cargo element
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Anti-lock braking system (ABS)
- Exterior mirrors electrically adjustable and heated
- Heated windscreen washer nozzles including 5l washer fluid reservoir
- Glasses compartment on the roof lining
- Roof rails AERO in black
- diesel particulate filter
- Third brake light
- Electronic transverse differential lock (XDS+)
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Cruise control system
- Tinted windows
- Heated rear window
- Rear window wiper including windscreen washer system
- ISOFIX preparations on the front passenger seat and the outer rear seats including top tether anchorage
- Removable trunk cover
- LED fog lights
- LED license plate lighting
- Steering wheel: height and length adjustable
- Manual headlight range adjustment
- Rear center armrest with through-loading option
- Engine drag torque control (MSR)
- Fatigue detection
- Upholstery: Cloth
- Radio accessories: 2 USB-C ports at the front
- Radio accessories: 8 speakers
- Radio accessories: Digital radio reception DAB+
- Radio accessories: voice control
- Tire pressure monitoring
- Wheels: 16" Twister AERO alloy wheels
- Seat belts
- Seats: Rear seat backrest 60:40 split folding
- Speed limiter
- 12-V socket in the trunk
- Lashing eyes in the trunk
- Central locking including radio remote control integrated in the key and EASY Start
- Shelves
- Airbag, driver and passenger
- Airbag, head airbags
- Airbag: Center airbag front
- Traction control (ASR)
- Exterior mirrors, electrically folding
- Hill start assist
- Hydraulic brake assist (HBA)
- Grey headliner
- Decorative strip in Goldress matt
- tachometer
- Electronic parking brake including auto-hold function
- Electronic Stabilization Control (ESC)
- Front radar assistant including city emergency braking function and person and cyclist detection
- Transmission: 7-speed direct shift gearbox (DSG)
- Green tec: Automatic start/stop system including brake energy recovery
- Interior mirror automatically dimming
- Child safety locks for the rear doors and windows
- Climatronic air conditioning (2 zones)
- Headrests (5) front and rear height adjustable
- LED rear lights
- LED headlights with LED daytime running lights
- Steering wheel: Leather steering wheel with multifunction buttons with shift paddles
- Front center armrest, including storage compartment
- Multifunction display in the instrument cluster
- Rear parking sensors
- Radio: Bolero music system with capacitive 10" color display
- Radio accessories: Bluetooth hands-free system
- Radio accessories: SmartLink
- Rain sensor and headlight assistant
- Tire mobility set
- Power steering, electromechanical
- Seats: Height-adjustable driver and passenger seats
- SKODA Care Connect
- Lane keeping assistant (Lane Assist)
- Phone: Wireless SmartLink for Apple CarPlay
- Immobiliser

### Extra equipment



- Luggage net partition
- Paint finish: metallic
- Steering wheel: Heated steering wheel including heated front seats
- Package: Business Columbus Infotainment Package (DSG) (Columbus navigation system - Free Bluetooth - Infotainment Online (3-year term), online map updates: for navigation, traffic situation, gas stations, and parking search - Digital Cockpit Plus - 3 USB charging ports - Driving profile selection - Adaptive Cruise Control (ACC) - Phone box with inductive charging - Travel Assist Assistance System: - Traffic sign recognition - Adaptive lane keeping assistant - Emergency and traffic jam assistant - Capacitive steering wheel with hands-off detection)

## Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

## Value reducing factors

No.	Component group	Description
1	Interior	Umbrella (VR) - Missing - Replace
2	Trim / covers	Brightware / decorative strip (Tür VR) - Scratch(es) - Replace
3	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value
4	Side panel - rear left side	Elbow - Scratch(es) - Smart repair
5	Front bumper	Front bumper - Deformed - Repair and paint
6	Side panel - rear right side	Side panel - Dent / paintcoat damage - Repair and paint

## Wear and tear

No.	Component group	Description
1	Body	Body (Waschstraßenkratzer) - Scratch(es) - No deduction
2	Rear bumper	Rear bumper - Scratch(es) - No deduction
3	Wing mirror - right side	Cap - Scratch(es) - No deduction
4	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear commensurate with its age and use.

## Missing parts

### Description

Equipment - Vehicle key



## Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features  
*(Delivery by third-party service providers)*
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.  
*(Functional tests of driver assistance systems are not included in the scope of services!)*
- a photo documentation of the vehicle

## Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

Apparently, no repaired previous damage could be found on the vehicle.

## Comments

Das Fahrzeug befand sich zum Besichtigungszeitpunkt in beschädigten, nicht demontierten Zustand. Schadenausweitung möglich, Zusatzkosten können entstehen.





Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear





Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



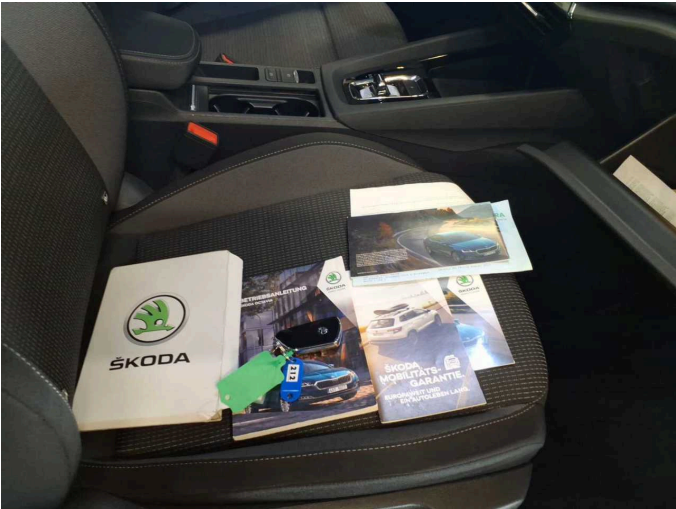


Figure 13: Documents



Figure 14: Documents



Figure 15: Navigation



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.





Figure 19: Misc.

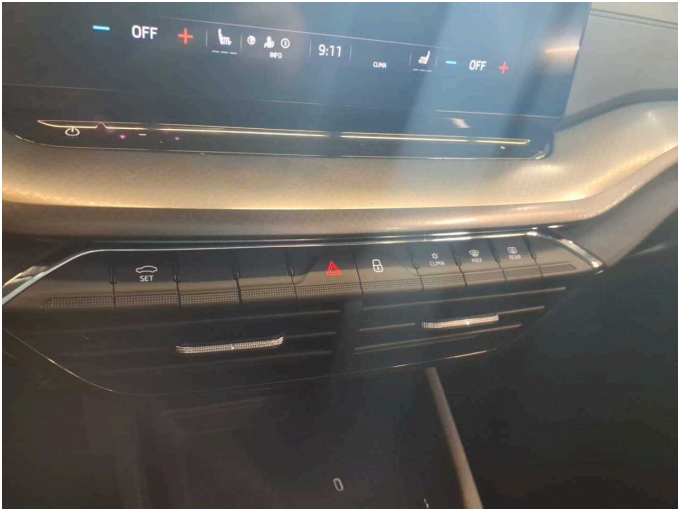


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.





Figure 25: Misc.




Figure 26: Misc.



Damage 1: Interior: Umbrella (VR) - Missing - Replace



Damage 2: Trim / covers: Brightware / decorative strip (Tür VR) - Scratch(es) - Replace

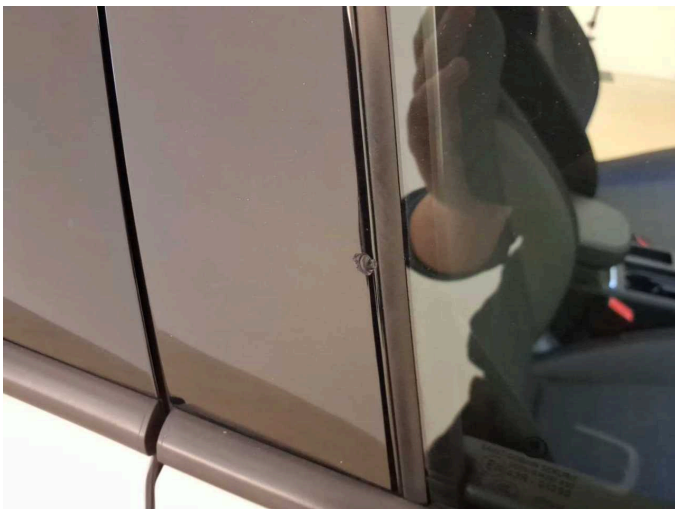

Damage 2: Trim / covers: Brightware / decorative strip (Tür VR) - Scratch(es) - Replace



Damage 3: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value





**Damage 3:** Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



**Damage 3:** Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



**Damage 4:** Side panel - rear left side: Elbow - Scratch(es) - Smart repair



**Damage 4:** Side panel - rear left side: Elbow - Scratch(es) - Smart repair



**Damage 5:** Front bumper: Front bumper - Deformed - Repair and paint



**Damage 5:** Front bumper: Front bumper - Deformed - Repair and paint





**Damage 5:** Front bumper: Front bumper - Deformed - Repair and paint




**Damage 6:** Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint




**Damage 6:** Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



**Damage 6:** Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

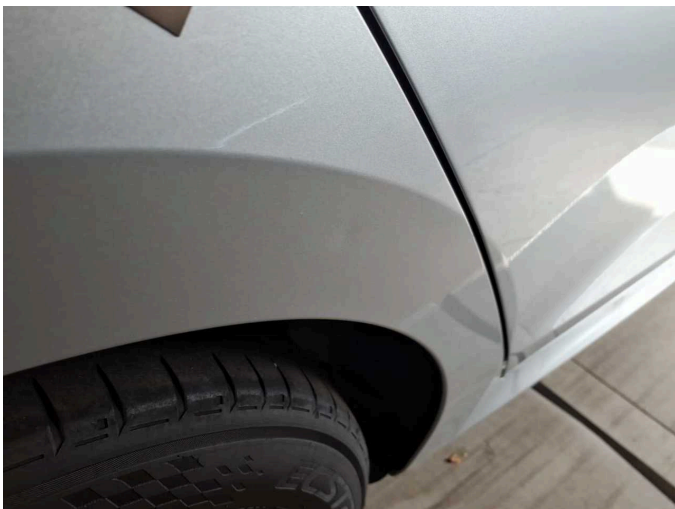

**Damage 6:** Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

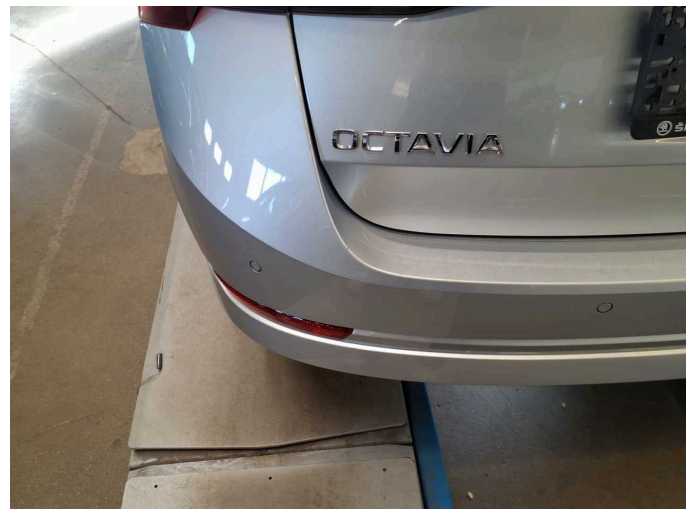


**Wear and tear 2:** Rear bumper: Rear bumper - Scratch(es) - No deduction






**Wear and tear 2:** Rear bumper: Rear bumper - Scratch(es) - No deduction

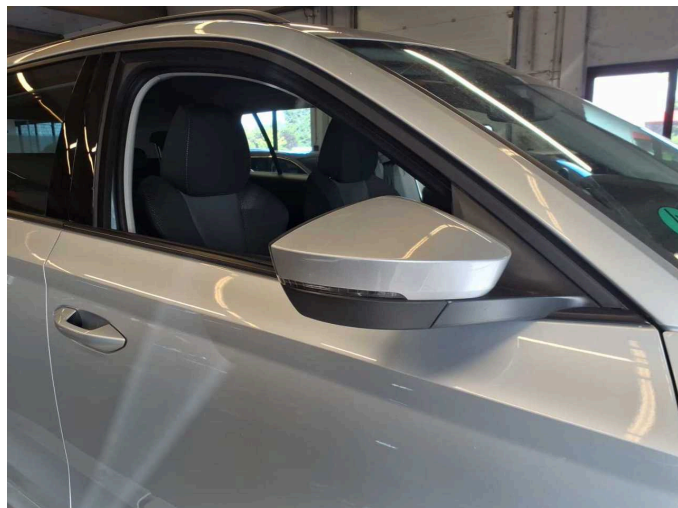


**Wear and tear 3:** Wing mirror - right side: Cap - Scratch(es) - No deduction




**Wear and tear 3:** Wing mirror - right side: Cap - Scratch(es) - No deduction

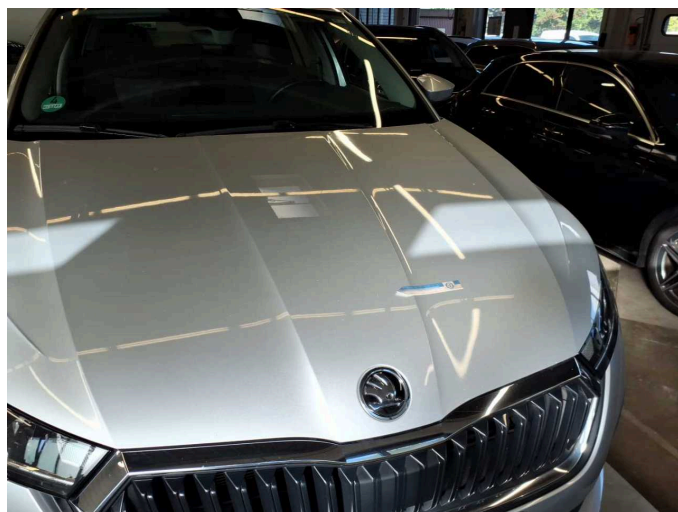

**Wear and tear 4:** Bonnet: Bonnet - Stone chips - No deduction

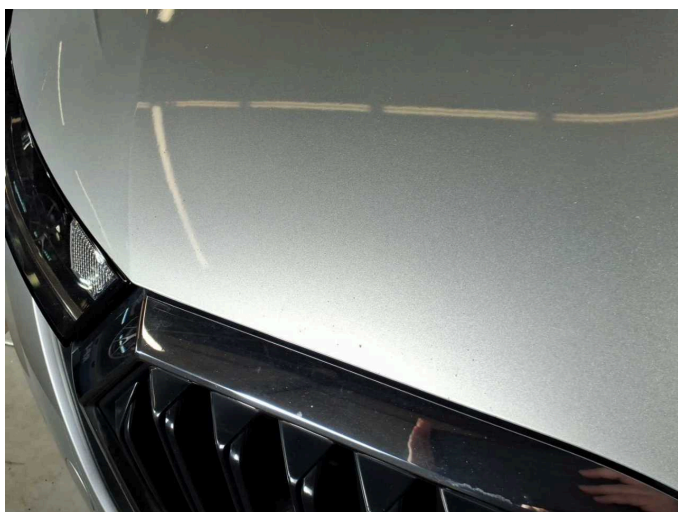

**Wear and tear 4:** Bonnet: Bonnet - Stone chips - No deduction

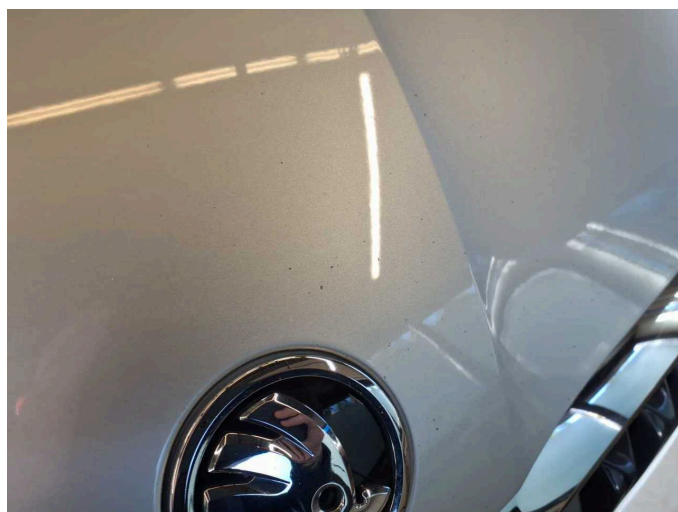

**Wear and tear 4:** Bonnet: Bonnet - Stone chips - No deduction



**Wear and tear 4:** Bonnet: Bonnet - Stone chips - No deduction



**Missing part 1:** Equipment: Vehicle key - Missing - Replace





# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJJ7NX8NY117334

Hersteller / Modell: SKODA SKODA Octavia Combi 2.0 TDI DSG Ambition

Datum	KM-Stand	Beschreibung
13.08.2024	77.449	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
12.12.2023	60.630	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
20.10.2023	50.818	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
01.03.2023	31.184	Regelwartungsdienst; Wartung Sonstiges
15.12.2022	24.748	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges