



Skoda Karoq: L602FB

Vinnnummer:	TMBJP7NU5M5042502	Versionname:	Karoq 1.0 TSI Greentech 81kW Business Edition Plus
First Registrationdate:	6/05/2021	Fiscalpower:	
Expertise Mileage:	110676	Power Kw:	81
Bodytype:		Body colour	Emerald Green metallic
Gearbox:	MAN 6 VIT	Paint type	Metalic
Transmission:	Front	Type of rims (mounted)	Aluminium
Fueltype:	Petrol	Parking lot	1054
Number of seats	5		
Type of rims (mounted)	Aluminium		
Maintenance needed	No		

Options

Number of keys total	2	Telephone equipment
GPS		Central consol F
Autom climate control		Luggage cover
Windows electric F		Headlights Xenon/LED/Laser
Radio multimedia		Front parking sensors
		Rear parking sensors

Degree of wear

	215/55/17/98 V			
Winter tyres:	Fr.L.	Vredestein: 5,1 mm	Fr.R.	Vredestein: 5,8 mm
	Re.L.	Vredestein: 4,5 mm	Re.R.	Vredestein: 4,7 mm
Tyre profile depth FL				5.1
Tyre profile depth FR				5.8
Tyre profile depth RL				4.5
Tyre profile depth RR				4.7
Tyre size FL				215/55 R 17 98 V
Tyre size FR				215/55 R 17 98 V
Tyre size RL				215/55 R 17 98 V
Tyre size RR				215/55 R 17 98 V
Tyre type FL				Winter
Tyre type FR				Winter
Tyre type RL				Winter
Tyre type RR				Winter
Tyre make FL				2480
Tyre make FR				2480
Tyre make RL				2480
Tyre make RR				2480

Assistance equipment

Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Interior, Stain, Cleaning



Door RL, Scratch(es), Repair and paint (complete)




Door FL, Chemical polution, Polish



Outside rear-view mirror housing L, Scratch(es), Replace and paint




Wing RL, Scratch(es), Polish

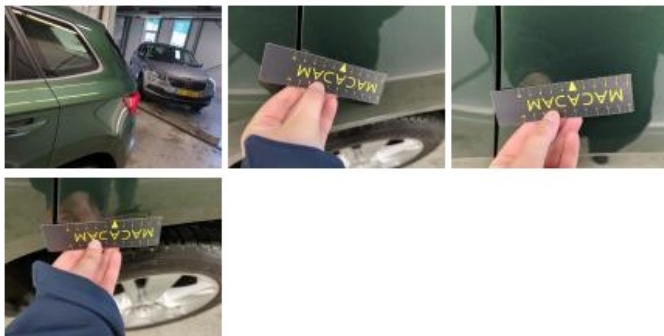


Bonnet, Bad repair, Repair and paint (complete)



Door RR, Scratch(es), Repair and paint (complete)

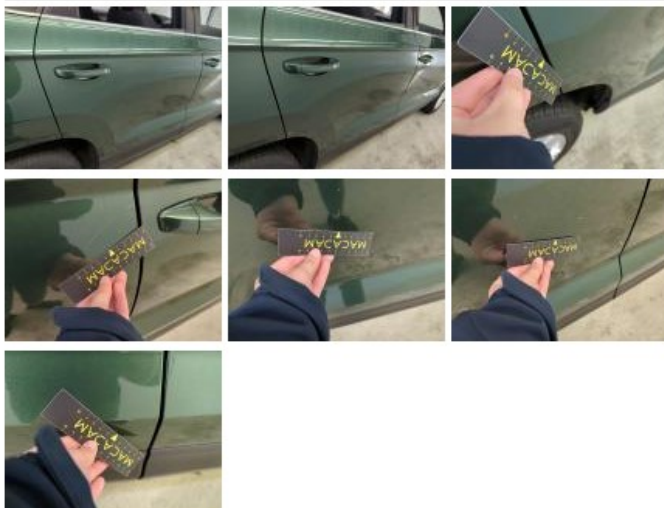

Door FR, Scratch(es), Repair and paint (complete)

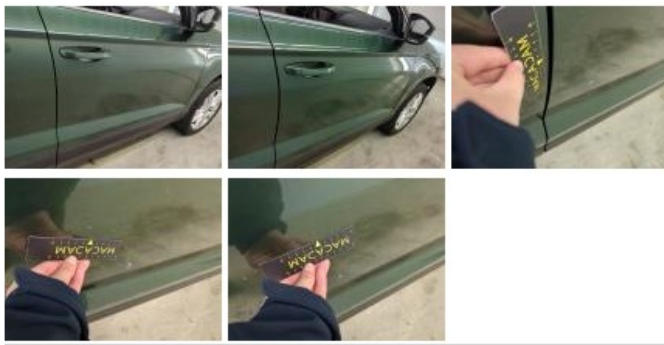

Outside rear-view mirror housing R, Scratch(es), Polish



Bumper RM, Scratch(es), Smart repair



Rear window, Scratch(es), Replace



Roof, Bad repair, Repair and paint (complete)

