



Expertise

Protocol number: 41499933
Order No. / Reference: 25196032
Inspection date: 12 Sept 2025

Manufacturer: Skoda
VIN: TMBJW9NPXM7031637

Model: Superb Combi 1.4 TSI iV DSG Ambition



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Superb Combi 1.4 TSI iV DSG Ambition	
Vehicle Identification number	TMBJW9NPXM7031637
Mileage (Read)	255,954 km
First registration	3 Dec 2020
Number of holders	1
Next periodical technical inspection	01/2026
(Report on hand)	
Power / Engine displacement	115 kw / 1,395 ccm
Fuel type / Cylinder	Hybr.B/E ext. edition / 4
Gearbox / Number of gears	Automatic / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Magnetic-Braun Metallic (F8V)
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	2,200 km
Last maintenance on / at	03/2025 at 228,132 km		
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	FX231275
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AUJ 00075		
Emission standard	EURO6;WLTP;AM;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,291 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94W	Summer tyres on Light alloy	Pirelli	4mm / 3mm
2)	215/55 R17 94W	Summer tyres on Light alloy	Pirelli	7mm / 7mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 98H	Winter tyres on Light alloy	Pirelli	0mm / 0mm
2)	215/55 R17 98H	Winter tyres on Light alloy	Pirelli	8mm / 8mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2024		
Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel				

Equipment

Standard equipment

- Storage compartments closed, behind the wheel arches in the trunk including cargo elements
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Traction control (ASR)
- Exterior mirrors and door handles in body color
- Illuminated glove compartment
- Hydraulic brake assist (HBA)
- tachometer
- Easy Start (start-stop button instead of ignition lock)
- Electronic transverse differential lock (XDS+)
- Headlight assistant and rain sensor
- Chassis: Adaptive chassis DCC (including driving profile selection and customizable key, without lowering)
- Front radar assistant including city emergency braking function
- Transmission: 6-speed direct shift gearbox (DSG)
- Heated rear window
- ISOFIX preparation on the outer rear seats, including top tether
- Headrests height adjustable front and rear
- LED low beam
- Steering wheel: height and length adjustable
- Rear center armrest with cup holders and through-loading option
- Color multifunction display in the instrument cluster
- Multi-collision brake
- Gasoline particulate filter
- Radio accessories: 2 USB-C ports in the center console
- Radio accessories: SmartLink+
- Tire pressure monitoring
- Wheels: 17" Stratos alloy wheels (7J x 17" ET 40 with 215/55 R17 tires)
- Seat belts Superb
- Seats: Height-adjustable front seats
- SKODA Care Connect
- Automatic start/stop system including brake energy recovery
- 12-V socket in the center console front and rear
- Chrome-plated elements
- Immobiliser
- Shelves
- Airbag, driver and switchable passenger airbag
- Airbag, head airbags
- Anti-lock braking system (ABS)
- Exterior mirrors electrically adjustable and heated
- Exterior mirrors, electrically folding
- Hill start assist
- Grey headliner
- Third brake light
- Electronic parking brake including auto-hold function
- Electronic Stabilization Control (ESC)
- Driving profile selection including personalizable key (Normal, Eco, Sport, Individual) (incl. additional key)
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Cruise control including speed limiter
- Tinted windows
- Rear window wiper including windscreen washer system
- Air Care Climatronic air conditioning system (2 zones)
- Trunk cover, roll-up and removable, semi-automatic
- Charging cable, Mode 2, Schuko, 10A
- LED rear lights
- Reading lights at the front and rear of the roof lining
- Front center armrest with storage compartment
- Engine drag torque control (MSR)
- Multifunction display in the instrument cluster
- LED fog lights with integrated cornering light
- Upholstery: Cloth
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Wireless SmartLink for Apple Car Play
- Tire mobility set
- Heated windscreen washer nozzles
- Power steering, electromechanical
- Seats: Adjustable lumbar supports in the front seats
- Seats: Rear seat backrest 60:40 split folding
- Sun visor on driver and passenger side with illuminated make-up mirror
- 12-V socket in the trunk
- Telephone: Comfort hands-free Bluetooth
- Lashing eyes in the trunk
- Central locking with radio remote control

Extra equipment

- Adaptive Cruise Control ACC (control range up to 210 km/h) (replaces cruise control)
- Trailer coupling, pivoting including trailer stabilization
- Decorative inlay Dark Brushed
- Airbag, Proactive Occupant Protection including rear side airbags
- Roof rails, anodized
- Digital instrument cluster (Virtual Cockpit) 10.2"
- Paint finish: metallic



- Electric panoramic sliding roof including sun blind (no glasses compartment on the roof lining)
- Steering wheel: Heated steering wheel (2 spokes) (with shift paddles)
- Parking sensors front and rear
- Seats: Heated front seats
- Seats: Folding passenger seat backrest
- Sun blind for the rear side windows
- Lane keeping (Lane Assist), lane change (Blind-Spot Detection), rear parking, emergency and traffic jam assistant (Lane Keeping Assist with adaptive lane guidance)
- Auxiliary heater with radio remote control
- Charging cable for AC charging stations (Mode 3 charging cable, Type 2, 16A)
- Package: Business Columbus (Ambition) (Combi) (dynamic radio navigation system Columbus, capacitive 9.2" touch display, color Maxi-Dot display, traffic sign recognition, Wi-Fi hotspot, phone box with inductive charging function (connected via external antenna), voice control, fatigue detection, 230 V socket, USB ports, tablet holder in the rear, Sunset Infotainment Online for 3 years, luggage net partition, electric tailgate, multifunctional storage)

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Body	Underbody panelling (links) - Broken / torn - Replace
3	Door - rear right side	Door - dent(s) - Smart repair
4	Front bumper	Front bumper - Scratched - Paint
5	Rear bumper	Rear bumper - Scratch(es) - Paint
6	Door - rear left side	Door - Dent / paintcoat damage - Repair and paint
7	Side panel - rear left side	Side panel - Scratch(es) - Paint
8	Boot lid / rear door	Boot lid - Scratch(es) - Paint
9	Side panel - rear right side	Side panel (inkl. Schaden inst.) - Unprofessionally repaired - Repair and paint
10	Roof	Roof - Corrosion - Paint

Wear and tear

No.	Component group	Description
1	Door - front left side	Door - Scratch(es) - No deduction
2	Mudguard - left side	Mudguard - left side - dent(s) - No deduction
3	2nd wheel set	2 tyres - Worn - No deduction
4	2nd wheel set	1 alloy rim - Scratched - No deduction

The vehicle shows signs of wear commensurate with its age and use.



Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Side - left, Side right, Provided by user / customer, from 18 Mar 2022	7.389,55 €

Repainting

No.	Repainting
1	Boot lid / rear door, Side panel - rear left side, Door - rear right side, Professionally carried out
2	Side panel - rear right side, Unprofessionally carried out

Paint coat thickness measurement

Boot lid / rear door	326 µm	Side panel - rear left side	581 µm
Side panel - rear right side	1,950 µm	Door - rear right side	205 µm

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

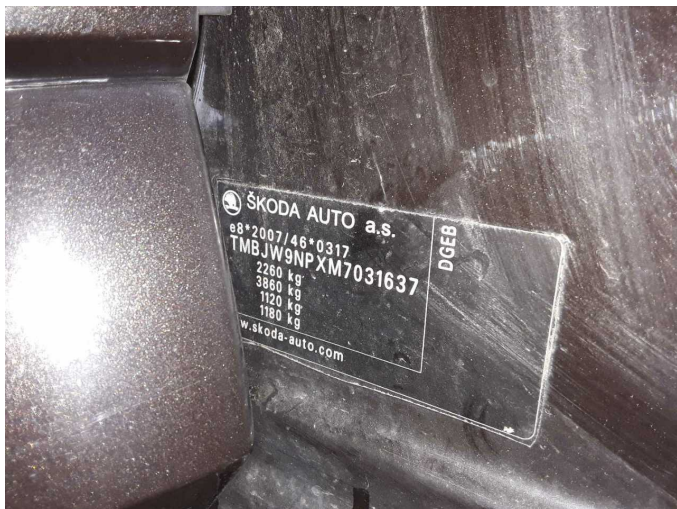


Figure 11: VIN



Figure 12: Mounted tyres

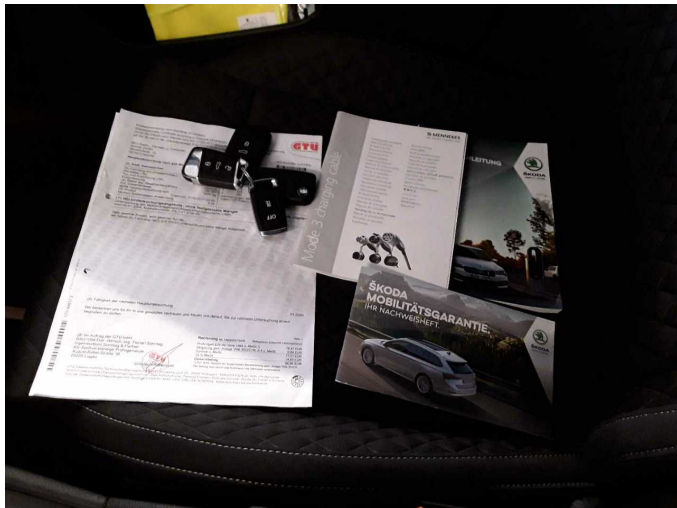


Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

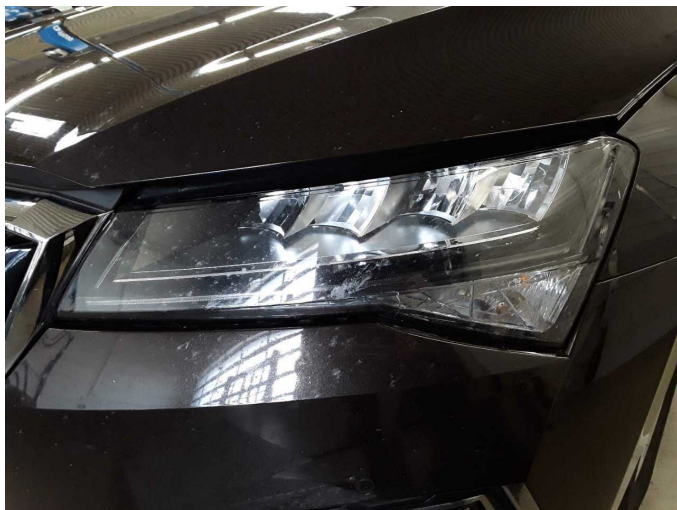


Figure 21: Misc.

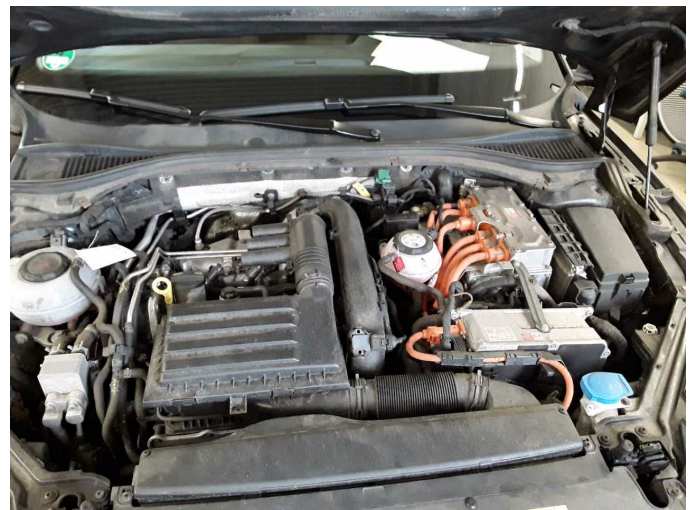


Figure 22: Misc.

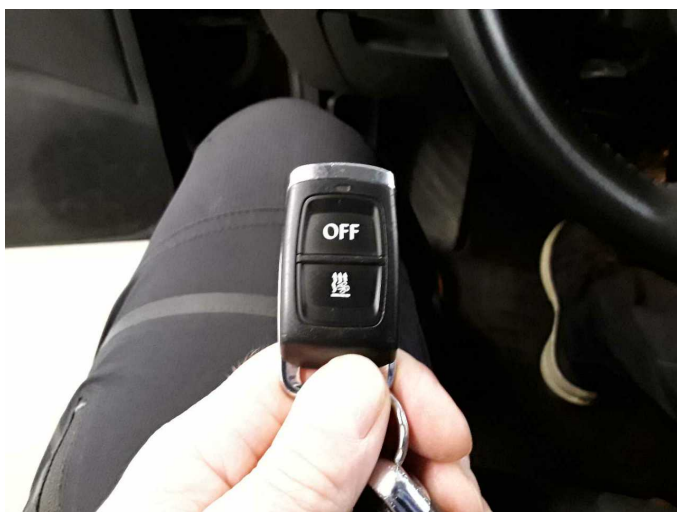


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

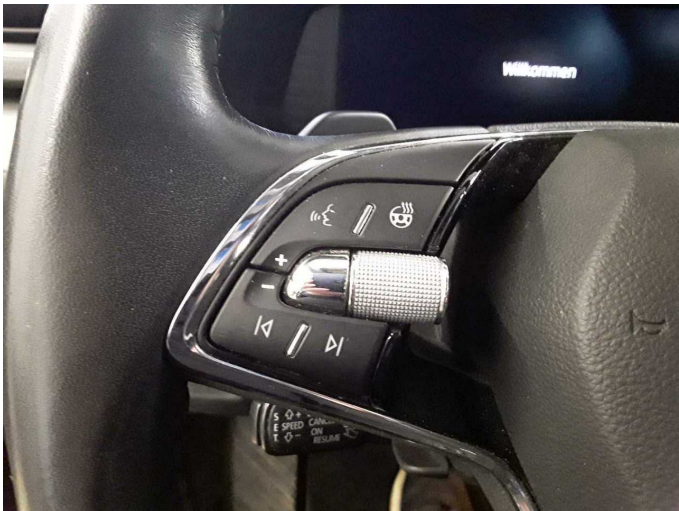


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.




Figure 31: Misc.



Figure 32: Misc.




Figure 33: Misc.

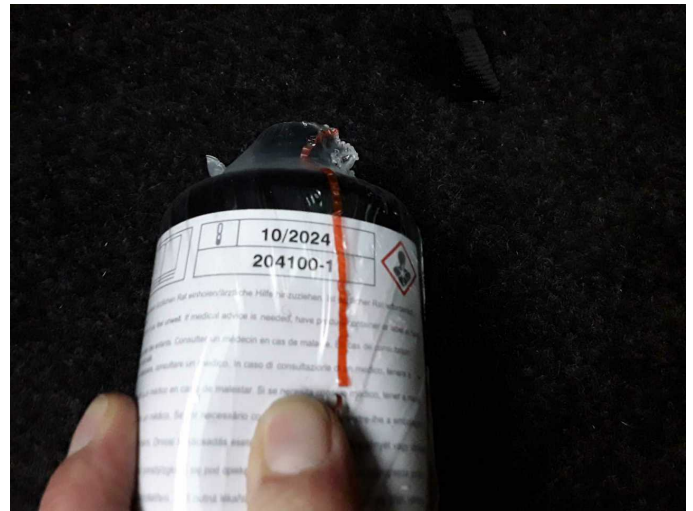


Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Body: Underbody panelling (links) - Broken / torn - Replace

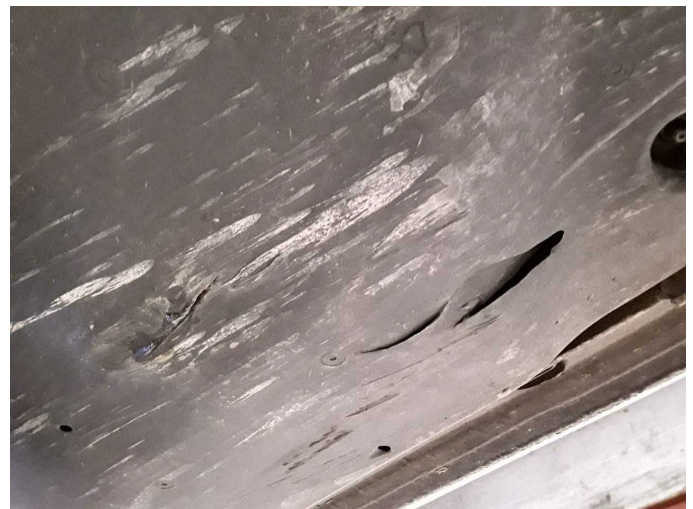


Damage 2: Body: Underbody panelling (links) - Broken / torn - Replace

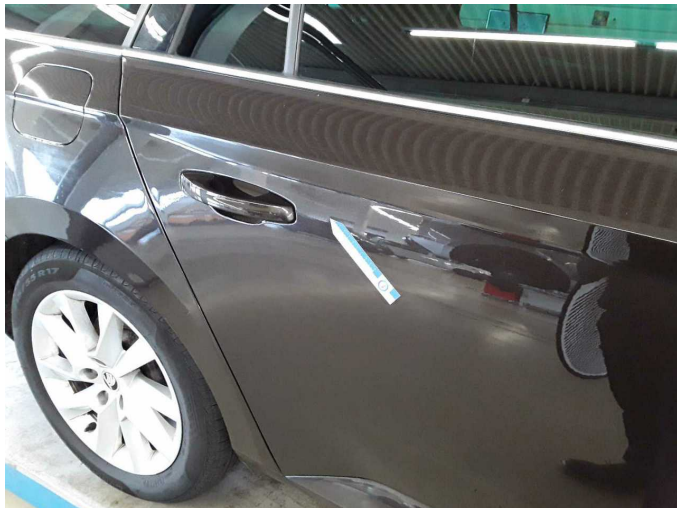

Damage 3: Door - rear right side: Door - dent(s) - Smart repair



Damage 3: Door - rear right side: Door - dent(s) - Smart repair

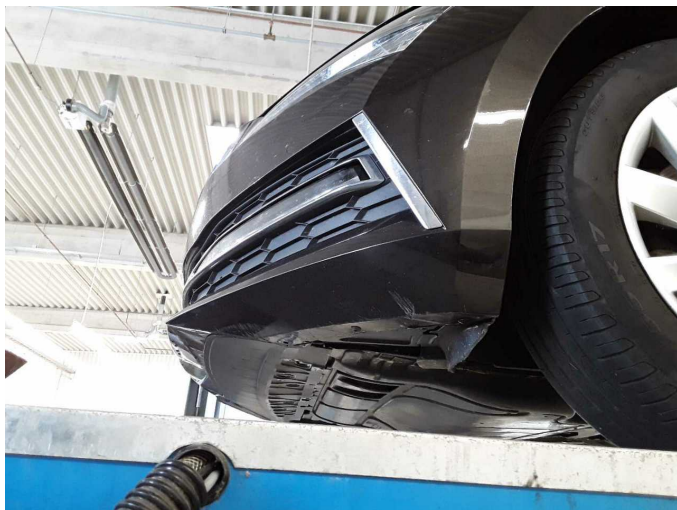


Damage 4: Front bumper: Front bumper - Scratched - Paint



Damage 4: Front bumper: Front bumper - Scratched - Paint



Damage 4: Front bumper: Front bumper - Scratched - Paint

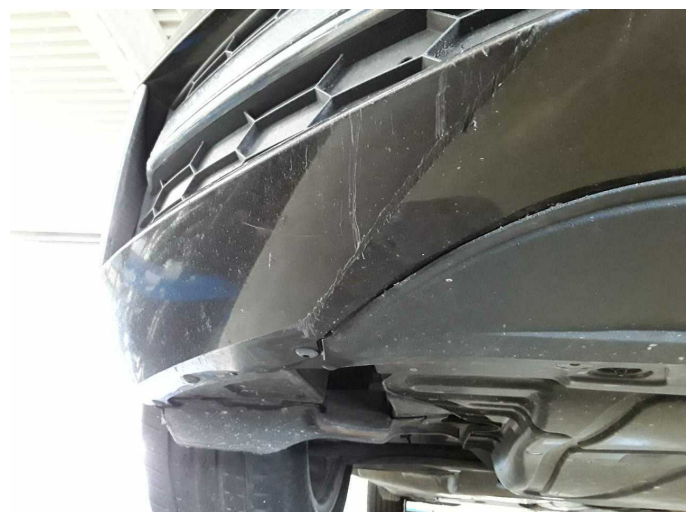

Damage 4: Front bumper: Front bumper - Scratched - Paint



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint

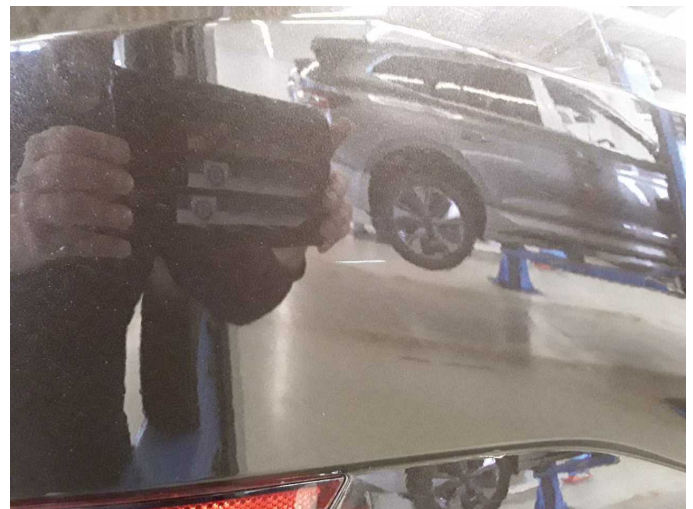

Damage 5: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 6: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint




Damage 6: Door - rear left side: Door - Dent / paintcoat damage - Repair and paint



Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Paint

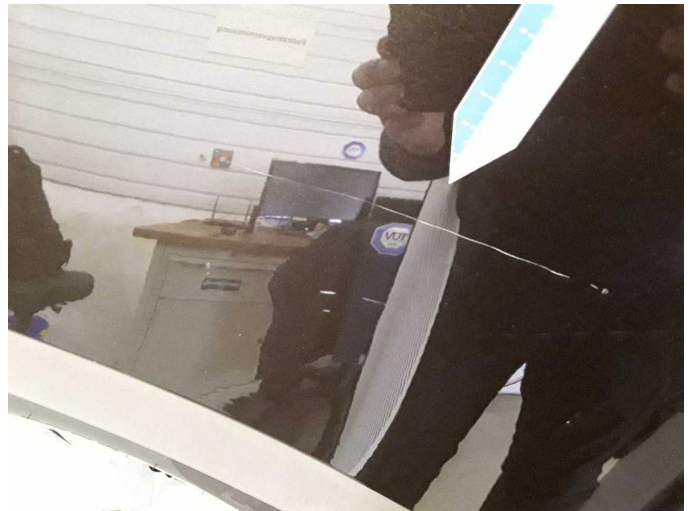

Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Paint

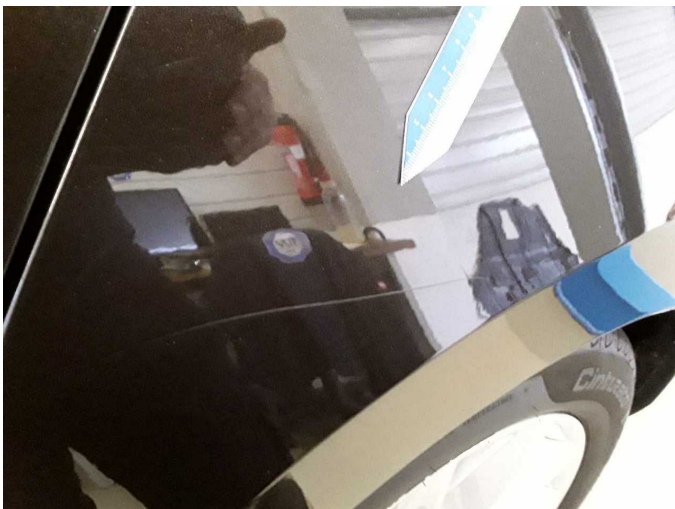

Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Paint




Damage 7: Side panel - rear left side: Side panel - Scratch(es) - Paint




Damage 8: Boot lid / rear door: Boot lid - Scratch(es) - Paint



Damage 8: Boot lid / rear door: Boot lid - Scratch(es) - Paint

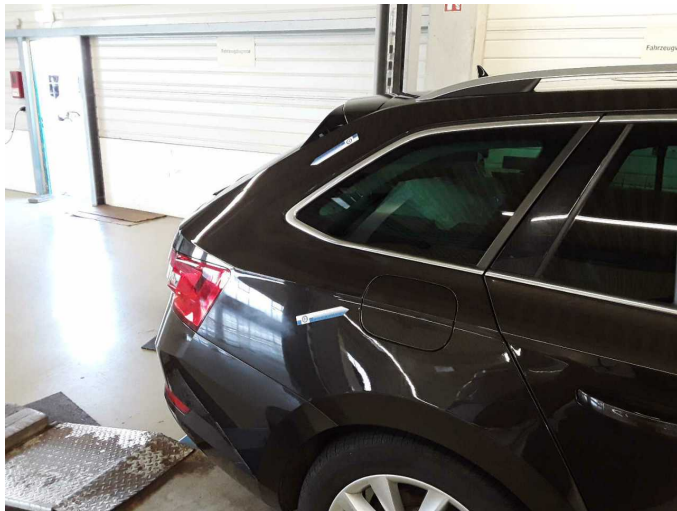


Damage 9: Side panel - rear right side: Side panel (inkl. Schaden inst.) - Unprofessionally repaired - Repair and paint

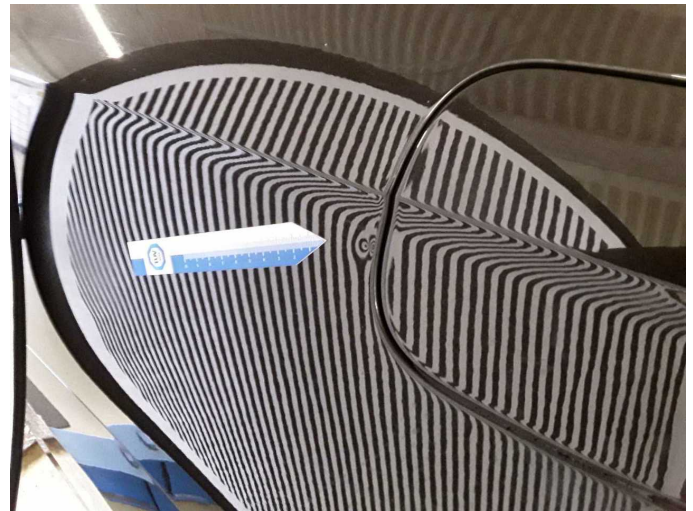


Damage 9: Side panel - rear right side: Side panel (inkl. Schaden inst.) - Unprofessionally repaired - Repair and paint



Damage 9: Side panel - rear right side: Side panel (inkl. Schaden inst.) - Unprofessionally repaired - Repair and paint

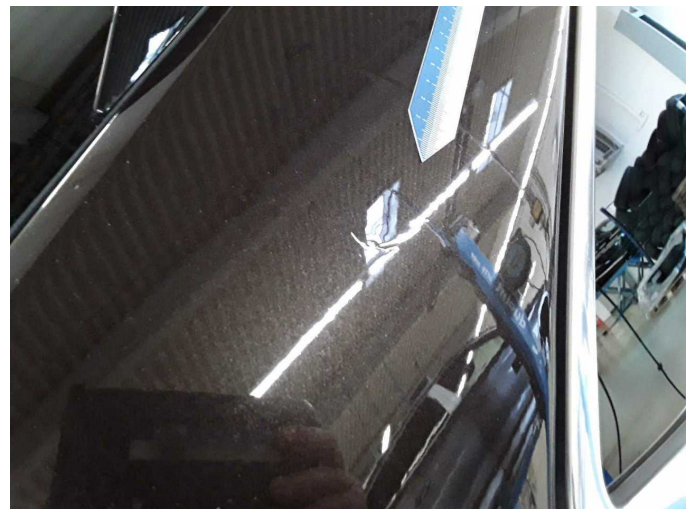

Damage 9: Side panel - rear right side: Side panel (inkl. Schaden inst.) - Unprofessionally repaired - Repair and paint

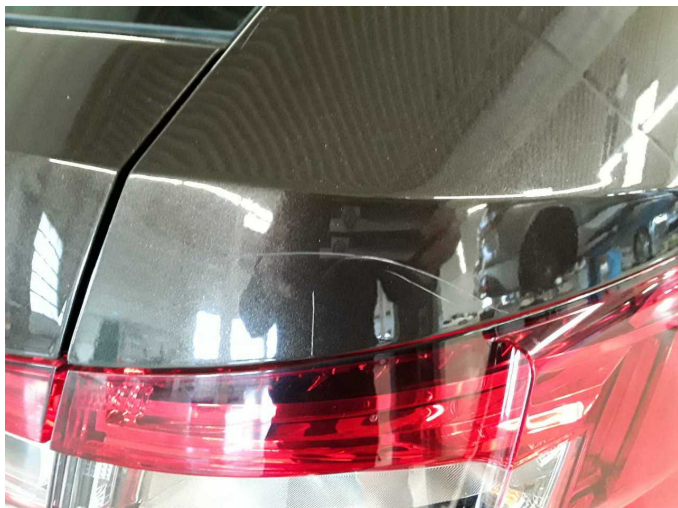

Damage 9: Side panel - rear right side: Side panel (inkl. Schaden inst.) - Unprofessionally repaired - Repair and paint




Damage 10: Roof: Roof - Corrosion - Paint




Damage 10: Roof: Roof - Corrosion - Paint



Boot lid / rear door: 326 µm

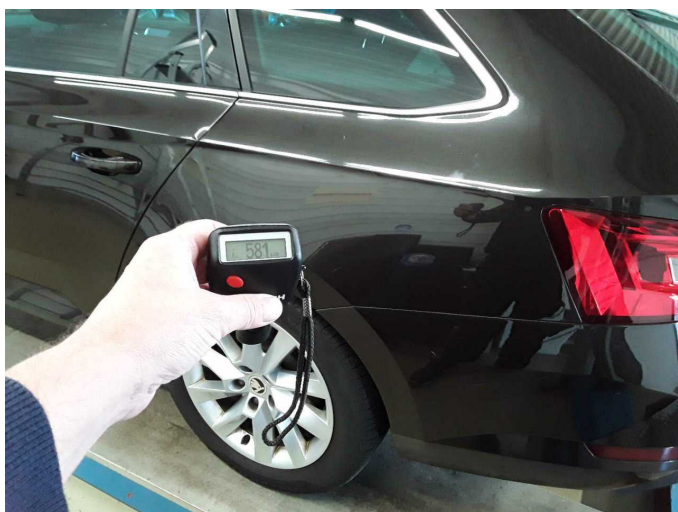

Side panel - rear left side: 581 µm

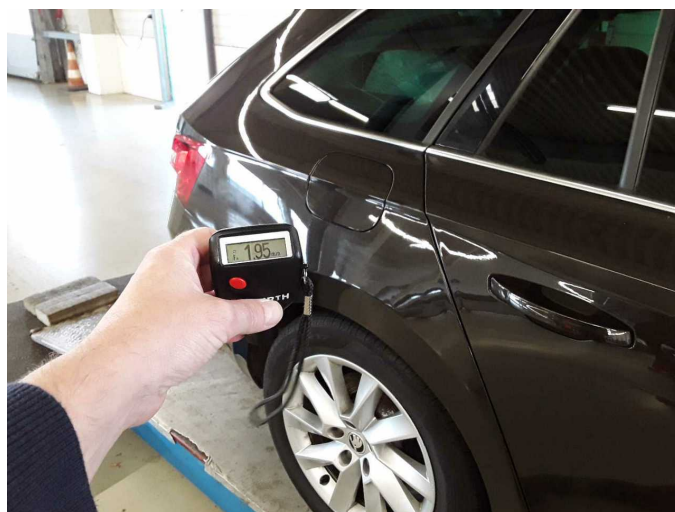

Side panel - rear right side: 1,950 µm



Door - rear right side: 205 μ m



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJW9NPXM7031637
Hersteller / Modell: SKODA SKODA Superb Combi 1.4 TSI iV DSG Ambition

Datum	KM-Stand	Beschreibung
26.06.2025	24.417	Regelwartungsdienst; Wartung Sonstiges
31.03.2025	228.132	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
28.01.2025	217.288	Regelwartungsdienst; Wartung Sonstiges
18.12.2024	210.190	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges; Zündkerzen ern
21.08.2024	191.520	Bremse Sonstiges; Bremsscheiben + Klötze v; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
19.06.2024	181.231	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Reparatur Sonstiges; Systemtest/Eigendiagnose; Wartung Sonstiges
05.03.2024	161.048	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
03.01.2024	149.397	AU
15.11.2023	140.731	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
13.09.2023	128.698	Regelwartungsdienst; Reparatur Sonstiges
14.07.2023	119.239	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
24.02.2023	99.351	Bremse Sonstiges; Bremsscheiben vorne; Luftfiltereinsatz ern; Regelwartungsdienst; Wartung Sonstiges
06.12.2022	88.515	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges; Zündkerzen ern
21.07.2022	66.790	Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
20.04.2022	50.613	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
10.11.2021	35.690	Kleine Inspektion; Motoröl b. Wartung
08.07.2021	18.973	Motoröl b. Wartung; Ölwechsel