



Expertise

Protocol number: 41513621
Order No. / Reference: 25183472
Inspection date: 12 Sept 2025

Manufacturer: Skoda	Model: Kodiaq 2.0 TDI 4x4 DSG Drive 125
VIN: TMBLK7NS0L8039929	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Kodiaq 2.0 TDI 4x4 DSG Drive 125	
Vehicle Identification number	TMBLK7NS0L8039929
Mileage (Read)	176,500 km
First registration	25 Jun 2020
Number of holders	1
Power / Engine displacement	140 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Black Magic Perleffekt
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	27,600 km
Last maintenance on / at	07/2025 at 173,000 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	FR652323
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / ARX 00069		
Emission standard	EURO6;WLTP;DG;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,400 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 99V	Summer tires (with run-flat tires) on Light alloy	Pirelli	6mm / 6mm
2)	235/50 R19 99V	Summer tires (with run-flat tires) on Light alloy	Pirelli	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tires (with run-flat tires) on Light alloy	Pirelli	6mm / 6mm
2)	215/65 R17 99H	Winter tires (with run-flat tires) on Light alloy	Pirelli	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	145/85 R18 103M	Summer tyres on Steel	Sonstige	4 mm

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

Equipment

Standard equipment

- Storage compartment on the left wheel house
- Shelves
- Adaptive Distance Assist ACC (up to 210 km/h) with lane keeping, lane change and rear traffic jam assist
- Airbag, driver's knee airbag
- Airbag, front side airbags
- All-wheel drive permanent
- Traction control (ASR)
- Electrically folding exterior mirrors including interior and exterior mirrors with automatic dimming
- Hill start assist
- Care Connect: Proactive Services (14-year term)
- Roof rails, black
- Anti-theft alarm system with SAFE system
- tachometer
- Electric tailgate operation including comfort opening
- Electronic transverse differential lock (XDS+)
- ESC Electronic Stabilization Control
- Electric windows front and rear
- Floor mats front and rear
- Transmission: 7-speed dual-clutch transmission (DSG)
- Green tec (automatic start/stop including brake energy recovery)
- Rear window wiper Aero including windscreen washer system
- Climatronic air conditioning (2 zones)
- Headrests height adjustable front and rear
- LED headlights with LED daytime running lights
- Steering wheel with multifunction buttons
- Steering wheel: 3-spoke leather steering wheel
- Front center armrest, including storage compartment
- MSR (engine drag torque control)
- Fog lights with integrated LED daytime running lights
- Net program in the trunk
- Upholstery: Cloth
- Radio accessories: Digital radio reception DAB+
- Tire mobility set
- Wheels: 19" Aero anthracite-polished alloy wheels
- Heated windscreen washer nozzles
- Headlights washer / wiper system
- Seat belts Kodiah
- Seats: Driver and passenger seats height adjustable
- Skoda Infotainment Online
- 12V socket - in the center console and in the trunk
- Sunset
- Front door sills
- Variable fastening concept in the trunk (only for 5-seater)
- Immobiliser
- Storage compartments behind the wheel arch in the trunk
- Removable waste bin for the door panel
- Aero wipers front
- Airbag, driver and passenger
- Airbag, head airbags
- Allergen filter
- Anti-lock braking system (ABS)
- Dashboard in black / black, door trim in black
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Brake assist, hydraulic
- Cargo elements in the trunk
- Decorative inlay Mythos Glossy Black
- diesel particulate filter
- Third brake light
- Electronic parking brake including auto-hold function
- Emergency Call
- Headlight assistant and rain sensor
- Front radar assistant including city emergency braking function with person detection
- Tinted windows
- Illuminated glove compartment
- Heated rear window
- ISOFIX preparation on the outer rear seats
- Kessy - keyless entry and start-stop system
- Trunk cover, rollable and removable
- LED ambient lighting
- LED taillights in crystal glass look & LED license plate lighting
- Rear center armrest with cup holders and through-loading option
- Multifunction display with Maxi-Dot display, color (on-board computer)
- Package: Family
- Radio: Columbus infotainment system (RS)
- Radio accessories: USB port in the center console
- Tire pressure monitoring
- Rear seat backrest 60:40 split folding, longitudinally adjustable, backrest angle
- Power steering, electromechanical
- Seats: Heated front and outer rear seats
- Skoda Care Connect
- Sun blind for the rear side windows
- Bumpers painted in body color
- Telephone: Comfort hands-free telephone system including phone box
- Lashing eyes in the trunk
- Central locking with radio remote control



Extra equipment

- Swivel trailer coupling (with electric release, including trailer stabilization)
- High beam assistant
- Finish: pearl effect
- Heated steering wheel
- Personalized key
- Radio accessories: CANTON sound system (9 speakers, 1 subwoofer, digital equalizer, 575W)
- Wheels: 18" steel spare wheel, space-saving (tires 145/85 R18 incl. jack, wheel wrench, loading floor cover replaces tire mobility kit)
- Seats: Folding passenger seat backrest
- Auxiliary heater with remote control
- Variable loading floor in the trunk
- Winter wheels on aluminum 215/65 R17
- Roof rails, anodized
- Chassis: Adaptive chassis DCC including driving profile selection (with customizable key (Normal, Eco, Sport, Individual), including Off-Road Assistant for 4x4 drive)
- Package: Business Columbus (Drive) (Dynamic Columbus radio navigation system with MP3, capacitive 9.2" color display, digital instrument cluster (virtual cockpit), traffic sign recognition, 2 SD card slots, SIM card slot (LTE support), Wi-Fi hotspot (data connection via the SIM in the LTE modem or via the paired mobile phone), 230 V socket and USB port, luggage net partition, Infotainment Online (valid for 3 years))
- 360° area view camera including Trailer Assist, parking sensors (front and rear)

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Seat - rear	Back seat (Isofix Abdeckung) - Missing - Replace
2	Trim / covers	Floor mats (VL) - Damaged - Replace
3	Bonnet	Bonnet - dent(s) - Smooth repair work
4	Roof	Roof rail - right side - dent(s) - Smooth repair work
5	Boot lid / rear door	Seal - Damaged - Replace
6	Interior	Interior - Soiled - Clean
7	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
8	Wheel / tyres	Tyre - rear right side - Porous / cracked - Replace
9	Wheel / tyres	Tyre - front right side - Porous / cracked - Replace
10	Wheel / tyres	Alloy rim - rear right side (Materialabtrag) - Scratch(es) - Replace
11	Headlight	Headlight - left side (Milchig) - Damaged - Replace

Wear and tear

No.	Component group	Description
1	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Front bumper	Front bumper - Stone chips - No deduction
4	Side panel - rear right side	Interior trim - Scratch(es) - No deduction



No.	Component group	Description
5	Rear bumper	Rear bumper - Scratch(es) - No deduction
6	Trim / covers	Door trim - rear left side - Scratch(es) - No deduction
7	Mudguard - left side	Mudguard - left side - Scratch(es) - No deduction
8	Side panel - rear right side	Side panel - Dent / paintcoat damage - No deduction
9	Door - rear right side	Door - dent(s) - No deduction
10	Door - front left side	Door - dent(s) - No deduction
11	Door - front right side	Door - Dent / paintcoat damage - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 21 Aug 2023	7.960,51 €

Accident damages

No.	Accident
1	Side right
2	Roof, Rear

Repainting

No.	Repainting
1	Side panel - rear left side, Side panel - rear right side, Door - rear left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear left side	1,800 µm	Side panel - rear right side	388 µm
Door - rear left side	233 µm		

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(Functional tests of driver assistance systems are not included in the scope of services!)
- a photo documentation of the vehicle



Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

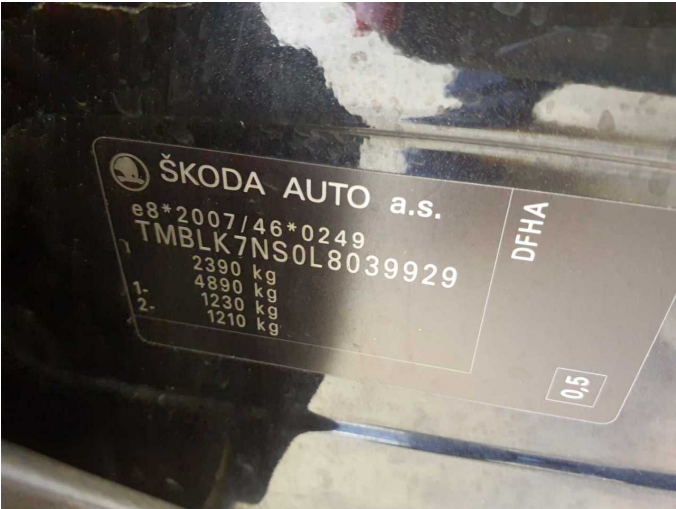


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

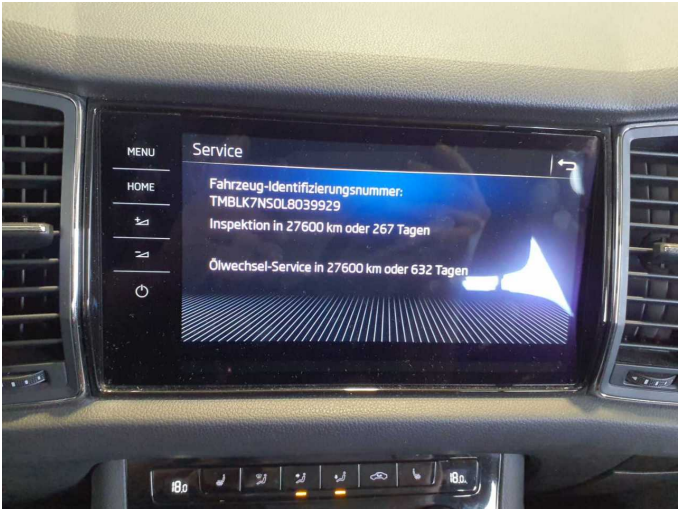


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.

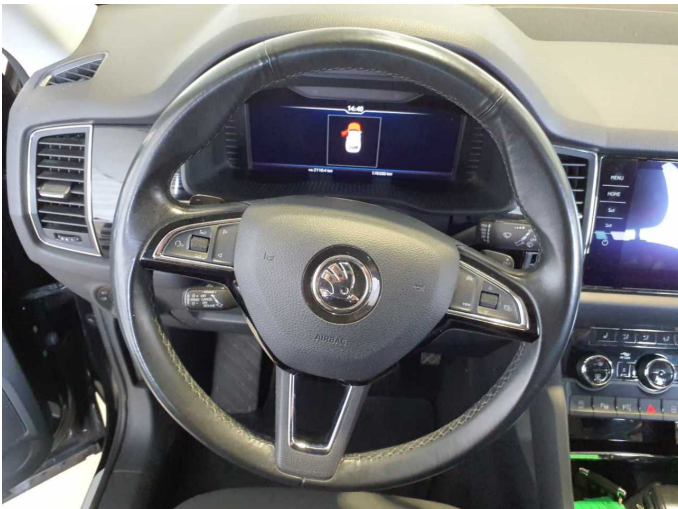


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.




Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

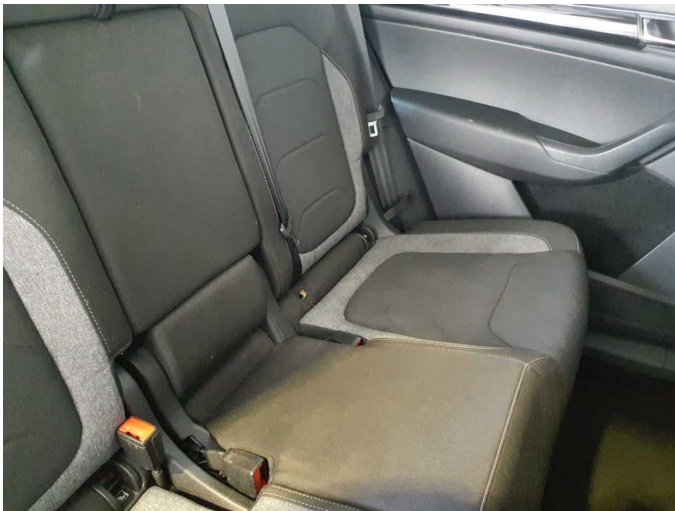

Damage 1: Seat - rear: Back seat (Isofix Abdeckung) - Missing - Replace



Damage 1: Seat - rear: Back seat (Isofix Abdeckung) - Missing - Replace



Damage 2: Trim / covers: Floor mats (VL) - Damaged - Replace




Damage 2: Trim / covers: Floor mats (VL) - Damaged - Replace



Damage 3: Bonnet: Bonnet - dent(s) - Smooth repair work



Damage 3: Bonnet: Bonnet - dent(s) - Smooth repair work

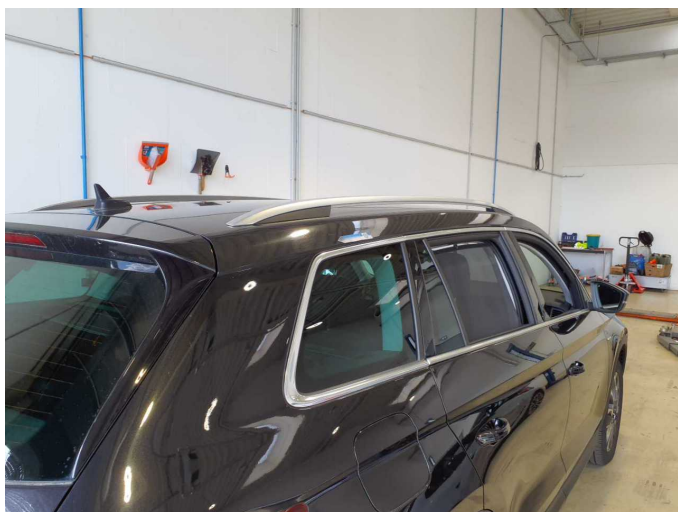

Damage 4: Roof: Roof rail - right side - dent(s) - Smooth repair work



Damage 4: Roof: Roof rail - right side - dent(s) - Smooth repair work



Damage 5: Boot lid / rear door: Seal - Damaged - Replace




Damage 5: Boot lid / rear door: Seal - Damaged - Replace



Damage 5: Boot lid / rear door: Seal - Damaged - Replace



Damage 5: Boot lid / rear door: Seal - Damaged - Replace

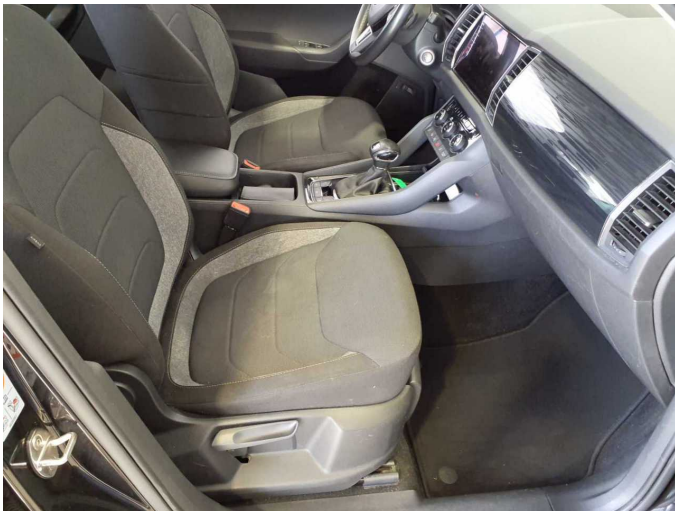

Damage 6: Interior: Interior - Soiled - Clean



Damage 6: Interior: Interior - Soiled - Clean



Damage 6: Interior: Interior - Soiled - Clean




Damage 6: Interior: Interior - Soiled - Clean



Damage 7: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 7: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

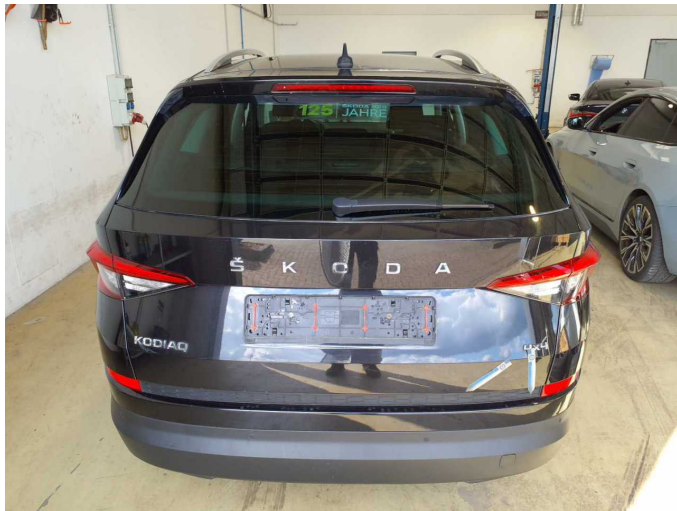


Damage 7: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 8: Wheel / tyres: Tyre - rear right side - Porous / cracked - Replace



Damage 8: Wheel / tyres: Tyre - rear right side - Porous / cracked - Replace

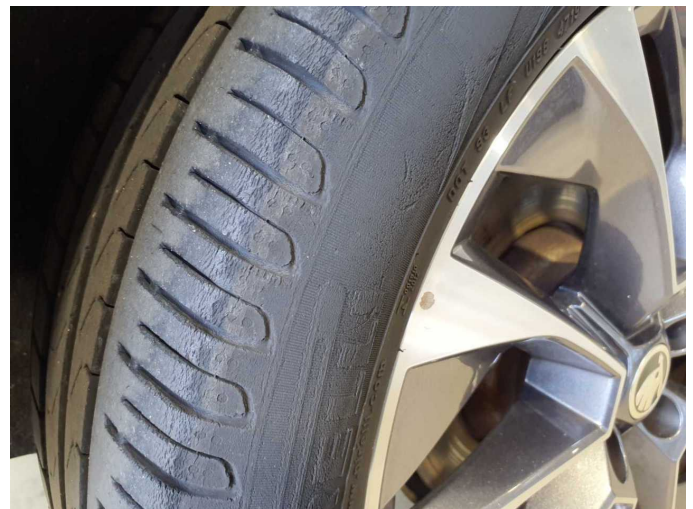


Damage 8: Wheel / tyres: Tyre - rear right side - Porous / cracked - Replace



Damage 8: Wheel / tyres: Tyre - rear right side - Porous / cracked - Replace



Damage 9: Wheel / tyres: Tyre - front right side - Porous / cracked - Replace

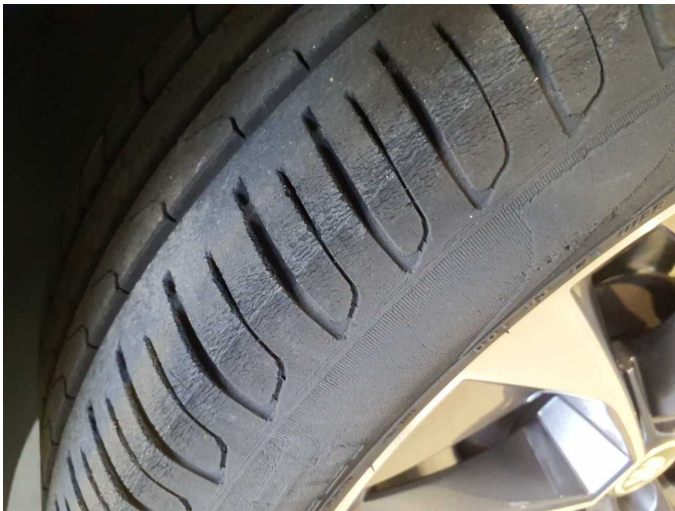

Damage 9: Wheel / tyres: Tyre - front right side - Porous / cracked - Replace



Damage 9: Wheel / tyres: Tyre - front right side - Porous / cracked - Replace



Damage 10: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratch(es) - Replace



Damage 10: Wheel / tyres: Alloy rim - rear right side (Materialabtrag) - Scratch(es) - Replace



Damage 11: Headlight: Headlight - left side (Milchig) - Damaged - Replace



Damage 11: Headlight: Headlight - left side (Milchig) - Damaged - Replace



Damage 11: Headlight: Headlight - left side (Milchig) - Damaged - Replace



Wear and tear 8: Side panel - rear right side: Side panel - Dent / paintcoat damage - No deduction




Wear and tear 8: Side panel - rear right side: Side panel - Dent / paintcoat damage - No deduction



Wear and tear 8: Side panel - rear right side: Side panel - Dent / paintcoat damage - No deduction



Wear and tear 9: Door - rear right side: Door - dent(s) - No deduction

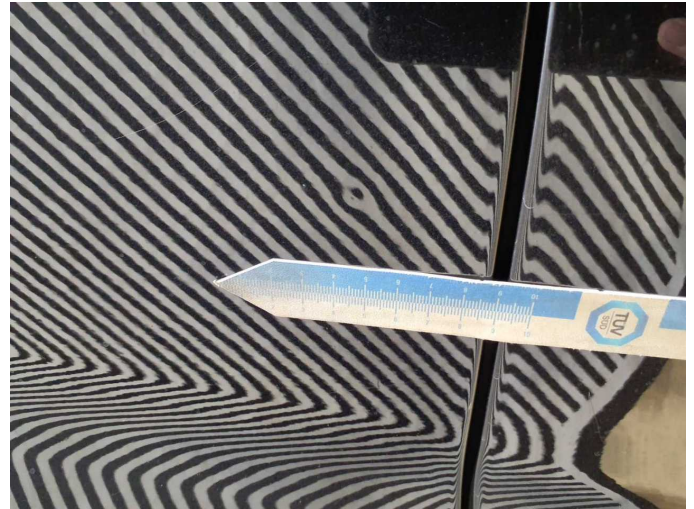


Wear and tear 9: Door - rear right side: Door - dent(s) - No deduction




Wear and tear 10: Door - front left side: Door - dent(s) - No deduction



Wear and tear 10: Door - front left side: Door - dent(s) - No deduction

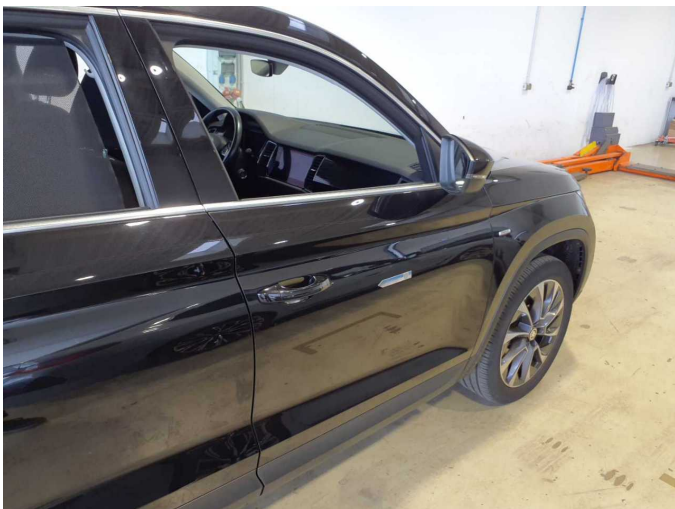

Wear and tear 11: Door - front right side: Door - Dent / paintcoat damage
- No deduction

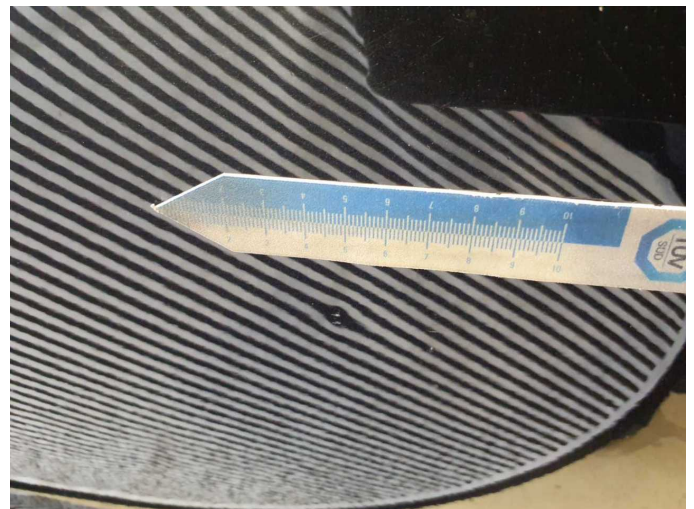

Wear and tear 11: Door - front right side: Door - Dent / paintcoat damage
- No deduction



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 2: Roof, Rear



Accident 2: Roof, Rear



Accident 2: Roof, Rear




Accident 2: Roof, Rear



Accident 2: Roof, Rear



Accident 2: Roof, Rear

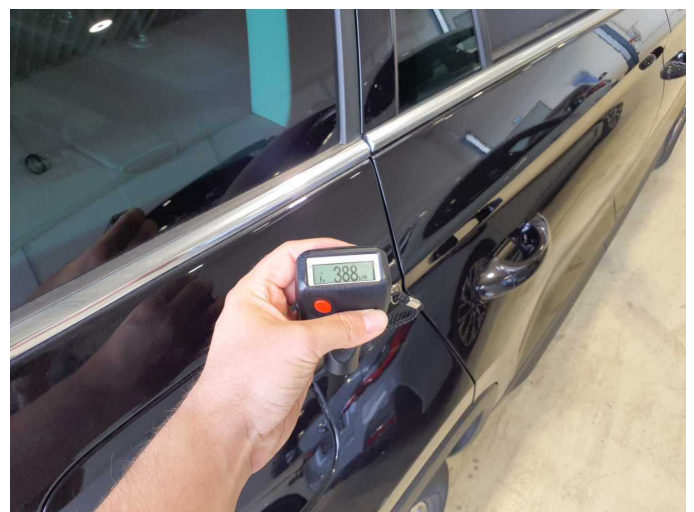

**Repainting 1: Side panel - rear left side, Side panel - rear right side,
Door - rear left side**




Repainting 1: Side panel - rear left side, Side panel - rear right side,
Door - rear left side



Repainting 1: Side panel - rear left side, Side panel - rear right side,
Door - rear left side



Repainting 1: Side panel - rear left side, Side panel - rear right side,
Door - rear left side

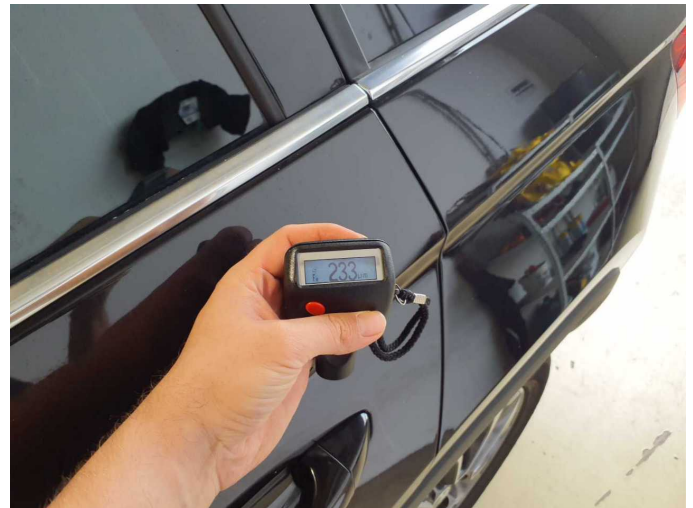

Repainting 1: Side panel - rear left side, Side panel - rear right side,
Door - rear left side



Repainting 1: Side panel - rear left side, Side panel - rear right side,
Door - rear left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBLK7NS0L8039929
Hersteller / Modell: SKODA SKODA Kodiaq 2.0 TDI 4x4 DSG Drive 125

Datum	KM-Stand	Beschreibung
17.07.2025	173.000	Kraftstofffilter ern; Motoröl b. Wartung; Regelwartungsdienst; Wartung Sonstiges
16.07.2024	142.995	Bremse Sonstiges; Bremsklötze vorne; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.04.2024	132.633	Reparatur Sonstiges; Systemtest/Eigendiagnose; Turbolader ern; Wartung Sonstiges
21.08.2023	118.763	AU
29.06.2023	110.840	Bremse Sonstiges; Bremsflüssigkeit ern; Bremsklötze vorne; Bremsscheiben vorne; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Ölwechsel - Hinterachse; Regelwartungsdienst; Reparatur Sonstiges; Systemtest/Eigendiagnose; Wartung Sonstiges
12.12.2022	88.893	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben hinten; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges
07.06.2022	65.565	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben vorne; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.09.2021	33.768	Motoröl b. Wartung; Regelwartungsdienst