



Expertise

Protocol number: 41532834
Order No. / Reference: 25225553
Inspection date: 15 Sept 2025

Manufacturer: Skoda	Model: Kodiaq 2.0 TDI 4x4 DSG Sportline
VIN: TMBLN7NS1N8007131	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Kodiaq 2.0 TDI 4x4 DSG Sportline	
Vehicle Identification number	TMBLN7NS1N8007131
Mileage (Read)	132,372 km
First registration	9 Sept 2021
Number of holders	1
Next periodical technical inspection	09/2026
(Report on hand)	
Power / Engine displacement	147 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	moonweiss-metallic (S9R)
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	18,300 km
Last maintenance on / at	05/2025 at 120,638 km		
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	GD072822
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AVW 00363		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,410 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 99V	Summer tires (with run-flat tires) on Light alloy	Pirelli	5mm / 5mm
2)	235/50 R19 99V	Summer tires (with run-flat tires) on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 104H	Winter tires (with run-flat tires) on Light alloy	Pirelli	4mm / 4mm
2)	235/55 R18 104H	Winter tires (with run-flat tires) on Light alloy	Pirelli	4mm / 4mm

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

Equipment

Standard equipment

- 12V socket in the center console and trunk
- Storage compartments behind the wheel arch in the trunk
- Airbag, driver and front passenger (front passenger airbag can be switched off)
- Airbag, front side airbags
- All-wheel drive permanent
- Traction control (ASR)
- Electrically folding exterior mirrors including interior and driver's mirror with automatic dimming
- Hill start assist
- Hydraulic brake assist (HBA)
- Black headliner
- Roof rails, black
- diesel particulate filter
- Third brake light (in the rear spoiler (LED))
- eCall (automatic emergency call function in the event of an accident with airbag deployment)
- ESC Electronic Stabilization Control
- Driving profile selection
- Chassis: Adaptive chassis DCC including driving profile selection (including off-road assistant for 4x4 drive)
- High beam assistant (Light Assist)
- Floor mats front and rear
- Closed storage compartment on the driver's side
- Transmission: 7-speed dual-clutch transmission (DSG)
- Illuminated glove compartment
- Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger including humidity sensor, odor and allergen filter, and climate-controlled glove compartment)
- LED ambient lighting (decorative strips in the door panels with selectable color scheme, LED reading lights in the front, LED lighting for the make-up mirrors in the sun visors)
- Steering wheel: Sport leather steering wheel with multifunction buttons including shift paddles (gear lever with leather elements)
- Front center armrest, including storage compartment
- Multifunction display in the instrument cluster, color
- Fog lights with integrated LED daytime running lights
- Pedals in stainless steel design
- Progressive steering
- Radio accessories: 8 speakers
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Wireless SmartLink
- Tire pressure monitoring
- Wheels: RunFlat tires with Seal technology ((self-sealing tires))
- Heated windscreen washer nozzles, front
- Headlights washer / wiper system
- Storage compartment on the left wheel house
- Aero wipers front
- Airbag, driver's knee airbag
- Airbag, head airbags
- Allergen filter
- Anti-lock braking system (ABS)
- Dashboard in black / black, door trim in black with microfiber inlay
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Care Connect: Proactive Services (10-year term) (Remote Access (1-year term))
- Dark Carbon decorative inlay
- tachometer
- Easy Start (start-stop button)
- Electronic parking brake including auto-hold function
- Electronic transverse differential lock (XDS+)
- Driving light assistant and rain sensor (tunnel light, coming and leaving home function)
- Electric windows front and rear (including anti-pinch protection and child safety lock)
- Front radar assistant including city emergency braking function with person detection
- Cruise control system
- Tinted windows
- Isofix anchorage on the outer rear seats including top tether
- Trunk cover, rollable and removable
- Headrests permanently integrated at the front, height adjustable at the rear
- LED matrix headlights and dynamic high beam assistant (Light Assist)
- LED taillights in crystal glass look & LED license plate lighting
- Reading lights on the front roof lining
- Rear center armrest with cup holders and through-loading option
- Engine drag torque control (MSR)
- Multi-collision brake
- Rear parking sensors
- Upholstery: Microfiber Sport-Black
- Radio: Bolero infotainment system (Bolero music system - capacitive 8" color display - voice control)
- Radio accessories: SmartLink (MirrorLink, Android Auto and Apple CarPlay)
- Wheels: 19" Triglav anthracite-polished alloy wheels (7Jx19 tires 235/50 R19 99V ET43)
- Rear seat backrest 60:40 split folding, longitudinally adjustable, backrest angle
- Power steering, electromechanical



- Kodiaq seat belts (height-adjustable three-point seat belts in the front, with belt tensioners - three three-point seat belts in the rear - seat belt fastening signaling in the front and in the second row of seats)
- Seats: Height-adjustable front seats
- Skoda Care Connect (SOS emergency call function (eCall, including automatic activation in the event of an accident with airbag deployment) - Mobility service (connection option for rapid assistance in the event of a breakdown) - Information service (connection option to the hotline for all questions about vehicle functions) - Free remote vehicle access for one year (Remote Access) with access to vehicle data/functions via smartphone, e.g., parking position, activating hazard lights, current fuel level status, and much more)
- Lashing eyes in the trunk
- Central locking with radio remote control (two vehicle keys)
- Seats: Heated front and outer rear seats
- Seats: Adjustable lumbar supports in the front seats
- Seats: Electrically adjustable front seats with memory function
- Seats: Remote release of the rear seat backrests (2nd row) in the trunk
- Sun visor on driver and passenger side with vanity mirror (illuminated)
- Speed limiter
- Sunset (rear window and rear side windows dark tinted)
- Telephone: Comfort hands-free telephone system including phone box (with inductive charging function (connection via external antenna))
- Front door sills
- Variable fastening concept in the trunk
- Immobiliser

Extra equipment

- Package: Business Amundsen (Sportline, RS) (Dynamic radio navigation system Amundsen - Capacitive 8" color display - Digital instrument cluster (Virtual Cockpit) - Driver Alert System - 230V socket and a USB charging port (Type-C) on the back of the front center armrest - Acoustic glazing in the front doors - Luggage net partition - Infotainment Online (3-year term))
- Paint finish: metallic / pearl effect
- Trailer coupling, swiveling (with electric release, including trailer stabilization)
- Electric panoramic sliding roof including sun blind (no glasses compartment on the roof lining)
- Parking sensors front & rear
- Rear view camera
- Third vehicle key
- Traveller Assistance System (DSG) (Adaptive Cruise Control ACC (control range up to 210 km/h) - Lane Assist - Adaptive Lane Guidance - Traffic Jam and Emergency Assist - Traffic Sign Recognition)

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting trip was carried out on the company premises.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front right side	Brightware - lower - Scratch(es) - Smart repair
2	Body	Wheel well - front right side (Radhausschale) - Broken / torn - Replace
3	Front bumper	Spoiler - Stone chips - Paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Vehicle glazing	Rear window - Scratch(es) - No deduction
3	Front bumper	Front bumper - Stone chips - No deduction



No.	Component group	Description
4	2nd wheel set	Tyres - complete set (Profiltiefe; Kein Teil der Ausstattung) - Worn - No deduction
5	Trim / covers	Floor mats - Holes - No deduction
The vehicle shows signs of wear commensurate with its age and use.		

Missing parts

Description
Equipment - Umbrella

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 26 Sept 2023	3.054,98 €
2	Rear, Side - left, Provided by user / customer, from 2 Dec 2023	4.843,32 €
3	Roof, Front, Side right, Provided by user / customer, from 22 Jun 2023	7.559,88 €
4	Side right, Provided by user / customer, from 26 Nov 2024	9.045,89 €

Repainting

No.	Repainting
1	Roof rail - left side, Professionally carried out, Invoice of repair done Non-existent
2	Roof rail - right side, Professionally carried out, Invoice of repair done Non-existent
3	Mudguard - right side, Professionally carried out, Invoice of repair done Non-existent
4	Bonnet, Professionally carried out, Invoice of repair done Non-existent
5	Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent
6	Side panel - rear right side, Professionally carried out, Invoice of repair done Non-existent
7	Door - rear left side, Professionally carried out, Invoice of repair done Non-existent
8	Door - rear right side, Professionally carried out, Invoice of repair done Non-existent
9	Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Roof rail - left side	181 µm	Roof rail - right side	276 µm
Mudguard - right side	205 µm	Bonnet	308 µm
Side panel - rear left side	925 µm	Side panel - rear right side	226 µm
Door - rear left side	196 µm	Door - rear right side	306 µm
Door - front right side	256 µm		

Order/Scope of order

- The order was placed to prepare a sales report for the vehicle described. This includes the following:
- Description of core relevant information about the vehicle
 - Documentation of equipment features
(Delivery by third-party service providers)
 - Documentation of damage, defects, missing parts
 - Documentation of previous damage, unrepaired previous damage, repainting
 - a brief visual or functional inspection of the equipment details if possible.
(Functional tests of driver assistance systems are not included in the scope of services!)
 - a photo documentation of the vehicle



Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

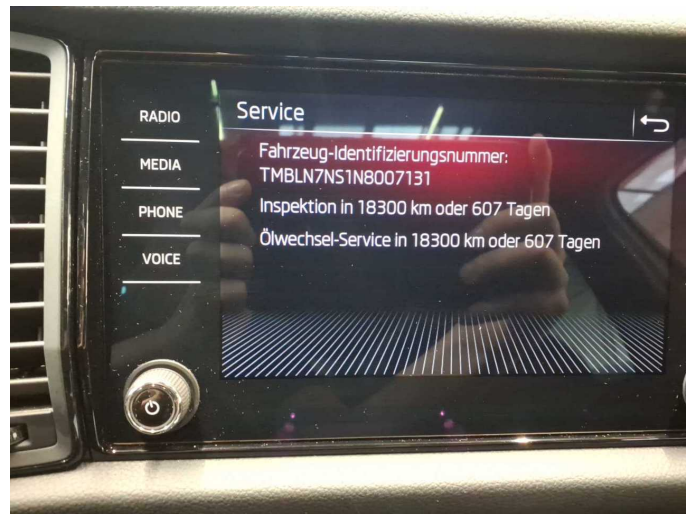


Figure 14: Documents



Figure 15: Documents

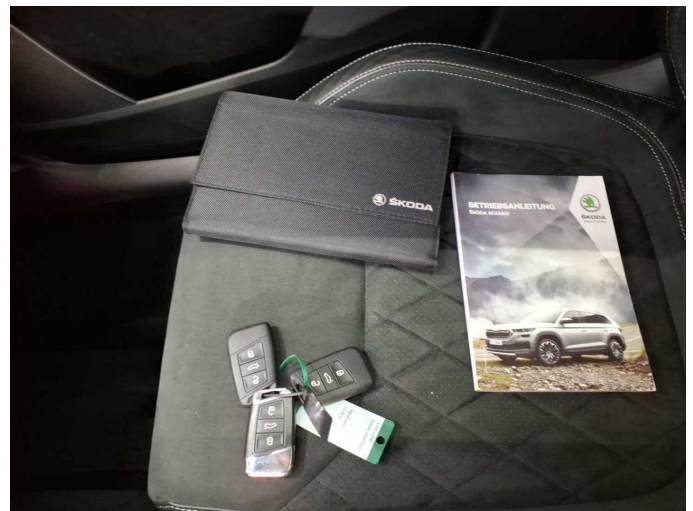


Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

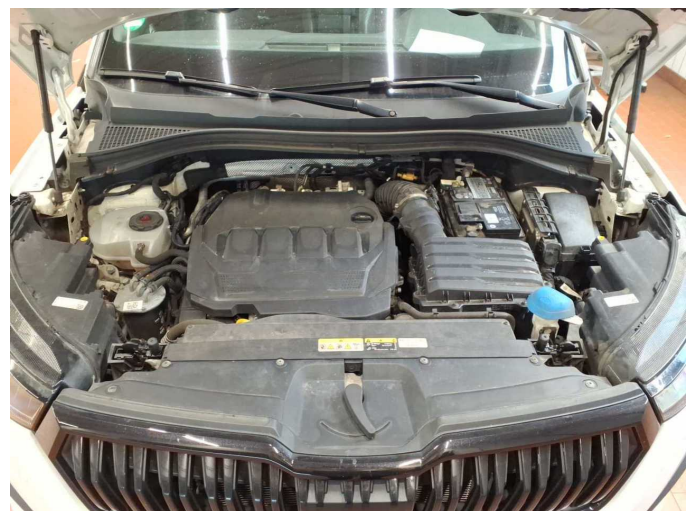


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Damage 1: Door - front right side: Brightware - lower - Scratch(es) - Smart repair



Damage 1: Door - front right side: Brightware - lower - Scratch(es) - Smart repair



Damage 2: Body: Wheel well - front right side (Radhausschale) - Broken / torn - Replace



Damage 2: Body: Wheel well - front right side (Radhausschale) - Broken / torn - Replace



Damage 3: Front bumper: Spoiler - Stone chips - Paint



Damage 3: Front bumper: Spoiler - Stone chips - Paint



Damage 3: Front bumper: Spoiler - Stone chips - Paint



Damage 3: Front bumper: Spoiler - Stone chips - Paint



Damage 3: Front bumper: Spoiler - Stone chips - Paint



Repainting 1: Roof rail - left side



Repainting 2: Roof rail - right side



Repainting 3: Mudguard - right side



Repainting 4: Bonnet



Repainting 5: Side panel - rear left side



Repainting 6: Side panel - rear right side



Repainting 7: Door - rear left side



Repainting 8: Door - rear right side



Repainting 9: Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBLN7NS1N8007131
Hersteller / Modell: SKODA SKODA Kodiaq 2.0 TDI 4x4 DSG Sportline

Datum	KM-Stand	Beschreibung
15.05.2025	120.638	Bremse Sonstiges; Bremsklötze vorne; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
02.09.2024	197.478	AU
27.06.2024	91.105	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
09.10.2023	62.178	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Ölwechsel - Hinterachse; Regelwartungsdienst; Wartung Sonstiges
15.08.2023	54.742	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne
30.11.2022	28.768	Motoröl b. Wartung; Regelwartungsdienst