



Expertise

Protocol number: 41141329
Order No. / Reference: 25072415
Inspection date: 20 Aug 2025

Manufacturer: Skoda
VIN: TMBLN9NS2M8056333

Model: Kodiaq 2.0 TDI 4x4 DSG Scout



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Kodiaq 2.0 TDI 4x4 DSG Scout	
Vehicle Identification number	TMBLN9NS2M8056333
Mileage (Read)	150,475 km
First registration	11 Jun 2021
Number of holders	1
Next periodical technical inspection	07/2026
(Report on hand)	
Power / Engine displacement	147 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Black-Magic Perleffekt
Doors / Seats	5 / 5
Upholstery type	Alcantara / cloth
Colour of upholstery	Black-Anthracite
Type of use	rental car



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	4,500 km
Last maintenance on / at	12/2024 at 124,909 km		
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	GD045744
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AVW 00252		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,369 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 99V	Summer tyres on Light alloy	Pirelli	4mm / 4mm
2)	235/50 R19 99V	Summer tyres on Light alloy	Pirelli	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 104H	Winter tyres on Light alloy	Goodyear	5mm / 5mm
2)	235/55 R18 104H	Winter tyres on Light alloy	Goodyear	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2025		

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

Equipment

Standard equipment

- Storage compartment on the left wheel house
- Shelves
- Airbag, driver's knee airbag
- Airbag, front side airbags
- All-wheel drive permanent
- Traction control (ASR)
- Electrically adjustable and heated exterior mirrors with integrated side indicators
- Brake assist, hydraulic
- Cargo elements in the trunk
- Decorative inlay Scout
- tachometer
- third vehicle key
- eCall
- Electronic transverse differential lock (XDS+)
- Headlight assistant and rain sensor
- Electric windows front and rear
- Floor mats front and rear
- Footwell lighting front and rear
- Transmission: 7-speed dual-clutch transmission (DSG)
- Green tec (automatic start/stop including brake energy recovery)
- Rear window wiper Aero including windscreen washer system
- Climatronic air conditioning (2 zones)
- Headrests height adjustable front and rear
- LED rear lights
- Rear center armrest with cup holders and through-loading option
- MSR (engine drag torque control)
- Fog lights with integrated LED daytime running lights
- Parking sensors front & rear
- Progressive steering
- Radio accessories: 8 speakers
- Radio accessories: SmartLink
- Tire mobility set
- Wheels: 19" Braga alloy wheels in anthracite-polished
- Heated windscreen washer nozzles
- Headlights washer / wiper system
- Seat belts Kodiah
- Skoda Care Connect
- 12V socket - in the center console and in the trunk
- Front and rear bumpers and sills in SCOUT look
- Telephone: Comfort hands-free telephone system including phone box
- Lashing eyes in the trunk
- Central locking with radio remote control
- Storage compartments behind the wheel arch in the trunk
- Airbag, driver and passenger
- Airbag, head airbags
- Allergen filter
- Anti-lock braking system (ABS)
- Electrically folding exterior mirrors including interior and exterior mirrors with automatic dimming
- Hill start assist
- Care Connect: Proactive Services (10-year term)
- Roof rails, anodized
- diesel particulate filter
- Third brake light
- Easy Start (start-stop button instead of the ignition lock)
- Electronic parking brake including auto-hold function
- ESC Electronic Stabilization Control
- Driving profile selection
- Front radar assistant including city emergency braking function with person detection
- Cruise control system
- Tinted windows
- Illuminated glove compartment
- Heated rear window
- Rear spoiler
- ISOFIX preparation on the outer rear seats
- Trunk cover, rollable and removable
- LED ambient lighting
- Steering wheel: Leather steering wheel with multifunction buttons
- Front center armrest, including storage compartment
- Multifunction display in the instrument cluster
- Net program in the trunk
- Upholstery: Microfiber Alcantara trim SCOUT
- Radio: Bolero infotainment system
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Wireless SmartLink
- Tire pressure monitoring
- Rear seat backrest 60:40 split folding, longitudinally adjustable, backrest angle
- Power steering, electromechanical
- Seats: Driver and passenger seats height adjustable
- Speed limiter
- Bumpers painted in body color
- Sunset
- Engine underbody protection
- Variable fastening concept in the trunk (only for 5-seater)
- Immobiliser

Extra equipment



- Trailer coupling, swiveling (with electric release, including trailer stabilization)
- Electric tailgate operation including comfort opening
- Kessy - keyless entry and start-stop system
- Finish: pearl effect
- Steering wheel: Heated steering wheel (including shift paddles)
- Package: Business Amundsen (Scout, Sportline) (Dynamic radio navigation system Amundsen with MP3 - Capacitive 8" color display - Color multifunction display in the instrument cluster - Fatigue detection - 230 V socket and USB port - Luggage net partition - Infotainment Online (valid for 3 years))
- Seats: Heated front seats
- Variable loading floor in the trunk
- Traveller Assistance System (DSG) (Adaptive Cruise Control ACC (control range up to 210 km/h) - Lane Assist - Adaptive Lane Guidance - Traffic Jam and Emergency Assist - Traffic Sign Recognition)
- LED headlights with LED daytime running lights (including adaptive headlights (AFS): lighting system with fully automatic and situation-dependent light control (city, intercity, motorway and bad weather modes), cornering lights, automatic headlight range adjustment)
- Electric panoramic sliding roof including sun blind (no glasses compartment on the roof lining)
- Proactive occupant protection including rear side airbags
- Rear view camera
- Seats: Folding tables on the front seat backrests

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Mudguard - right side	Mudguard - right side - Scratch(es) - Smart repair
3	Mudguard - left side	Mudguard - left side - Scratch(es) - Smart repair
4	Mudguard - right side	Wheel well extension - Scratch(es) - Smart repair
5	Door - rear left side	Door edge - Scratch(es) - Smart repair
6	Wing mirror - left side	Cap - Scratch(es) - Paint
7	Wing mirror - right side	Cap - Scratch(es) - Paint
8	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
9	Rear bumper	Protection strip - centre - Scratched - Smart repair
10	Roof	Roof rail - right side - Scratch(es) - Smart repair
11	Front bumper	Front bumper - Scratched - Smart repair
12	Door - rear right side	Door - Dent / paintcoat damage - Smart repair
13	Front bumper	Spoiler - Scratch(es) - Smart repair
14	Door - front left side	Door - Dent / paintcoat damage - Smart repair
15	Door - front right side	Door - Dent / paintcoat damage - Smart repair
16	Rear bumper	Rear bumper - Scratch(es) - Repair and paint
17	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint
18	Vehicle glazing	Windscreen with rain sensor - Stone chips - Replace

Wear and tear



No.	Component group	Description
1	Side panel - rear left side	Side panel - Scratch(es) - Cover / polish
2	Side panel - rear right side	Side panel - Scratch(es) - Cover / polish

The vehicle shows signs of wear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 19 May 2022	1.282,96 €

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument cluster



Figure 9: Instrument panel



Figure 10: interior 360° view ([Online link](#))



Figure 11: Cargo area



Figure 12: VIN



Figure 13: Mounted tyres



Figure 14: Documents

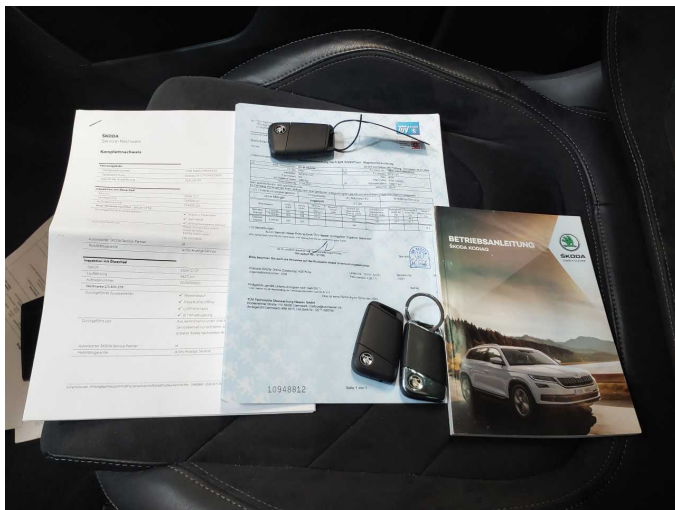


Figure 15: Documents

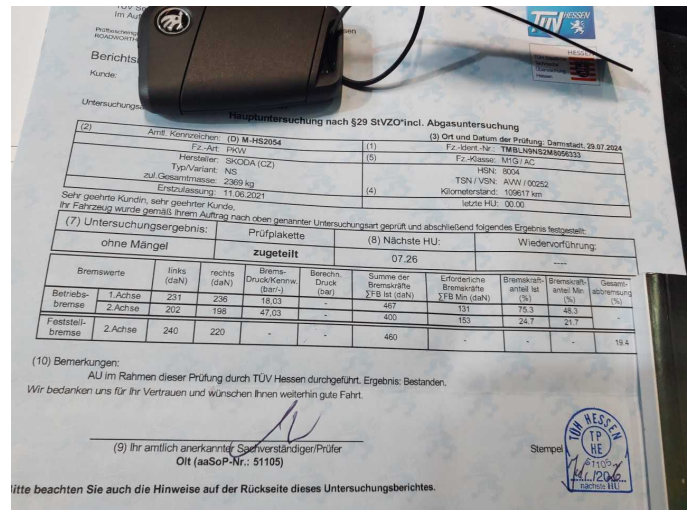


Figure 16: Documents

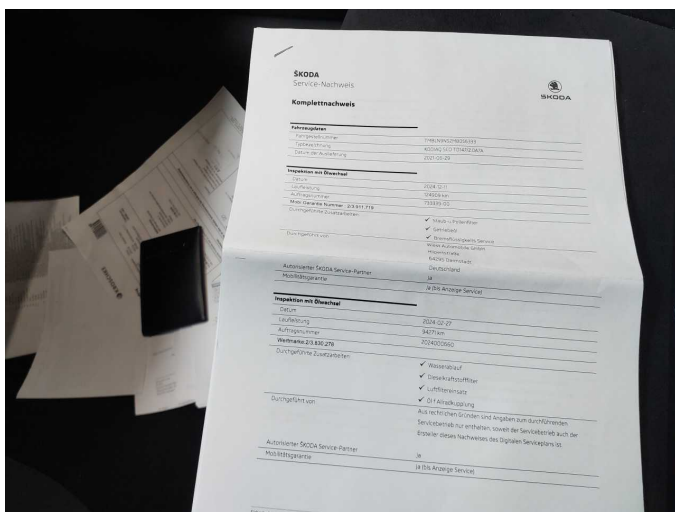


Figure 17: Documents



Figure 18: Additional tyres



Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.

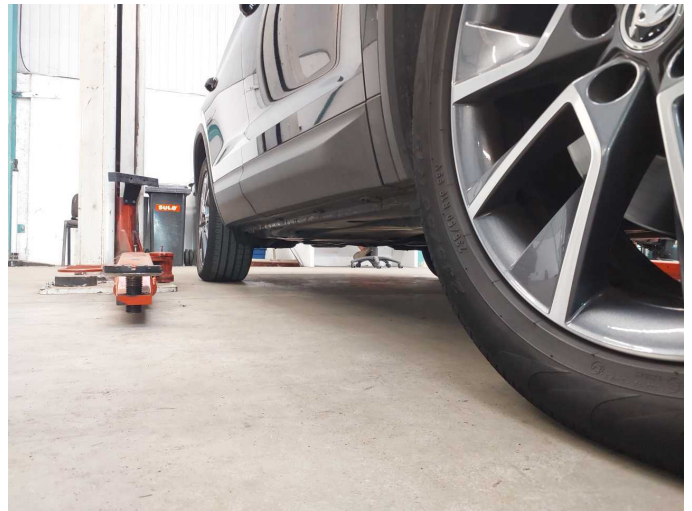


Figure 22: Misc.



Figure 23: Misc.

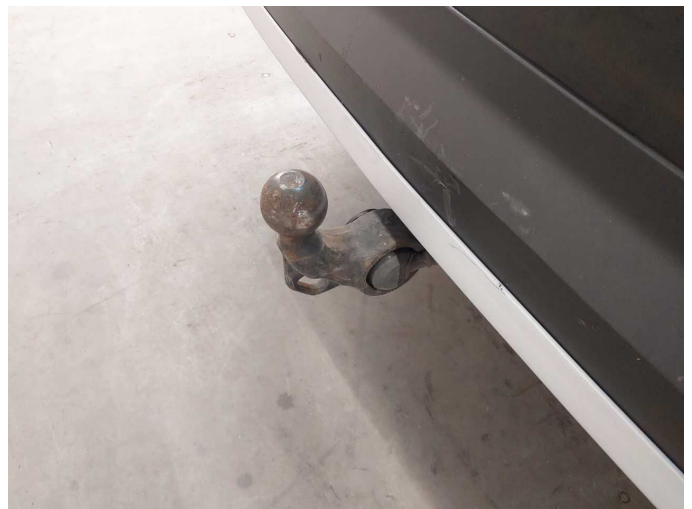


Figure 24: Misc.



Figure 25: Misc.

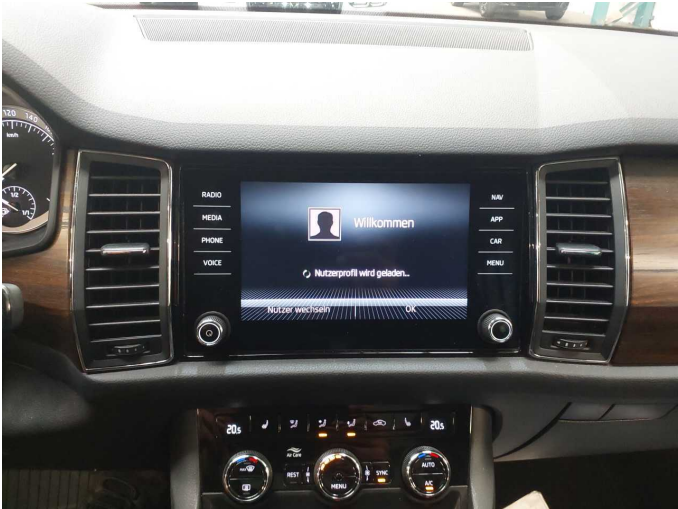


Figure 26: Misc.



Figure 27: Misc.




Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.

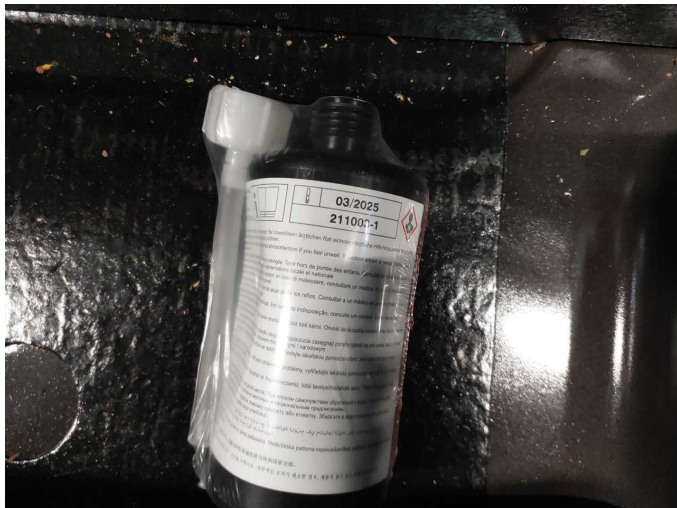

Damage 1: Equipment: Tirefit filler - Expired - Replace



Damage 2: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair




Damage 2: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair



Damage 3: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair




Damage 3: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair

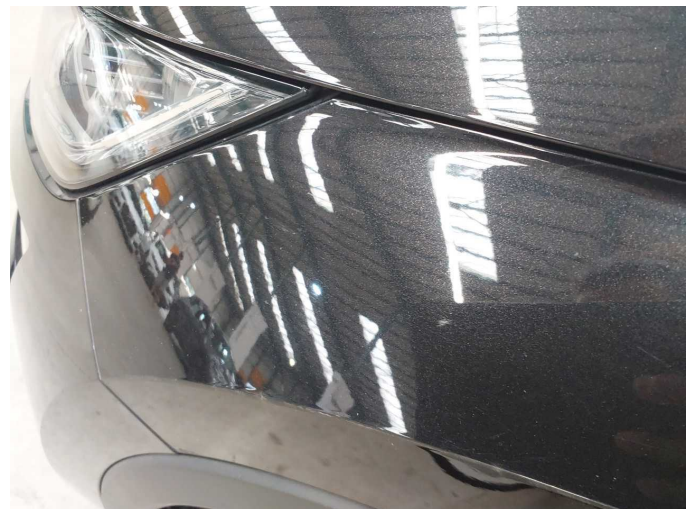


Damage 3: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair



Damage 4: Mudguard - right side: Wheel well extension - Scratch(es) - Smart repair

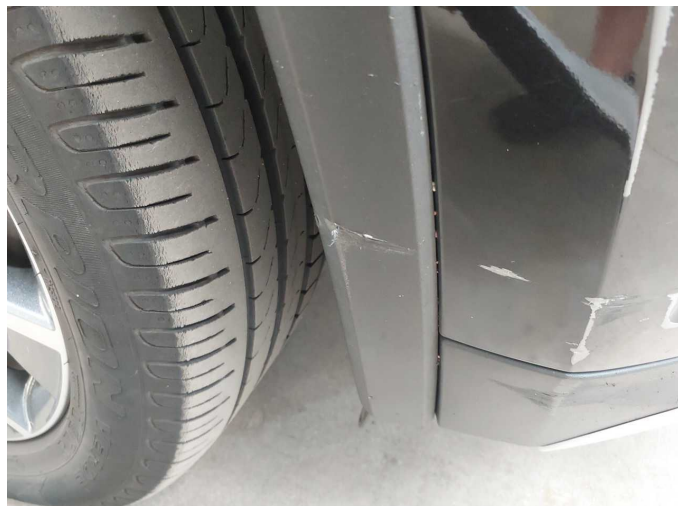


Damage 4: Mudguard - right side: Wheel well extension - Scratch(es) - Smart repair

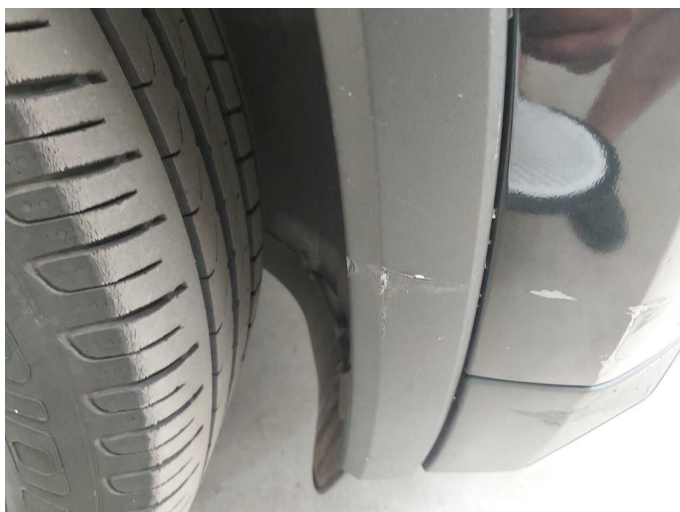

Damage 4: Mudguard - right side: Wheel well extension - Scratch(es) - Smart repair



Damage 5: Door - rear left side: Door edge - Scratch(es) - Smart repair

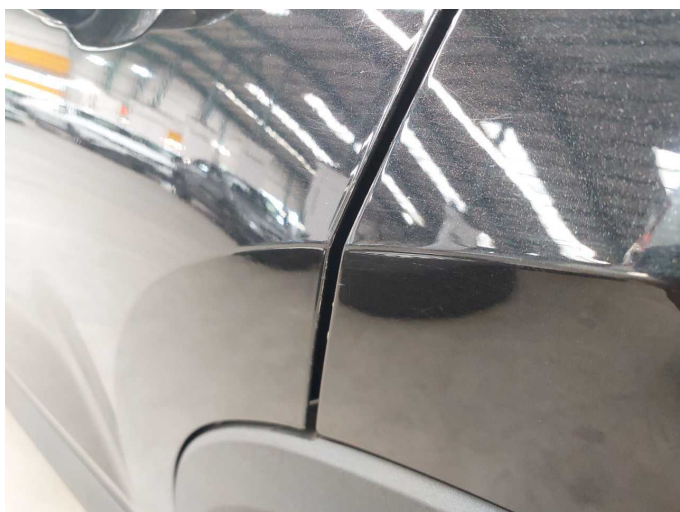

Damage 5: Door - rear left side: Door edge - Scratch(es) - Smart repair



Damage 6: Wing mirror - left side: Cap - Scratch(es) - Paint



Damage 6: Wing mirror - left side: Cap - Scratch(es) - Paint



Damage 7: Wing mirror - right side: Cap - Scratch(es) - Paint



Damage 7: Wing mirror - right side: Cap - Scratch(es) - Paint




Damage 7: Wing mirror - right side: Cap - Scratch(es) - Paint



Damage 7: Wing mirror - right side: Cap - Scratch(es) - Paint



Damage 8: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

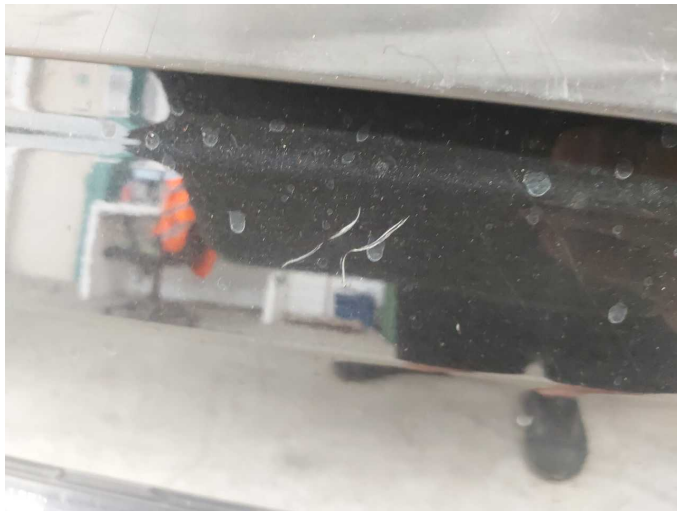

Damage 8: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair




Damage 9: Rear bumper: Protection strip - centre - Scratched - Smart repair



Damage 9: Rear bumper: Protection strip - centre - Scratched - Smart repair



Damage 9: Rear bumper: Protection strip - centre - Scratched - Smart repair

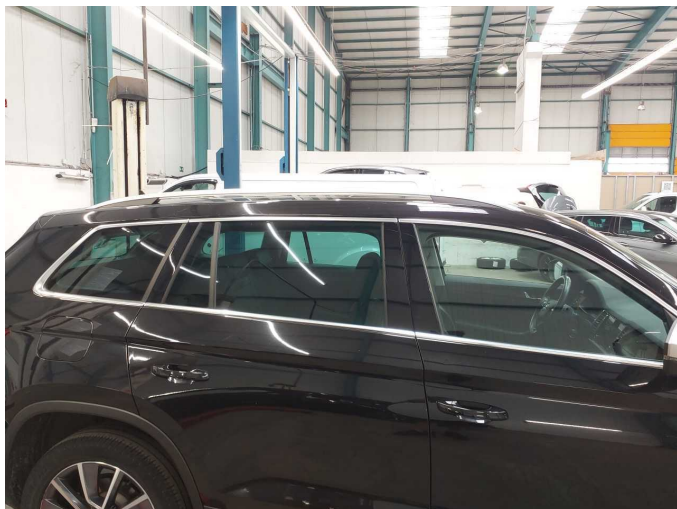

Damage 10: Roof: Roof rail - right side - Scratch(es) - Smart repair



Damage 10: Roof: Roof rail - right side - Scratch(es) - Smart repair



Damage 10: Roof: Roof rail - right side - Scratch(es) - Smart repair



Damage 11: Front bumper: Front bumper - Scratched - Smart repair



Damage 11: Front bumper: Front bumper - Scratched - Smart repair




Damage 11: Front bumper: Front bumper - Scratched - Smart repair



Damage 11: Front bumper: Front bumper - Scratched - Smart repair




Damage 12: Door - rear right side: Door - Dent / paintcoat damage - Smart repair

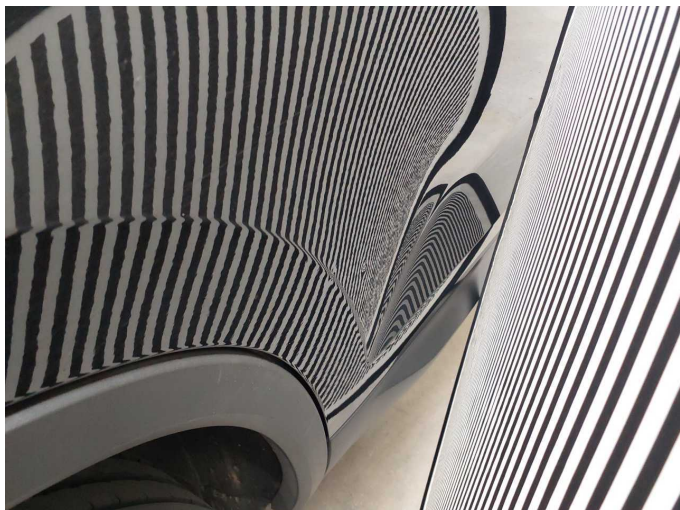

Damage 12: Door - rear right side: Door - Dent / paintcoat damage - Smart repair




Damage 12: Door - rear right side: Door - Dent / paintcoat damage - Smart repair

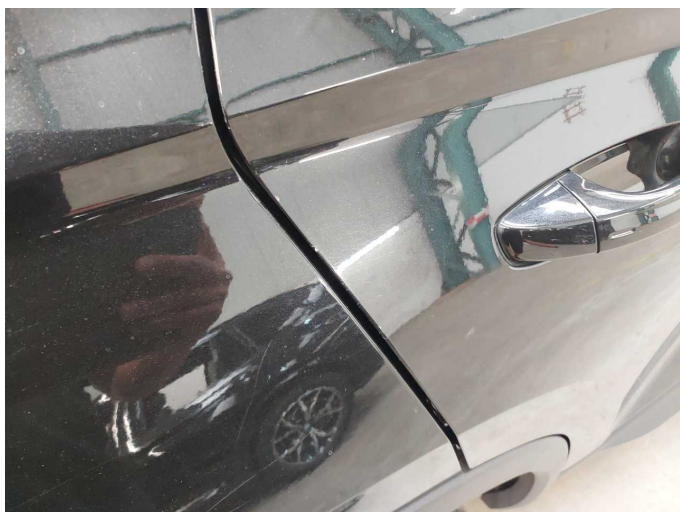

Damage 12: Door - rear right side: Door - Dent / paintcoat damage - Smart repair




Damage 13: Front bumper: Spoiler - Scratch(es) - Smart repair

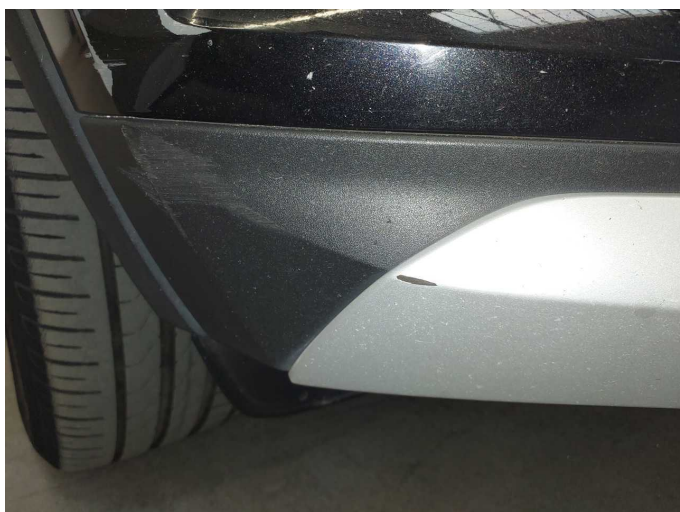


Damage 13: Front bumper: Spoiler - Scratch(es) - Smart repair



Damage 14: Door - front left side: Door - Dent / paintcoat damage - Smart repair

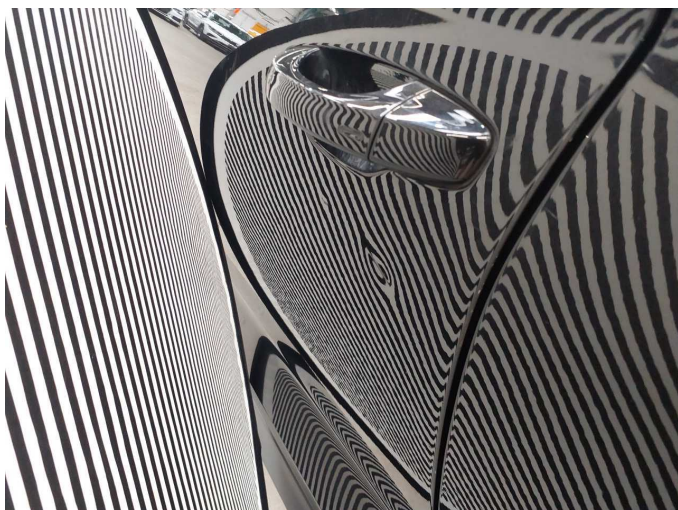

Damage 14: Door - front left side: Door - Dent / paintcoat damage - Smart repair

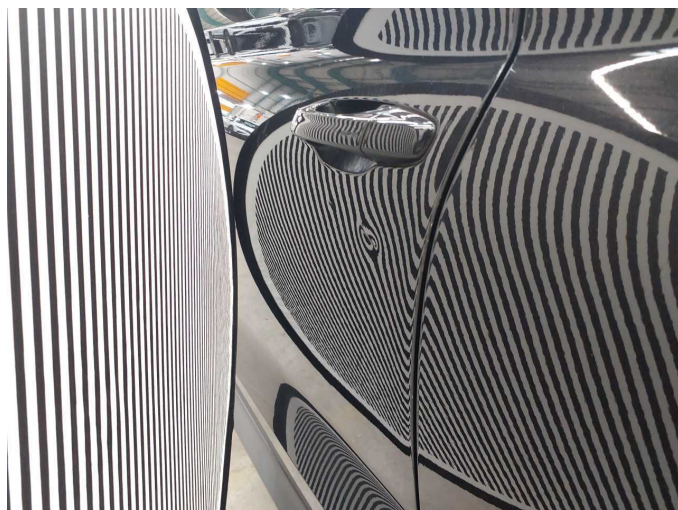

Damage 14: Door - front left side: Door - Dent / paintcoat damage - Smart repair



Damage 14: Door - front left side: Door - Dent / paintcoat damage - Smart repair



Damage 15: Door - front right side: Door - Dent / paintcoat damage - Smart repair



Damage 15: Door - front right side: Door - Dent / paintcoat damage - Smart repair




Damage 15: Door - front right side: Door - Dent / paintcoat damage - Smart repair




Damage 16: Rear bumper: Rear bumper - Scratch(es) - Repair and paint




Damage 16: Rear bumper: Rear bumper - Scratch(es) - Repair and paint

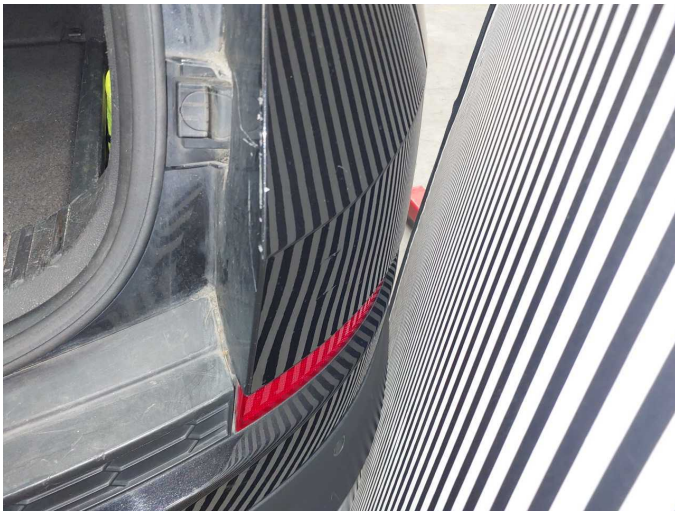

Damage 16: Rear bumper: Rear bumper - Scratch(es) - Repair and paint

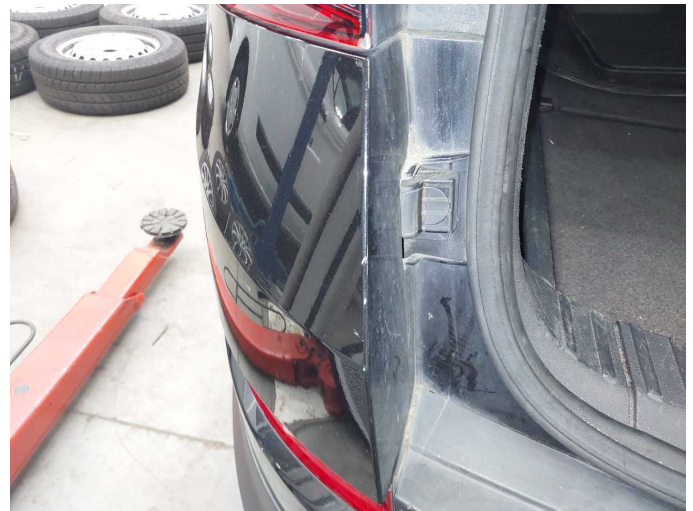


Damage 16: Rear bumper: Rear bumper - Scratch(es) - Repair and paint

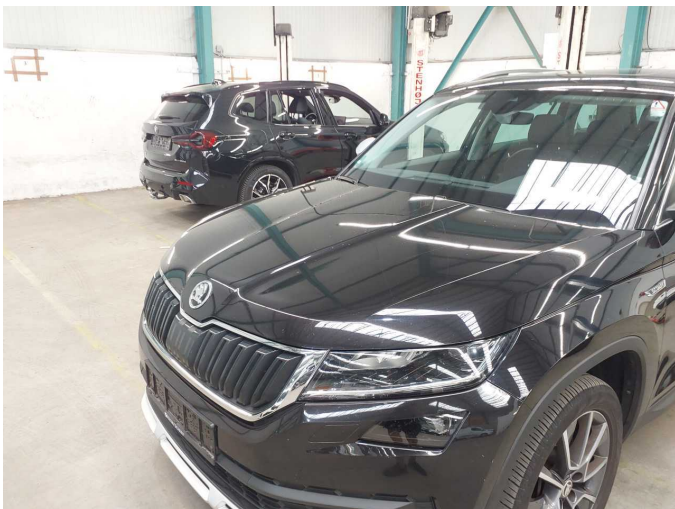

Damage 17: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 17: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint

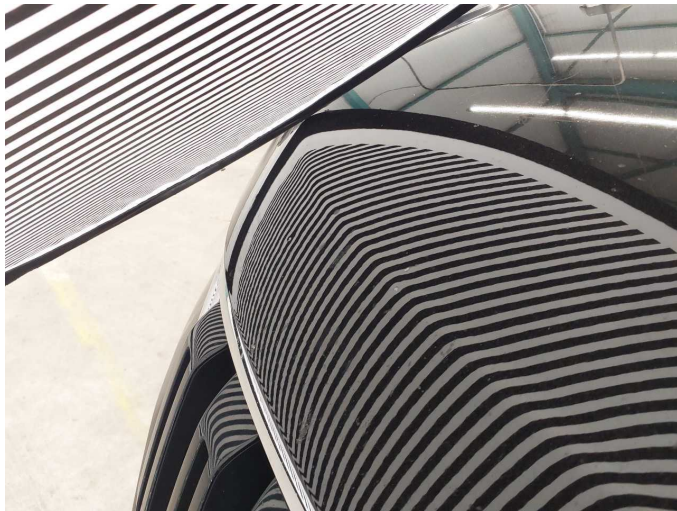


Damage 17: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 17: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 18: Vehicle glazing: Windscreen with rain sensor - Stone chips - Replace

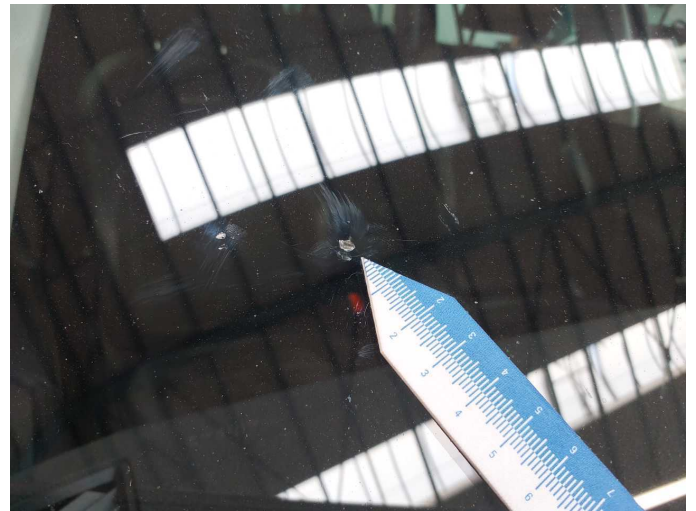

Damage 18: Vehicle glazing: Windscreen with rain sensor - Stone chips - Replace



Damage 18: Vehicle glazing: Windscreen with rain sensor - Stone chips - Replace



Wear and tear 1: Side panel - rear left side: Side panel - Scratch(es) - Cover / polish



Wear and tear 1: Side panel - rear left side: Side panel - Scratch(es) - Cover / polish



Wear and tear 1: Side panel - rear left side: Side panel - Scratch(es) - Cover / polish



Wear and tear 2: Side panel - rear right side: Side panel - Scratch(es) - Cover / polish



Wear and tear 2: Side panel - rear right side: Side panel - Scratch(es) - Cover / polish



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBLN9NS2M8056333
Hersteller / Modell: SKODA SKODA Kodiaq 2.0 TDI 4x4 DSG Scout

Datum	KM-Stand	Beschreibung
13.12.2024	124.909	Batterie ern; Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
11.09.2024	113.795	Reparatur Sonstiges; Systemtest/Eigendiagnose
29.07.2024	0	HU + AU
28.02.2024	94.278	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Getriebeöl ern/prüfen; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel - Hinterachse; Regelwartungsdienst; Reparatur Sonstiges; Systemtest/Eigendiagnose; Wartung Sonstiges
22.03.2023	60.986	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
31.03.2022	29.848	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges