



Renault Traffic: 1WPR323

Vinnumber:	VF1FL000462668560	Versionname:	
First Registrationdate:	2/08/2019	Fiscalpower:	
Expertise Mileage:	28149	Power Kw:	70
Bodytype:		Body colour:	White
Gearbox:	MAN 6 VIT	Type of rims (mounted):	Steel
Transmission:		Parking lot:	2525
Fueltype:	Diesel		
Type of rims (mounted):	Steel		
Certificate of Conformity:	Yes		
Category:	Light Commercial Vehicle		
Registration Certificate Car (BE):	Yes		
Registration Certificate Home (BE):	No		

Options

Number of keys total:	2	Rear parking sensors:	
Type of headlighting:	Headlighting Halogen	Type of Tow bar:	Tow bar fixed
Type of GPS:	GPS base		
Type of Lining:	Lining fabrics		
Type of climate control:	Manual climate control		

Limited Technical Inspection

Tyres

205/65/16/105 T				
Summer tyres:	Fr.L.	Continental: 4 mm	Fr.R.	Continental: 4 mm
	Re.L.	Continental: 5 mm	Re.R.	Continental: 5 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				5.0
Tyre profile depth RR				5.0
Tyre size FL				205/65 R 16 105 T
Tyre size FR				205/65 R 16 105 T
Tyre size RL				205/65 R 16 105 T
Tyre size RR				205/65 R 16 105 T
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				256
Tyre make FR				256
Tyre make RL				256
Tyre make RR				256


Assistance equipment

Emergency spare wheel:	Yes	Jack:	Yes
Number of charging cables (normal):	0		
Number of charging cables (rapid charge):	0		

Total cost ex VAT	4195,92
-------------------	---------

Interior, Damaged, Acceptable	0,00
-------------------------------	------



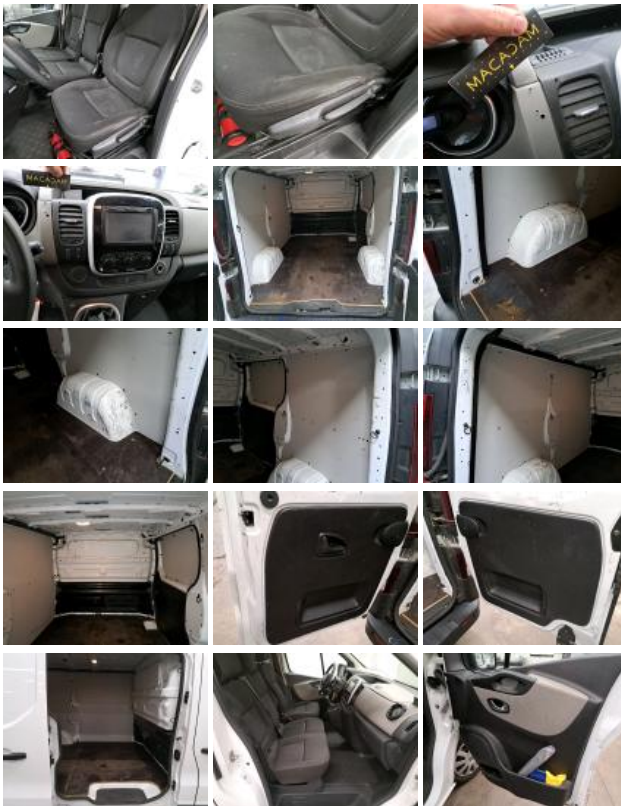

Seat cover FL, Stain, Cleaning	28,43
--------------------------------	-------



Backrest cover FL, Stain, Cleaning	28,43
------------------------------------	-------




Bumper F, Broken, Replace	546,82
---------------------------	--------



Bumper F, Scratch(es), Repair and paint (complete)	216,80
--	--------



Windscreen moulding, Damaged, Replace	207,39
---------------------------------------	--------

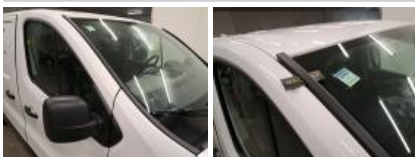

Wheel cover FL, Scratch(es), Replace	44,52
--------------------------------------	-------




Outside rear-view mirror housing L, Scratch(es), Smart repair 113,74



Door FL, Dent(s) and scratch(es), Repair and paint (complete) 325,87



Door trim FL, Scratch(es), Acceptable 0,00

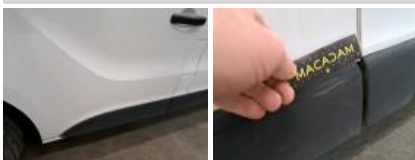

Wing RL, Dent(s) and scratch(es), Repair and paint (complete) 315,48



Wing trim RL, Scratch(es), Replace 61,60



Wheel cover RL, Scratch(es), Replace 44,52



Rubber seal for boot lid, Broken, Replace 63,69



Boot door panel RR, Dent(s) and scratch(es), Repair and paint (complete) 494,10



Boot door panel RL, Dent(s) and scratch(es), Repair and paint (complete)	494,10
--	--------



Supplementary brake light, Broken, Replace	112,20
--	--------




Bumper R, Scratch(es), Repair and paint (complete)	216,80
--	--------



Wheel cover RR, Scratch(es), Replace	44,52
--------------------------------------	-------



Wing RR, Dent(s) and scratch(es), Repair and paint (complete)	315,48
---	--------

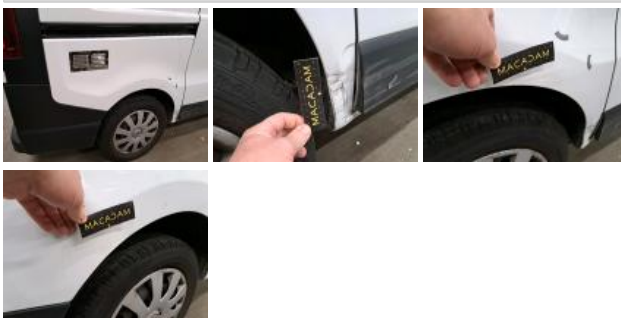

Door trim RR, Scratch(es), Replace	151,04
------------------------------------	--------



Door RR, Dent(s) and scratch(es), Repair and paint (complete)

325,87



A-pillar right, Scratch(es), Acceptable

0,00



Wheel cover FR, Scratch(es), Replace

44,52

