



RENAULT KANGOO VU
KANGOO EXPRESS L1 1.5 DCI 90 ECO2
GRAND CONFORT EURO 5

VIN NO VF1FW15B547798693

Registration Number CQ591ZA



MOT Date



Last Service



Number of Owners



Last Service Mileage



Number of Keys



First Registration Date



Odometer Reading



Country First Registered



Inspection Report Summary

Customer	BCAuto Encheres	Report Number	P20250913085437
Inspection Date / Place	2025-09-13 / BCA ROPPE	Cosmetic Grade	5

Vehicle Summary

Vehicle Condition	Non-Runner	VAT Type	Exempt Rate
Fuel Type	Diesel	Gearbox Type	Manual
Colour	White	Engine Size (cc)	1461
Engine Size	1.5	No of Doors	5
Body Type	Box Wagon	Drive Train	Front
Seat Colour		No of Seats	2
Charging Cables		NEDC CO2 Rating (q/km)	129

Vehicle History & Documents

Service Book Available	Present	Next Service Mileage	km
Previous Usage	Normal Use	Imported	No
Manufacturer Warrenty			





Equipment


Central locking	Rear parking sensors	Power assisted steering	Radio
Cruise control			

Equipment Details


Seat Heating	No	Air Conditioning	Yes
--------------	----	------------------	-----

Cosmetic Damage

35 Dommages

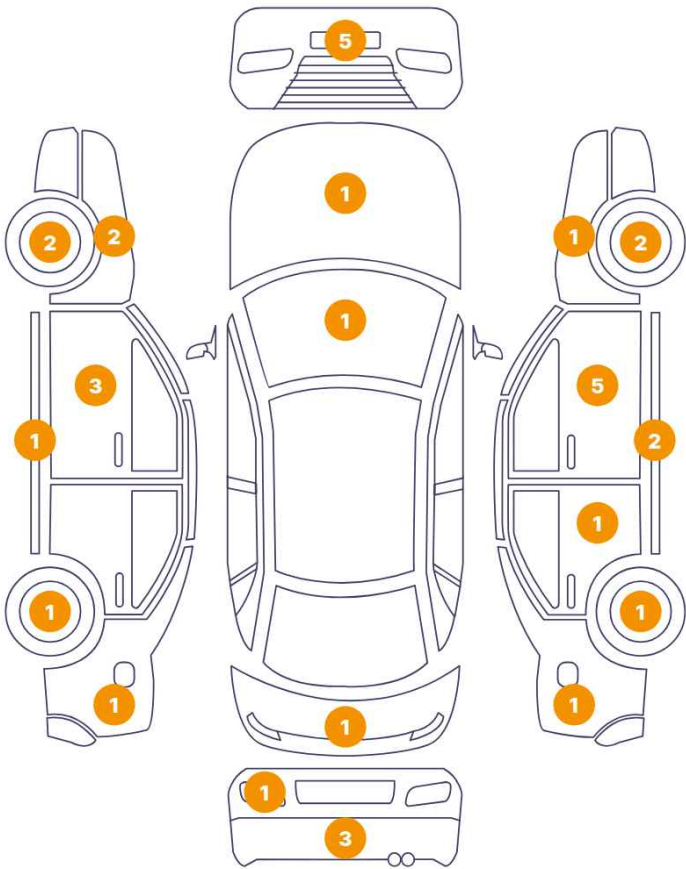

25 Dommages

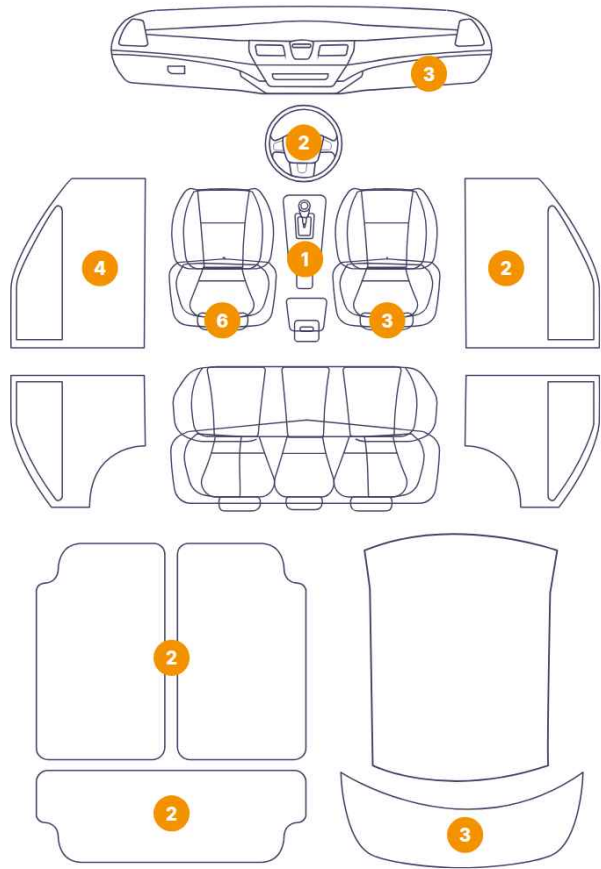

Component		Damage	Comments
1	Panel Filling / Front Left	Interior / Scraped	
2	Panel Filling / Front Left	Interior / Dirty	
3	Floor Carpet	Interior / Dirty	
4	Door Step / Front Left	Interior / Worn - out	
5	Door Step / Front Left	Interior / Dirty	
6	Seat Cushion / Front Left	Interior / Ripped	
7	Seat Cushion / Front Left	Interior / Holed	
8	Seat Cushion / Front Left	Interior / Stained	
9	Backrest Cover / Front Left	Interior / Holed	
10	Backrest Cover / Front Left	Interior / Ripped	
11	Backrest Cover / Front Left	Interior / Dirty	
12	Steering Wheel / Front	Interior / Worn - out	

13	Steering Wheel / Front	Interior / Dirty
14	Center Console	Interior / Dirty
15	Trunk Carpet	Interior / Holed
16	Trunk Carpet	Interior / Dirty
17	Trunk Upholstery / Back	Interior / Broken
18	Trunk Upholstery / Back	Interior / Broken
19	Other	Interior / Missing
20	Panel Filling / Front Right	Interior / Scraped
21	Panel Filling / Front Right	Interior / Dirty
22	Floor Carpet	Interior / Dirty
23	Seat Cushion / Front Right	Interior / Loose
24	Seat Cushion / Front Right	Interior / Stained
25	Backrest Cover / Front Right	Interior / Dirty
26	Dashboard / Front	Interior / Scraped
27	Dashboard / Front	Interior / Dirty
28	Gear Knob	Interior / Ripped
29	Windshield / Front	Glass Break
30	Bumper / Front	Paint / Scratch / Line
31	Bumper / Front	Paint / Chipping
32	Bumper / Front	Paint / Chipping
33	Hood	Paint / Chipping
34	Corner Bumper / Front Left	Paint / Scratch / Line
35	Hubcap / Front Left	Out of Bodywork / Scratch
36	Wheel Arch / Front Left	Bodywork / Breakage
37	Fender / Front Left	Paint / Chipping
38	Fender / Front Left	Paint / Chipping
39	Mirror Shell / Front Left	Missing Part
40	Rocker Panel / Center Left	Bodywork / Dent / Deformation
41	Door / Front Left	Bodywork / Dent / Deformation

42	Door / Front Left	Paint / Scratch / Line
43	Side Panel / Back Left	Bodywork / Dent / Deformation
44	Hubcap / Back Left	Missing element hubcap
45	Back Light / Left	Glass Break
46	Tailgate	Bodywork / Dent / Deformation
47	Bumper / Back	Missing Part
48	Bumper / Back	Paint / Scratch / Line
49	Side Panel / Back Right	Bodywork / Dent / Deformation
50	Corner Bumper / Back Right	Bodywork / Dent / Deformation
51	Hubcap / Back Right	Out of Bodywork / Scratch
52	Door / Back Right	Paint / Scratch / Line
53	Rocker Panel / Center Right	Paint / Chipping
54	Rocker Panel / Center Right	Bodywork / Dent / Deformation
55	Door / Front Right	Bodywork / Dent / Deformation
56	Door / Front Right	Bodywork / Dent / Deformation
57	Door / Front Right	Paint / Scratch / Line
58	Mirror Shell / Front Right	Bodywork / Breakage
59	Fender / Front Right	Paint / Scratch / Line
60	Corner Bumper / Front Right	Bodywork / Dent / Deformation
61	Rim / Front Right	Paint / Corrosion
62	Hubcap / Front Right	Missing element hubcap
63	Pillar / Front Right	Paint / Scratch / Line
64	Trunk Upholstery / Back	Interior / Broken



1. Panel Filling / Front Left
Interior / Scraped -



2. Panel Filling / Front Left
Interior / Dirty -



3. Floor Carpet
Interior / Dirty -




4. Door Step / Front Left
Interior / Worn - out -



5. Door Step / Front Left
Interior / Dirty -




6. Seat Cushion / Front Left
Interior / Ripped -

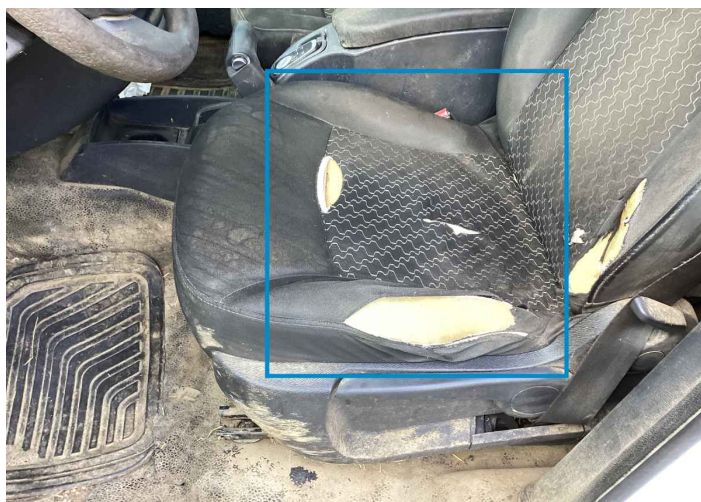


7. Seat Cushion / Front Left
Interior / Holed -



8. Seat Cushion / Front Left
Interior / Stained -

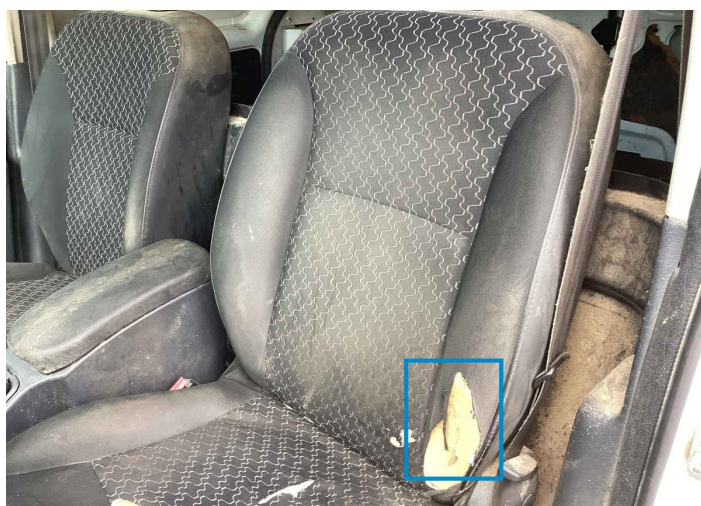

9. Backrest Cover / Front Left
Interior / Holed -

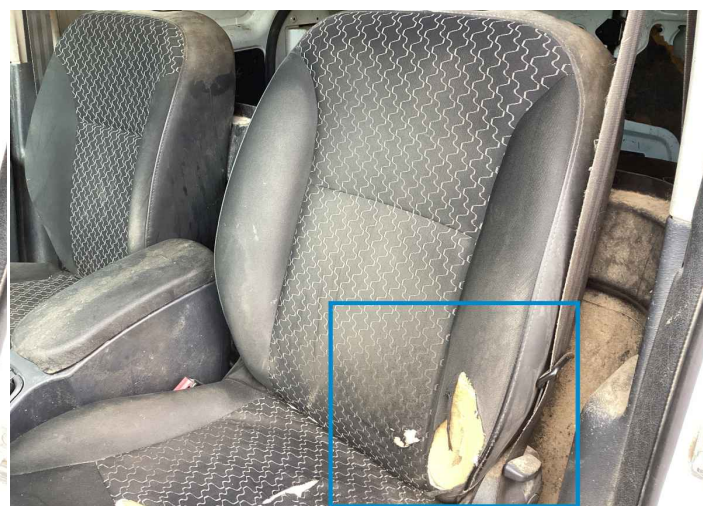

10. Backrest Cover / Front Left
Interior / Ripped -




11. Backrest Cover / Front Left
Interior / Dirty -



12. Steering Wheel / Front
Interior / Worn - out -




13. Steering Wheel / Front
Interior / Dirty -

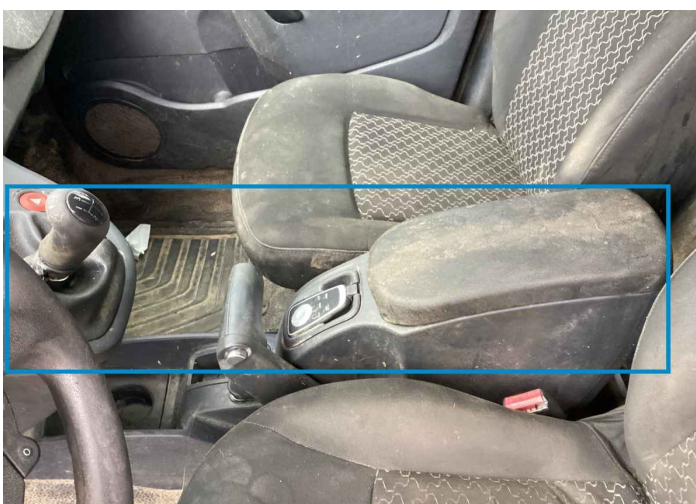

14. Center Console
Interior / Dirty -



15. Trunk Carpet
Interior / Holed -

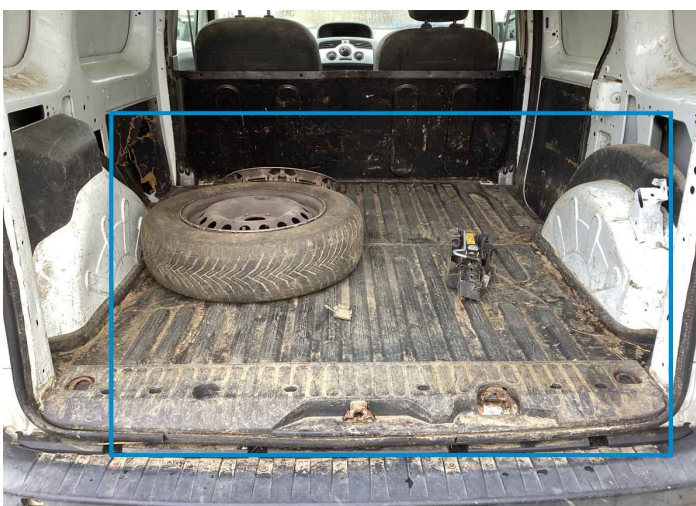

16. Trunk Carpet
Interior / Dirty -



17. Trunk Upholstery / Back
Interior / Broken -



18. Trunk Upholstery / Back
Interior / Broken -



19.
Interior / Missing -




20. Panel Filling / Front Right
Interior / Scraped -



21. Panel Filling / Front Right
Interior / Dirty -




22. Floor Carpet
Interior / Dirty -

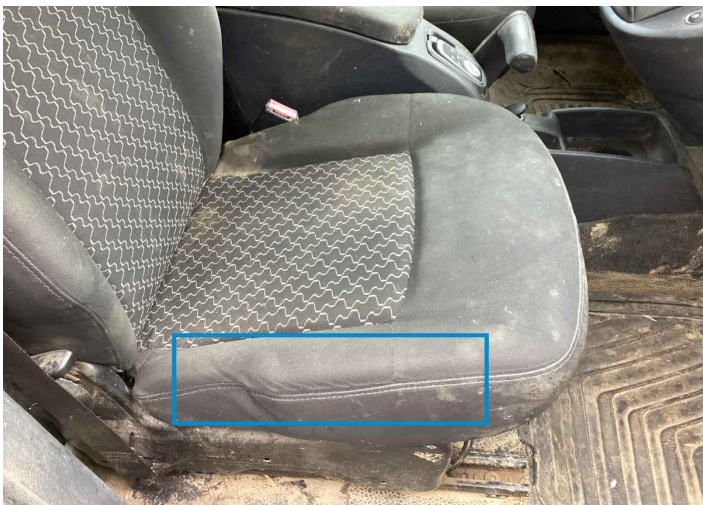

23. Seat Cushion / Front Right
Interior / Loose -



24. Seat Cushion / Front Right
Interior / Stained -

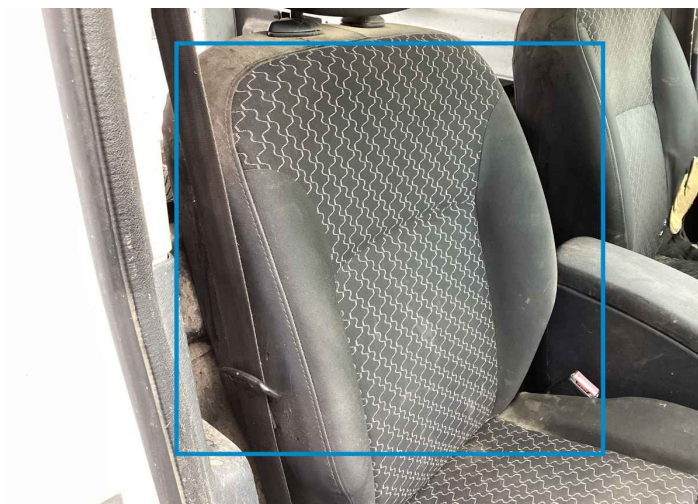


25. Backrest Cover / Front Right
Interior / Dirty -



26. Dashboard / Front
Interior / Scraped -



27. Dashboard / Front
Interior / Dirty -

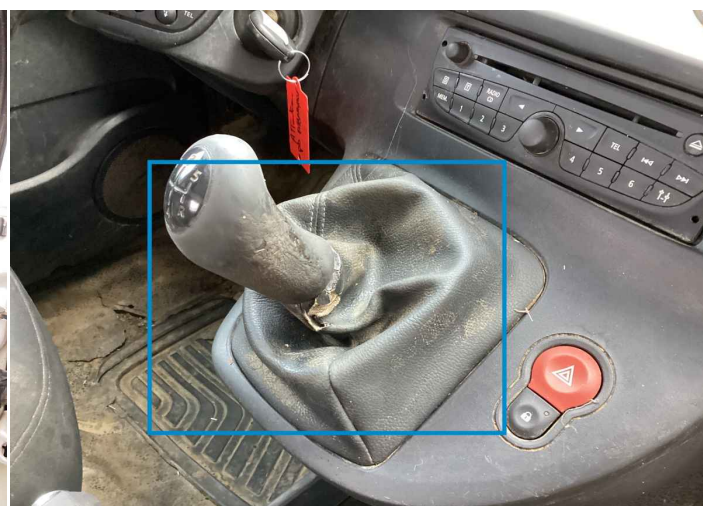

28. Gear Knob
Interior / Ripped -



29. Windshield / Front
Glass Break -



30. Bumper / Front
Paint / Scratch / Line -



31. Bumper / Front
Paint / Chipping -



32. Bumper / Front
Paint / Chipping -



33. Hood
Paint / Chipping -



34. Corner Bumper / Front Left
Paint / Scratch / Line -



35. Hubcap / Front Left
Out of Bodywork / Scratch -



36. Wheel Arch / Front Left
Bodywork / Breakage -



37. Fender / Front Left
Paint / Chipping -




38. Fender / Front Left
Paint / Chipping -



39. Mirror Shell / Front Left
Missing Part -



40. Rocker Panel / Center Left
Bodywork / Dent / Deformation -

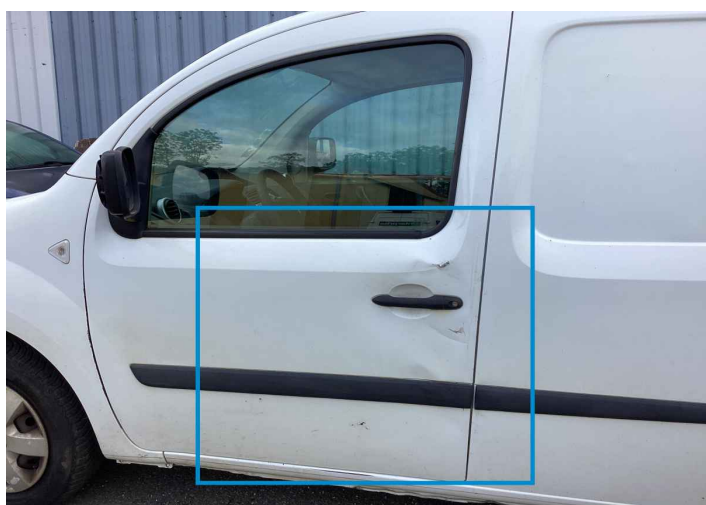

41. Door / Front Left
Bodywork / Dent / Deformation -



42. Door / Front Left
Paint / Scratch / Line -



43. Side Panel / Back Left
Bodywork / Dent / Deformation -



44. Hubcap / Back Left
Missing element hubcap -



45. Back Light / Left
Glass Break -



46. Tailgate
Bodywork / Dent / Deformation -



47. Bumper / Back
Missing Part -



48. Bumper / Back
Paint / Scratch / Line -



49. Side Panel / Back Right
Bodywork / Dent / Deformation -



50. Corner Bumper / Back Right
Bodywork / Dent / Deformation -



51. Hubcap / Back Right
Out of Bodywork / Scratch -



52. Door / Back Right
Paint / Scratch / Line -




53. Rocker Panel / Center Right
Paint / Chipping -



54. Rocker Panel / Center Right
Bodywork / Dent / Deformation -



55. Door / Front Right
Bodywork / Dent / Deformation -

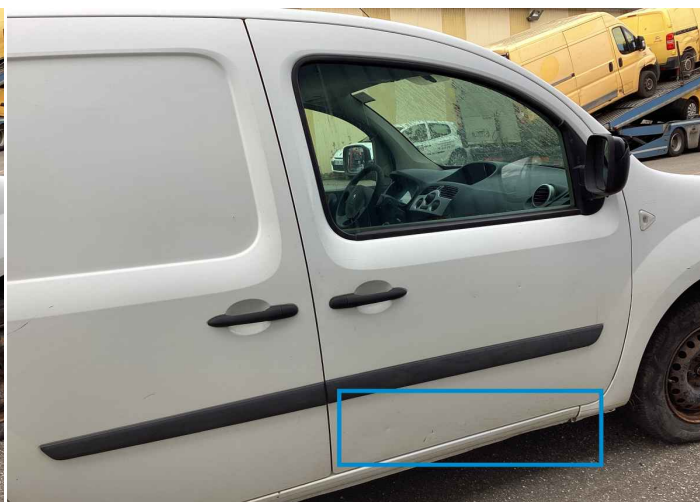

56. Door / Front Right
Bodywork / Dent / Deformation -



57. Door / Front Right
Paint / Scratch / Line -



58. Mirror Shell / Front Right
Bodywork / Breakage -



59. Fender / Front Right
Paint / Scratch / Line -




60. Corner Bumper / Front Right
Bodywork / Dent / Deformation -



61. Rim / Front Right
Paint / Corrosion -



62. Hubcap / Front Right
Missing element hubcap -

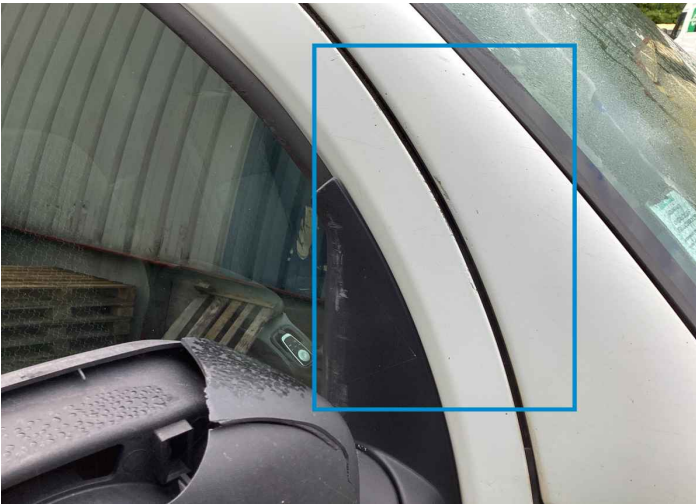

63. Pillar / Front Right
Paint / Scratch / Line -



64. Trunk Upholstery / Back
Interior / Broken -

Mechanical Condition

Tyres

Presence Anti-Theft Lock Nut 

 *No troubles detected, good condition or correct tests, according to vehicle age and mileage*

 *Damages or malfunction detected that requires repairs by the buyer*

 *Not applicable*

 *Not tested*

Disclaimer Section

The test drive is done on a flat surface and lasts about 2 minutes. The driven distance is a minimum of 300 meters, including a u-turn, an acceleration and a braking phase. The highest speed achieved during this test is 50km/h. The mechanical check is a visual and dynamic diagnosis without any disassembly. We cannot guarantee any mechanical wear part.