

# Renault

CLIO TCE 90 FR TECHNO

VIN: VF1RJA00772920506



## Description

<b>Registration number</b> GX-951-AQ	<b>Registration date</b> 22/05/2024	<b>Odometer</b> 55943 km
<b>Color</b> Grey	<b>Year</b> -	<b>Upholstery</b> -
<b>Number of doors</b> -	<b>Number of seats</b> -	<b>Generation</b> -
<b>Body Type</b> Hatchback	<b>Vehicle Type</b> Passenger car	<b>Engine type</b> Combustion
<b>Fuel Type</b> Petrol	<b>Max power</b> 91 HP	

## Vehicle Equipments

Rear-view camera	Climate control	Alloy wheel rims
Rear sensors	Cruise control	SATNAV

## Statement details

<b>Inspection loc</b> EUROPCAR LYON AEROPORT	<b>Statement date</b> 20/03/2026	<b>Inspection approval date</b> 23/03/2026
---	-------------------------------------	---

## Control

<b>Engine start issue</b> No	<b>Is not roadworthy</b> No
---------------------------------	--------------------------------

## Defects & corrections

#	Element	Defect	Correction
001	Compressor tyre repair kit / -	Missing	Replace



002 Rear parcel shelf retaining strap hook / Back Left Missing Replace



003 Rim / Back Right  
Material : Aluminium alloy / Rim/Tyre diameter : 16 " Scratched Painting



004 Rim / Front Right  
Material : Aluminium alloy / Rim/Tyre diameter : 16 " Scratched Painting



005 Bumper / Front Dent Repair









006 Bumper moulding / Front Dent Repair



007 Wing / Front Right Improper Repair Painting



008	Exterior door mirror shell / Left	Scratched	Acceptable
			
009	Door / Back Left	Dent	Smart repair
			
010	Roof post A/B/C / Left	Dent	Smart repair
			
011	Bumper / Back	Scratched	Painting
			
012	Wing / Back Right	Dent	Acceptable
			
013	Door / Back Right	Dent	Smart repair
			
014	Sill / Right	Dent	Repair



015

Door / Front Right

Improper Repair

Repair



016

Exterior door mirror shell / Right

Scratched

Replace



### Loose Items

- |   |  |   |
|---|--|---|
| <input type="checkbox"/> Slow charging cable (Type 2, Mode 2) | <input type="checkbox"/> Quick charging cable (Type 2, Mode 3) | <input type="checkbox"/> Load cover             |
| <input checked="" type="checkbox"/> Warranty booklet          | <input type="checkbox"/> Memory card                           | <input type="checkbox"/> Locking wheel nut      |
| <input checked="" type="checkbox"/> Remote key                | <input type="checkbox"/> Compressor tyre repair kit            | <input type="checkbox"/> Jack                   |
| <input type="checkbox"/> Cargo net                            | <input type="checkbox"/> Separation net                        | <input checked="" type="checkbox"/> User manual |
| <input checked="" type="checkbox"/> Rear parcel shelf         | <input checked="" type="checkbox"/> Refill tyre repair kit     | <input type="checkbox"/> Spare wheel tyre       |

### Main set of tyres

<b>Front Left</b>	TIGAR	195 / 55 / 16 / Summer	5.5 mm
<b>Front Right</b>	TIGAR	195 / 55 / 16 / Summer	5.5 mm
<b>Back Left</b>	CONTINENTAL	195 / 55 / 16 / Summer	5 mm
<b>Back Right</b>	CONTINENTAL	195 / 55 / 16 / Summer	4.8 mm

Pictures



Front left



Rear



Boot opened



Rear right



Dashboard from rear seat



Front passenger compartment




Odometer



Navigation



Spare Tyre

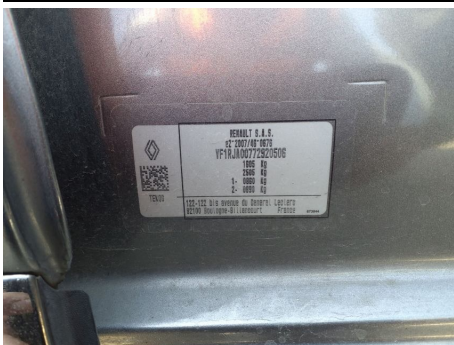

Vin



Other



Compressor tyre repair kit / - / Missing



Rear parcel shelf retaining strap hook / Back Left / Missing



Rim / Back Right / Scratched



Rim / Back Right / Scratched



Rim / Front Right / Scratched



Rim / Front Right / Scratched



Bumper / Front / Dent



Bumper / Front / Dent



Bumper moulding / Front / Dent



Bumper moulding / Front / Dent



Wing / Front Right / Improper Repair




Wing / Front Right / Improper Repair



Exterior door mirror shell / Left / Scratched



Exterior door mirror shell / Left / Scratched

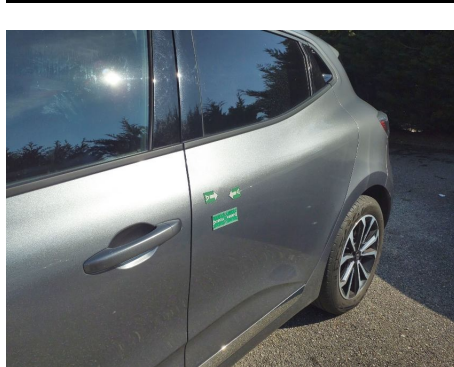

Door / Back Left / Dent



Door / Back Left / Dent

