

Renault

CAPTUR TCE 90 FR TECHNO

VIN: VF1RJB00972854711



Description

Registration number GW-974-KS	Registration date 17/04/2024	Odometer 66830 km
Color Blue	Year -	Upholstery -
Number of doors -	Number of seats -	Generation -
Body Type Sport Utility Vehicule	Vehicle Type Passenger car	Engine type Combustion
Fuel Type Petrol	Max power 90 HP	

Vehicle Equipments

Rear-view camera	Climate control	Alloy wheel rims
Rear sensors	Front sensors	Cruise control
SATNAV		

Statement details

Inspection loc EUROPCAR LYON AEROPORT	Statement date 12/03/2026	Inspection approval date 13/03/2026
---	-------------------------------------	---

Control

Engine start issue No	Is not roadworthy No
---------------------------------	--------------------------------

Defects & corrections

#	Element	Defect	Correction
001	Tyre / Front Left Rim/Tyre diameter : 18 "	Worn Out	Replace



002

Bumper / Front

Dent

Repair



003

Door / Front Left

Dent

Acceptable



004

Bumper / Back Right

Scatched

Painting



005

Spoiler / Back

Dent

Repair




006

Wiper blade cover / Back

Missing

Replace

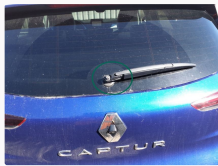

007

Wing extension moulding / Back Right

Scatched

Painting



008	Door / Back Right	Dent	Smart repair
009	Door sill / Back Right	Dent	Repair

Loose Items

- | | | |
|---|---|--|
| <input type="checkbox"/> Slow charging cable | <input type="checkbox"/> Quick charging cable | <input type="checkbox"/> Load cover |
| <input checked="" type="checkbox"/> Warranty booklet | <input type="checkbox"/> Memory card | <input type="checkbox"/> Locking wheel nut |
| <input checked="" type="checkbox"/> Remote key | <input type="checkbox"/> Compressor tyre repair kit | <input checked="" type="checkbox"/> Jack |
| <input type="checkbox"/> Cargo net | <input type="checkbox"/> Separation net | <input checked="" type="checkbox"/> User manual |
| <input checked="" type="checkbox"/> Rear parcel shelf | <input type="checkbox"/> Refill tyre repair kit | <input checked="" type="checkbox"/> Spare wheel tyre |

Main set of tyres

Front Left	GOODYEAR	215 / 55 / 18 / Summer	2.4 mm
Front Right	GOODYEAR	215 / 55 / 18 / Summer	3 mm
Back Left	GOODYEAR	215 / 55 / 18 / Summer	5 mm
Back Right	GOODYEAR	215 / 55 / 18 / Summer	4.3 mm
Back		///	7 mm

Pictures



Front left



Rear



Boot opened



Rear right




Dashboard from rear seat



Front passenger compartment



Odometer

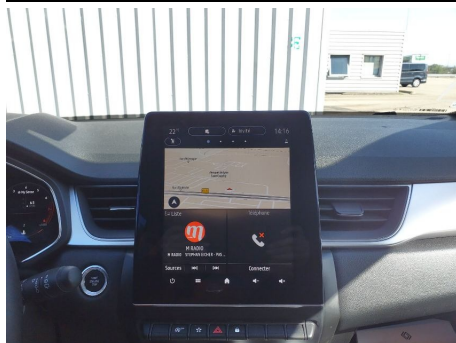

Navigation



Spare Tyre



Vin



Other



Tyre / Front Left / Worn Out



Bumper / Front / Dent



Bumper / Front / Dent



Door / Front Left / Dent



Door / Front Left / Dent



Bumper / Back Right / Scratched




Bumper / Back Right / Scratched



Spoiler / Back / Dent



Spoiler / Back / Dent

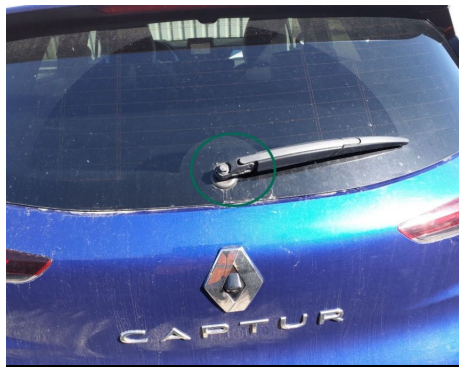

Wiper blade cover / Back / Missing



Wing extension moulding / Back Right / Scratched



Wing extension moulding / Back Right / Scratched



Door / Back Right / Dent



Door / Back Right / Dent



Door sill / Back Right / Dent



Door sill / Back Right / Dent

