



Renault Koleos: 2BAB286

Vinnumber:	VF1RZG00867361142	Versionname:	Koleos Initiale Paris 2.0dCi 190pk/cv 5p X-Tronic
First Registrationdate:	3/09/2021	Fiscalpower:	
Expertise Mileage:	179698	Power Kw:	135
Bodytype:		Type of rims (mounted)	Aluminium
Gearbox:	Automatic		
Transmission:			
Fueltype:			
Maintenance	NOT OK		
Maintenance	uitvoeren		
Battery functioning	Yes		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Luggage cover	
GPS		Type of Tow bar	Tow bar removable
Type of Maintenance book	Digital maintenance		
Type of GPS storage	HD		

Tyres

	225/55/19/103 Y			
Summer tyres:	Fr.L.	Hankook: 4 mm	Fr.R.	Hankook: 3 mm
	Re.L.	Continental: 3 mm	Re.R.	Continental: 2 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				3.0
Tyre profile depth RL				3.0
Tyre profile depth RR				2.0
Tyre size FL				225/55 R 19 103 Y
Tyre size FR				225/55 R 19 103 V
Tyre size RL				225/55 R 19 103 V
Tyre size RR				225/55 R 19 103 V
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				260
Tyre make FR				260
Tyre make RL				256
Tyre make RR				256

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Service, Maintenance, Check



Bumper grille, Broken, Replace



Bumper moulding F, Broken, Replace



Bumper F, Broken, Replace and paint




Windscreen, Stone chip(s), Windscreen repair




Wing trim FL, Missing, Replace



Wheel arch cover FL, Missing, Replace

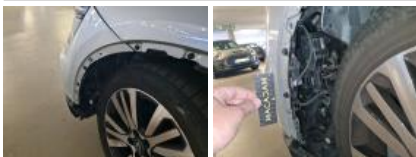

Outside rear-view mirror base L, Broken, Replace

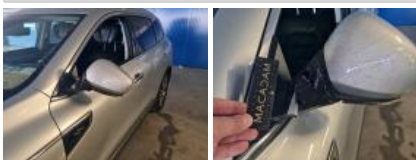

A-pillar left, Dent(s), Acceptable



Door FL, Dent(s) and scratch(es), Repair and paint (complete)



Sill trim L, Missing, Replace




Tailgate / Boot, Dent(s), Acceptable



Bumper R, Scratch(es), Repair and paint (complete)



Bumper moulding R, Scratch(es), Replace

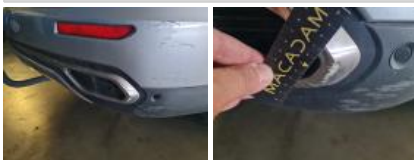


Bumper trim R, Scratch(es), Replace



Alloy rim RR polished, Chemical polution, Repair and paint (complete)



Alloy rim FR polished, Scratch(es), Repair and paint (complete)

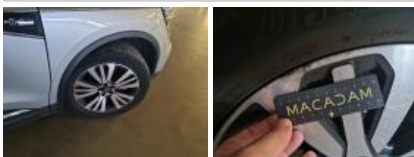

Wing trim FR, Broken, Replace



Bodywork, Accident, Check

