



Peugeot 308 (UKL): 1YPK411

Vinnumber:	VF3LCYHYPLS239541	Versionname:	308 SW Active 1.5BlueHDI S&S 100pk/cv 5p
First Registrationdate:	27/10/2020	Fiscalpower:	
Expertise Mileage:	163431	Power Kw:	75
Bodytype:		Type of rims (mounted)	Aluminium
Gearbox:	MAN 6 VIT		
Transmission:			
Fueltype:			
Maintenance	NOT OK		
Battery functioning	Yes		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Luggage cover	
GPS		Type of Tow bar	No Tow bar
Type of Maintenance book	Digital maintenance		
Type of GPS storage	HD		


Tyres

	205/55/16/91 V			
Summer tyres:	Fr.L.	Uniroyal: 6 mm	Fr.R.	Uniroyal: 6 mm
	Re.L.	Nexen: 4 mm	Re.R.	Nexen: 4 mm
Tyre profile depth FL				6.0
Tyre profile depth FR				6.0
Tyre profile depth RL				4.0
Tyre profile depth RR				4.0
Tyre size FL				205/55 R 16 91 V
Tyre size FR				205/55 R 16 91 V
Tyre size RL				205/55 R 16 91 V
Tyre size RR				205/55 R 16 91 V
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				265
Tyre make FR				265
Tyre make RL				1957072
Tyre make RR				1957072

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Roof liner, Stain, Acceptable

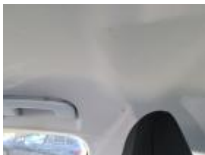



Seat cover FR, Stain, Acceptable



Door panel RR, Scratch(es), Smart repair



Seat cover FL, Stain, Acceptable



Door panel RR, Scratch(es), Repair/replace (lump sum)



Service, Maintenance, Check



Steering wheel, Worn, Acceptable



Floor covering FL, Missing, Check



Floor covering R, Missing, Check



Seat cover R, Stain, Acceptable



Door panel FR, Scratch(es), Acceptable



Bumper F, Scratch(es), Repair and paint (complete)



Bonnet, Scratch(es), Repair and paint (complete)



Bumper grille, Scratch(es), Acceptable



Outer sill L, Dent(s) and scratch(es), Repair and paint (complete)



Door FL, Dent(s), Paintless dent repair



Alloy rim FL, Scratch(es), Repair and paint (complete)



Door FL, Scratch(es), Acceptable



Alloy rim RL, Scratch(es), Acceptable



Door RL, Dent(s), Acceptable



Outside rear-view mirror housing L, Scratch(es), Acceptable



Step L, Scratch(es), Acceptable



Step L, Dent(s), Acceptable



Door FL, Repaired, Check



Door RL, Repaired, Check



Wing RL, Scratch(es), Acceptable



Tyre RL, Tear, Replace



Tyre FL, Tear, Replace



Internal boot lining L, Scratch(es), Acceptable



Boot lid covering R, Scratch(es), Acceptable



Bumper R, Scratch(es), Repair and paint (complete)



Tailgate / Boot, Scratch(es), Acceptable



Rear window, Scratch(es), Check



Wing RR, Dent(s) and scratch(es), Repair and paint (complete)



Door RR, Dent(s) and scratch(es), Acceptable



Alloy rim FR, Scratch(es), Repair and paint (complete)



Step R, Scratch(es), Acceptable



Alloy rim RR, Scratch(es), Repair and paint (complete)



Door FR, Repaired, Check



Outer door handle FR, Scratch(es), Acceptable



Tyre FR, Tear, Replace



Tyre RR, Tear, Replace



Roof, Dent(s) and scratch(es), Acceptable

