



Peugeot 308 (UKL): 1YWA896

Vinnumber:	VF3LCYHJZLS311589	Versionname:	308 SW Business 1.5BlueHDi S&S 130pk/cv 5p
First Registrationdate:	7/01/2021	Fiscalpower:	
Expertise Mileage:	121886	Power Kw:	96
Bodytype:		Type of rims (mounted)	Aluminium
Gearbox:	MAN 6 VIT		
Transmission:			
Fueltype:			
Maintenance	OK		
Maintenance	+13900 km		
Battery functioning	Yes		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Luggage cover	
GPS		Type of Tow bar	No Tow bar
Type of Maintenance book	Maintenancebook present		
Type of GPS storage	HD		

Tyres

205/55/16/91 V				
Summer tyres:	Fr.L.	Fulda: 4 mm	Fr.R.	Fulda: 4 mm
	Re.L.	Fulda: 6 mm	Re.R.	Fulda: 6 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				6.0
Tyre profile depth RR				6.0
Tyre size FL				205/55 R 16 91 V
Tyre size FR				205/55 R 16 91 V
Tyre size RL				205/55 R 16 91 V
Tyre size RR				205/55 R 16 91 V
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				2484
Tyre make FR				2484
Tyre make RL				2484
Tyre make RR				2484

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Door panel RR, Scratch(es), Acceptable



Floor covering FL, Worn, Check



Roof liner, Burned, Smart repair



Interior covering A pillar L, Burned, Smart repair



Door panel FR, Burned, Smart repair




Bumper F, Dent(s) and scratch(es), Acceptable




Bonnet, Bad repair, Repair and paint (complete)



Wing RL, Dent(s), Repair and paint (complete)

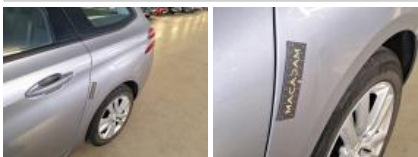

Alloy rim RL, Scratch(es), Acceptable

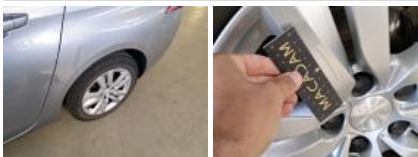

Door FL, Scratch(es), Acceptable



Alloy rim FL, Scratch(es), Repair and paint (complete)



Boot lid covering R, Scratch(es), Smart repair



Bumper R, Scratch(es), Repair and paint (complete)



Outer sill R, Dent(s) and scratch(es), Spot repair



Alloy rim FR, Scratch(es), Repair and paint (complete)



Alloy rim RR, Scratch(es), Acceptable



Wing RR, Bad repair, Repair and paint (complete)



Outside rear-view mirror housing R, Scratch(es), Acceptable

