



## PEUGEOT 308 SW: 1YPZ578

Vinnnumber:	<b>VF3LCYHZKLS253390</b>	Versionname:	<b>1.5 BlueHDi 130 S&amp;S EAT8 Allure Pack</b>
First Registrationdate:	<b>30/10/2020</b>	Fiscalpower:	
Expertise Mileage:	<b>106537</b>	Power Kw:	<b>96</b>
Bodytype:		Parking lot	<b>3523</b>
Gearbox:	<b>Automatic</b>	Type of rims (mounted)	<b>Aluminium</b>
Transmission:		Body colour	<b>Grey</b>
Fueltype:	<b>Diesel</b>		
Certificate of Conformity	<b>Yes</b>		
Type of rims (mounted)	<b>Aluminium</b>		
Category	<b>Passenger Car</b>		
Registration Certificate Home (BE)	<b>No</b>		
Registration Certificate Car (BE)	<b>Yes</b>		

## Options

Radio multimedia		Luggage cover	
Steering wheel multifunctional		Rear parking sensors	
Seats F heated		Front parking sensors	
Type of GPS	<b>GPS big screen color</b>	Type of Tow bar	<b>No Tow bar</b>
Cruise Control			
Type of climate control	<b>Autom climate control</b>		
Number of keys total	<b>2</b>		
Type of headlighting	<b>Headlighting LED</b>		
Type of Lining	<b>Lining fabrics</b>		

## Limited Technical Inspection

## Tyres

Tyre size RL	<b>205/55 R 16 91 H</b>
Tyre type FL	<b>Winter</b>
Tyre type RL	<b>Winter</b>
Tyre profile depth FR	<b>3.0</b>
Tyre profile depth RR	<b>3.0</b>
Tyre make FR	<b>261</b>
Tyre size FR	<b>205/55 R 16 91 H</b>
Tyre make RR	<b>261</b>
Tyre size RR	<b>205/55 R 16 91 H</b>

**205/55/16/91 H**

Winter tyres:	Fr.L.	<b>Michelin: 3 mm</b>	Fr.R.	<b>Michelin: 3 mm</b>
	Re.L.	<b>Michelin: 3 mm</b>	Re.R.	<b>Michelin: 3 mm</b>

Tyre profile depth FL	<b>3.0</b>
Tyre make FL	<b>261</b>
Tyre size FL	<b>205/55 R 16 91 H</b>
Tyre type FR	<b>Winter</b>
Tyre profile depth RL	<b>3.0</b>
Tyre type RR	<b>Winter</b>
Tyre make RL	<b>261</b>

## Assistance equipment

Number of charging cables (normal)	<b>0</b>	Compressor	<b>Yes</b>
Number of charging cables (rapid charge)	<b>0</b>		
Repair kit	<b>Yes</b>		

Total cost ex VAT	<b>992,81</b>
Interior, Worn, Acceptable	<b>0,00</b>



Bumper F, Scratch(es), Acceptable 0,00



Windscreen, Stone chip(s), Replace 673,46



Alloy rim FL polished, Scratch(es), Repair and paint (complete) 199,04



Outside rear-view mirror housing L, Scratch(es), Acceptable 0,00



Boot carpet, Scratch(es), Acceptable 0,00



Bumper R, Scratch(es), Acceptable 0,00



Tailgate / Boot, Scratch(es), Acceptable 0,00



Alloy rim RR polished, Scratch(es), Acceptable 0,00



Door RR, Scratch(es), Acceptable 0,00




Alloy rim FR polished, Scratch(es), Acceptable 0,00



Bodywork, Not original part, Remove lettering 0,00



Roof, Dent(s), Paintless dent repair 93,06

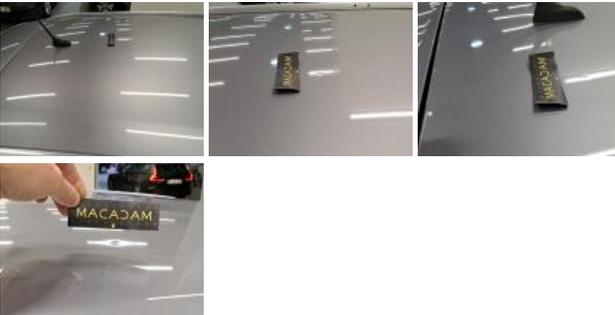

Aerial, Damaged, Replace 27,25

