


Vehicle details

VIN	VF3MRHNSU KS452154	Brand	PEUGEOT	Maintenance date	-
Licence Plate	J8-71-BD	Model	3008 Blue Lease Premium PureTech 130 EAT8 5d	Maintenance mileage	-
Registration date	27/08/2020	Year	2020	Exterior Color	White Solid
Odometer	156 378 km	Engine size	1199	interior Color	Black
Fuel	Petrol	Body Type	-	Next technical inspection	-
Seats	-	Transmission	Automatic	CO2	-
Doors	5	Gears	-		

Inspection Details

Inspection date	17/09/2025	Inspection loc.	Ayvens Veghel
-----------------	------------	-----------------	---------------

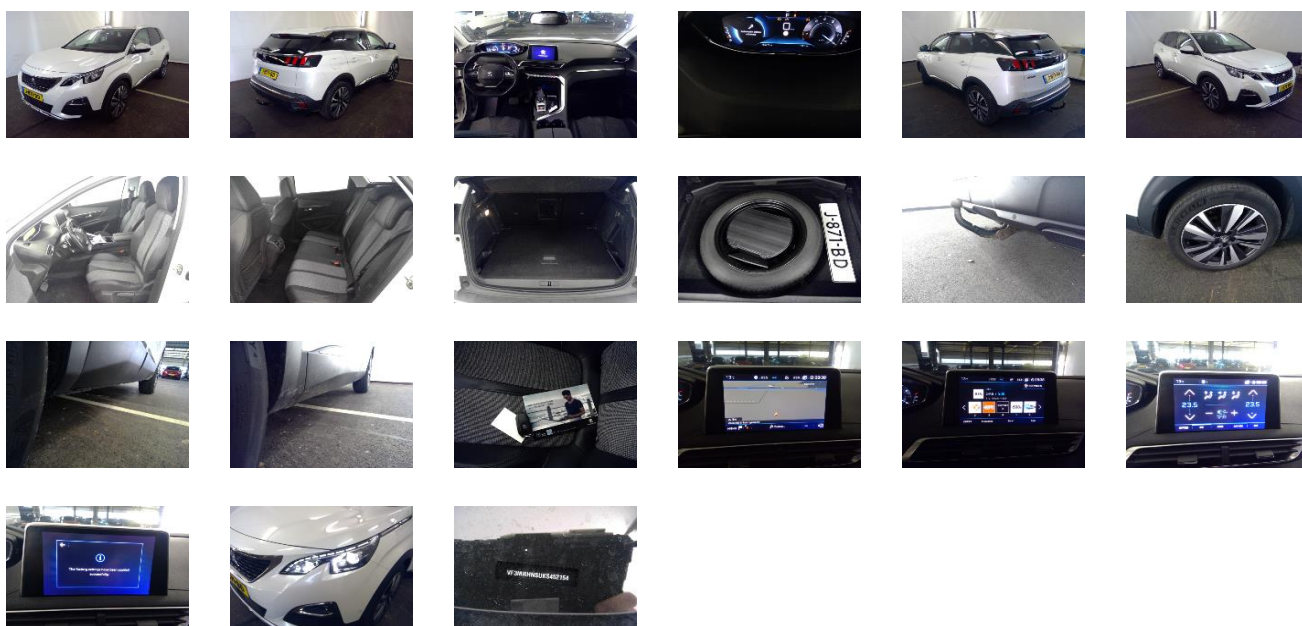

Generic equipment

Automated air-conditioning	✓
Cruise control	✓
GPS system	✓
Alloy wheel rims	✓
Automatic Gearbox	✓
Tow	✓
Central locking	✓
Electric windows	✓
Mixed upholstery	✓
Side rails	✓
Park Distance Control	✓
Audio System	✓
Led lighting	✓

Removable element


Spare wheel (wheel & tyre)	✓
Rear parcel shelf	✓

Technical Document

User manual	✓
Remote key	✓
Sat Nav CD ROM Software	✓
Spare key	✗

Tyres

Michelin 205/55/19 Summer 4.0 mm

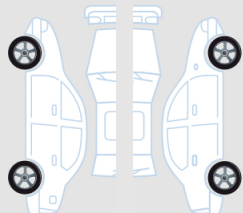

Michelin 205/55/19 Summer 4.0 mm



Michelin 205/55/19 Summer 4.0 mm

Michelin 205/55/19 Summer 4.0 mm


Exterior

2



Part Wing
Position Front left
Damages Dented
Severity Diameter (mm) > 20
Repair mode Smart Repair

3

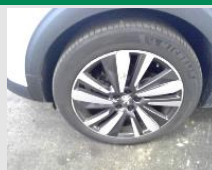

Part Alloy wheel 19"
Position Front left
Damages Scratched
Severity -
Repair mode Lumpsum repair

4



Part Step plate
Position Front left
Damages Scratched
Severity -
Repair mode For info

5




Part Wing moulding
Position Front left
Damages Scratched
Severity Length (cm) > 10
Repair mode Repair

6



Part Door
Position Back left
Damages Dented
Severity Diameter (mm) > 20
Repair mode Smart Repair

11

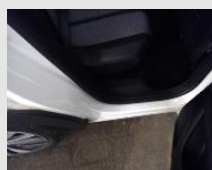

Part Step plate
Position Back right
Damages Dented
Severity -
Repair mode For info

12



Part Door
Position Front right
Damages Dent & Chips
Severity Diameter (mm) > 20
Repair mode Repair

13



Part Alloy wheel 19"
Position Front right
Damages Scratched
Severity -
Repair mode Lumpsum repair

14



Part Bumper
Position Front
Damages Scratched
Severity Length (cm) > 10
Repair mode Repair

15



Part Bumper moulding
Position Back
Damages Scratched
Severity Length (cm) > 10
Repair mode Repair

Interior damage

1



Part Spare key
Position -
Damages Missing
Severity -
Repair mode Replace

7



Part Interior tailgate lining
Position Up
Damages Scratched
Severity -
Repair mode Replace

8



Part	Boot carpet
Position	Down
Damages	Scratched
Severity	-
Repair mode	Replace

9



Part	Boot carpet
Position	Back left
Damages	Scratched
Severity	-
Repair mode	Replace

10



Part	Boot carpet
Position	Back right
Damages	Scratched
Severity	-
Repair mode	Replace