



Renault Trucks Master: VLV44S

Vinnumber:	VF6VF000X68214078	Versionname:	Master RT 3T5 2.3 dCi 110kW FWD L3H1 Red Edition Plancher automaat
First Registrationdate:	12/10/2021	Fiscalpower:	
Expertise Mileage:	200957	Power Kw:	110
Bodytype:		Body colour:	Gris Kempenners
Gearbox:	Automatic	Paint type:	Opaque
Transmission:	Front	Type of rims (mounted):	Steel
Fueltype:	Diesel	Parking lot:	1224
Number of seats:	2		
Type of rims (mounted):	Steel		
Maintenance needed:	Yes		

Options

Number of keys total	1	Central consol F
Manual climate control		Rear parking sensors
Windows electric F		Lining artificial leather

Tyres

Location	Position	Measures	Depth	Make	Type
Front	Left	225 / 65 / 16 / 112 / R / Steel	7,9 mm	Continental	Winter
	Right	225 / 65 / 16 / 112 / R / Steel	7,3 mm	Continental	Winter
Rear	Left	225 / 65 / 16 / 112 / R / Steel	10,2 mm	Hankook	Winter
	Right	225 / 65 / 16 / 112 / R / Steel	6,8 mm	Hankook	Winter

Assistance equipment

Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

Ignition key, Missing, Replace

No pictures to display

Seat cover FL, Worn, Replace



Backrest cover FL, Worn, Replace



Service, Maintenance, Execute



User's manual, Missing, Replace

No pictures to display

Centre console, Scratch(es), Replace



Inner door handle, Broken, Replace



Side bar L, Dent(s), Replace



Side wall RL, Crack, Repair and paint (complete)



Door FL, Dent(s) and scratch(es), Repair and paint (complete)



Outside rear-view mirror housing L, Scratch(es), Replace



Mirror side repeater L, Scratch(es), Replace



Outer sill L, Scratch(es), Repair and paint (complete)



Bumper F, Broken, Replace



Bumper grille, Deformed / Strained, Replace



Headlight R, Scratch(es), Replace



Bonnet, Dent(s) and scratch(es), Repair and paint (complete)



Wheel cover FR, Missing, Replace



Wing FR, Dent(s), Repair and paint (complete)




Outside rear-view mirror housing R, Broken, Replace



Mirror side repeater R, Crack, Replace



Door FR, Dent(s), Repair and paint (complete)

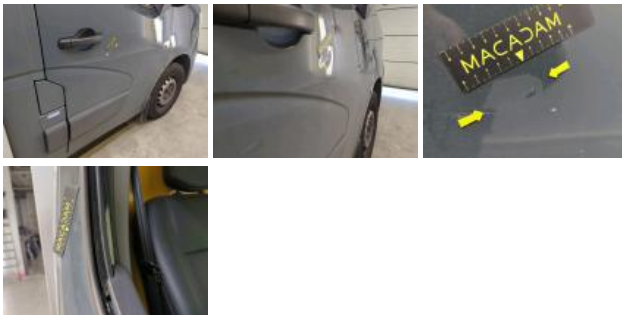

Central pillar R, Dent(s), Paintless dent repair



Side bar R, Dent(s), Replace



Side wall RR, Crack, Repair and paint (complete)




Reflector, Broken, Replace



Bumper corner RL, Deformed / Strained, Replace and paint



Bumper corner RR, Deformed / Strained, Replace and paint

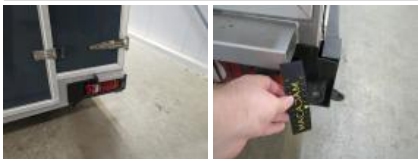


Reflector, Broken, Replace



Shutter / cover R, Deformed / Strained, Replace



Shutter / cover R, Deformed / Strained, Replace

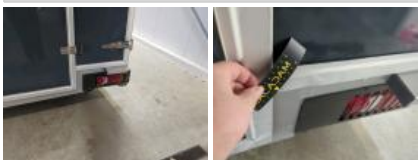

Boot door panel RL, Crack, Repair and paint (complete)



Boot door panel RR, Crack, Repair and paint (complete)

