



CITROËN GRAND C4 PICASSO: 1SXX789				
Vinnumber:	VF73ABHXTJ616905	Versionname:	1.6 BlueHDi 115 S&S EAT6 Business GPS	
First Registrationdate:	11/08/2017	Fiscalpower:		
Expertise Mileage:	143064	Power Kw:	85	
Bodytype:		Body colour	Burgundy	
Gearbox:	Automatic	Type of rims (mounted)	Aluminium	
Transmission:		Parking lot	2117	
Fueltype:	Diesel			
Type of rims (mounted)	Aluminium			
Certificate of Conformity	No			
Category	Passenger Car			
Registration Certificate Car (BE)	Yes			
Registration Certificate Home (BE)	No			
Options				
Number of keys total	2	Rear parking sensors		
Steering wheel multifunctional		Type of Tow bar	No Tow bar	
Radio multimedia				
Type of headlighting	Headlighting Halogen			
Type of GPS	GPS big screen color			
Type of Lining	Lining fabrics			
Type of climate control	Autom climate control			
Limited Technical Inspection				
Tyres				
Summer tyres:	205/60/16/92 H			
	Fr.L.	Uniroyal: 4 mm	Fr.R.	Uniroyal: 4 mm
	Re.L.	Uniroyal: 4 mm	Re.R.	Uniroyal: 4 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				4.0
Tyre profile depth RR				4.0
Tyre size FL				205/60 R 16 92 H
Tyre size FR				205/60 R 16 92 H
Tyre size RL				205/60 R 16 92 H
Tyre size RR				205/60 R 16 92 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				265
Tyre make FR				265
Tyre make RL				265
Tyre make RR				265
Assistance equipment				
Emergency spare wheel	Yes	Jack		Yes
Number of charging cables (normal)	0			
Number of charging cables (rapid charge)	0			
Total cost ex VAT				6885,55
Certificate Of Conformity, Missing, Replace				187,67



Interior, Dirty, Cleaning

170,61



Door panel RR, Scratch(es), Smart repair

113,74



Door panel RL, Scratch(es), Smart repair

113,74



Interior, Worn, Acceptable

0,00



Bumper F, Dent(s) and scratch(es), Repair and paint (complete)

289,07



Bonnet, Scratch(es), Polish	0,00
-----------------------------	------



Windscreen, Scratch(es), Replace	869,11
----------------------------------	--------




Wing RL, Scratch(es), Repair and paint (complete)	420,65
---	--------



Step L, Scratch(es), Acceptable	0,00
---------------------------------	------



Door FL, Scratch(es), Acceptable	0,00
----------------------------------	------

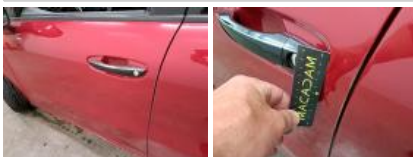

Alloy rim FL, Scratch(es), Acceptable	0,00
---------------------------------------	------



Door RL, Dent(s) and scratch(es), Acceptable	0,00
--	------



Luggage compartment cover, Missing, Replace	175,50
---	--------



Interior covering C pillar L, Scratch(es), Replace 63,93



Interior covering C pillar R, Scratch(es), Acceptable 0,00



Tailgate / Boot, Not original part, Forfeit 54,25



Bumper R, Dent(s) and scratch(es), Repair and paint (complete) 289,07



Rear window, Scratch(es), Replace 308,09




Rear light L, Waterinfiltration, Acceptable 0,00



Rear light R, Scratch(es), Replace 800,54



Alloy rim FR, Scratch(es), Repair and paint (complete)		129,66
  		
		
Wing FR, Dent(s) and scratch(es), Repair and paint (complete)		300,51
  		
		
Door RR, Dent(s) and scratch(es), Repair and paint (complete)		434,50
  		
		
Outer sill R, Dent(s) and scratch(es), Replace and paint		1942,19
 		
Alloy rim RR, Scratch(es), Repair and paint (complete)		129,66
  		
Wing RR, Dent(s), Paintless dent repair		93,06
 		
Roof, Scratch(es), Polish		0,00
  		