


Vehicle details

VIN	VF73AHNS2 MJ566355	Brand	Citroën	Maintenance date	-
Licence Plate	K9-76-SJ	Model	Grand C4 SpaceTourer PureTech 130 S;S Business 5d	Maintenance mileage	-
Registration date	19/03/2021	Year	2021	Exterior Color	Grey Metallic
Odometer	175 351 km	Engine size	1199	Interior Color	Grey
Fuel	Petrol	Body Type	-	Next technical inspection	-
Seats	-	Transmission	Manual	CO2	-
Doors	5	Gears	6		

Inspection Details

Inspection date	06/10/2025	Inspection loc.	Dekra Ayvens
-----------------	------------	-----------------	--------------

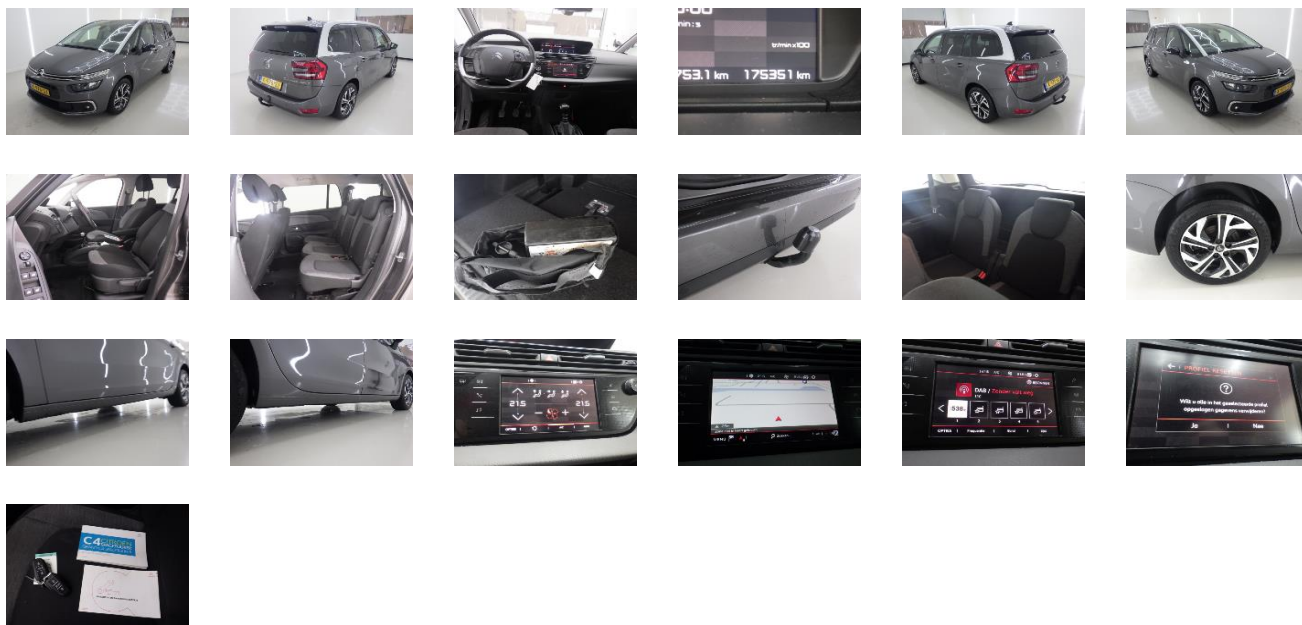

Generic equipment

Automated air-conditioning	✓
Cruise control	✓
GPS system	✓
7 seater	✓
Alloy wheel rims	✓
Tow	✓
Metallic paint	✓
Central locking	✓
Electric windows	✓
Side rails	✓
Park Distance Control	✓
Audio System	✓

Removable element


Spare wheel kit	✓
Load cover	✓

Technical Document

User manual	✓
Warranty booklet	✓
Spare key	✓
Remote key	✓
Sat Nav CD ROM Software	✓

Tyres

Continental 205/55/17 Summer 5.5 mm

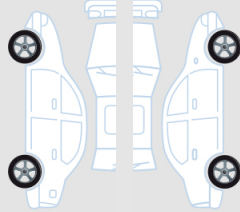


Continental 205/55/17 Summer 5.0 mm



Continental 205/55/17 Summer 6.0 mm



Continental 205/55/17 Summer 6.0 mm




Exterior

1



Part	Alloy wheel 17"
Position	Front left
Damages	Scratched
Severity	-
Repair mode	Lumpsum repair

3

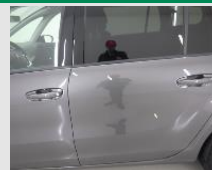

Part	Door
Position	Back left
Damages	Dented
Severity	Diameter (mm) > 20
Repair mode	Smart Repair

5



Part	Wing
Position	Back left
Damages	Scratched
Severity	-
Repair mode	Repair

6




Part	Alloy wheel 17"
Position	Back left
Damages	Scratched
Severity	-
Repair mode	Lumpsum repair

7



Part	Bumper
Position	Back
Damages	Scratched
Severity	-
Repair mode	Repair

8

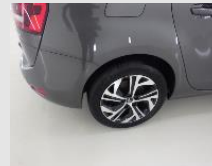

Part	Alloy wheel 17"
Position	Back right
Damages	Scratched
Severity	-
Repair mode	Lumpsum repair

9



Part	Door
Position	Back right
Damages	Dent & Chips
Severity	-
Repair mode	Repair

10



Part	Door
Position	Front right
Damages	Dented
Severity	Diameter (mm) > 20
Repair mode	Smart Repair

11



Part	Alloy wheel 17"
Position	Front right
Damages	Scratched
Severity	-
Repair mode	Lumpsum repair

12



Part	Bumper
Position	Front
Damages	Scratched
Severity	-
Repair mode	Repair

13



Part	Roof
Position	-
Damages	Dent & Chips
Severity	-
Repair mode	Repair

Interior damage

2



Part	Interior cleaning
Position	Front
Damages	Stained/dirty
Severity	-
Repair mode	Cleaning

4



Part	Interior cleaning
Position	Centre
Damages	Stained/dirty
Severity	-
Repair mode	Cleaning