



Citroen Berlingo: 1RVD673

Vinnumber:	VF77J5FK6GJ905834	Versionname:	Berlingo Break Live 1.6VTi 98pk/cv 4p
First Registrationdate:	9/03/2017	Fiscalpower:	
Expertise Mileage:	26546	Power Kw:	72
Bodytype:		Type of rims (mounted)	Steel
Gearbox:	MAN 5 VIT		
Transmission:			
Fueltype:			
Maintenance	NOT OK		
Maintenance	uitvoeren		
Battery functioning	No		
Type of rims (mounted)	Steel		
Certificate of Conformity	Yes		
Category	Light Commercial Vehicle		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Type of Tow bar	Tow bar fixed
Type of Maintenance book	Maintenancebook present		
Type of GPS storage	N.A.		

Tyres

195/65/15/91 H				
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Michelin: 5 mm	Re.R.	Bridgestone: 6 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				5.0
Tyre profile depth RR				6.0
Tyre size FL				195/65 R 15 91 H
Tyre size FR				195/65 R 15 91 H
Tyre size RL				195/65 R 15 91 H
Tyre size RR				195/65 R 15 91 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				261
Tyre make FR				261
Tyre make RL				261
Tyre make RR				255

Assistance equipment

Spare wheel	No
Number of charging cables (normal)	0
Number of charging cables (rapid charge)	0

MOT certificate, Non-conforme, Replace



Service, Maintenance, Check



Data erasure, Maintenance, Check



Steering wheel, Scratch(es), Replace



Interior, Not original part, Replace



Headlight R, Scratch(es), Replace



Bumper F, Scratch(es), Replace



Headlight L, Scratch(es), Replace



Bonnet, Dent(s) and scratch(es), Repair and paint (complete)



Wheel arch cover FL, Broken, Replace



Wing FL, Dent(s), Repair and paint (complete)



Outside rear-view mirror housing L, Scratch(es), Acceptable



Door FL, Dent(s) and scratch(es), Repair and paint (complete)



Door seal FL, Broken, Replace



Door window RL, Not original part, Forfeit




Door RL, Scratch(es), Acceptable



Outer door handle RL, Broken, Replace



Wheel cover RL, Missing, Replace

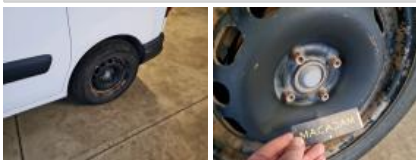

Wing RL, Dent(s) and scratch(es), Repair and paint (complete)





Spare wheel, Missing, Replace



Luggage compartment cover, Missing, Replace



Wheel aperture RL, Scratch(es), Spot repair



Wheel aperture RR, Scratch(es), Spot repair



Rubber seal for boot lid, Deformed / Strained, Replace



Shutter / cover R, Missing, Replace



Rear light L, Scratch(es), Replace



Bumper R, Scratch(es), Replace



Rear light R, Scratch(es), Replace



Boot door panel RR, Scratch(es), Acceptable



Wheel cover RR, Missing, Replace



Tyre RR, Not original part, Replace



Wing RR, Scratch(es), Repair and paint (complete)



Outer sill R, Dent(s) and scratch(es), Repair and paint (complete)



Sliding door R, Dent(s) and scratch(es), Acceptable



Door trim RR, Scratch(es), Acceptable



Door FR, Dent(s), Acceptable



Outside rear-view mirror housing R, Scratch(es), Acceptable



Wheel cover FR, Missing, Replace




Mirror side repeater R, Broken, Replace



Wing FR, Dent(s), Repair and paint (complete)



Tyre FR, Flat, Replace

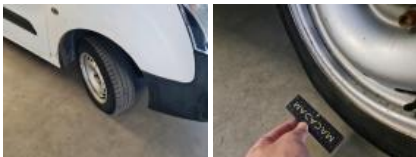

Roof pillar R, Dent(s), Acceptable



Bodywork, Not original part, Remove lettering

