



Peugeot Rifter: 2BVK406

Vinnumber:	VR3ECYHT2NJ602554	Versionname:	Rifter Standard Allure 1.5 BlueHDi S/S 102pk/cv 5p
First Registrationdate:	6/04/2022	Fiscalpower:	
Expertise Mileage:	151270	Power Kw:	75
Bodytype:		Type of rims (mounted)	Steel
Gearbox:	MAN 6 VIT		
Transmission:			
Fueltype:			
Maintenance	OK		
Maintenance	6960 km - 5 maanden		
Battery functioning	Yes		
Type of rims (mounted)	Steel		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	1	Luggage cover	
Type of Maintenance book	Digital maintenance	Type of Tow bar	Tow bar removable
Type of GPS storage	N.A.		

Tyres

	215/65/15/102 H			
Summer tyres:	Fr.L.	Hankook: 3 mm	Fr.R.	Hankook: 3 mm
	Re.L.	Hankook: 5 mm	Re.R.	Hankook: 5 mm
Tyre profile depth FL				3.0
Tyre profile depth FR				3.0
Tyre profile depth RL				5.0
Tyre profile depth RR				5.0
Tyre size FL				215/65 R 15 102 H
Tyre size FR				215/65 R 15 102 H
Tyre size RL				215/65 R 15 102 H
Tyre size RR				215/65 R 15 102 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				260
Tyre make FR				260
Tyre make RL				260
Tyre make RR				260

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Ignition key, Missing, Replace



Data erasure, Maintenance, Check

No pictures to display

Instrument panel, complete, Not original part, Check



Interior, Dirty, Acceptable



Floor covering FL, Worn, Acceptable



Armrest, Damaged, Replace



Door panel FR, Scratch(es), Acceptable



Backrest cover FL, Scratch(es), Acceptable



Air vent RM, Broken, Replace



Backrest cover FR, Scratch(es), Smart repair



Bumper spoiler F, Dent(s) and scratch(es), Replace





Bumper F, Scratch(es), Acceptable



Door FL, Scratch(es), Acceptable



Boot cover, Broken, Replace



Internal boot lining L, Scratch(es), Acceptable



Internal boot lining R, Scratch(es), Acceptable



Rear bulkhead lining, Scratch(es), Acceptable



Boot lid covering R, Scratch(es), Acceptable




Tailgate / Boot, Dent(s), Repair and paint (complete)





Tailgate / Boot, Chemical polution, Repair and paint (complete)

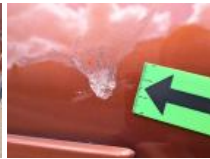

Bumper R, Scratch(es), Replace



Sill trim R, Broken, Replace



Door trim FR, Scratch(es), Replace



Wing trim FR, Scratch(es), Replace



Roof, Dent(s), Acceptable

