



Peugeot Partner (Segm. B1): 1VMU867

Vinnumber:	VR3EFBHYBJJ868646	Versionname:	Partner L2 Heavy Premium 1.6 BlueHDi S&S 100pk/cv
First Registrationdate:	3/01/2019	Fiscalpower:	
Expertise Mileage:	122867	Power Kw:	73
Bodytype:		Type of rims (mounted)	Steel
Gearbox:	MAN 5 VIT		
Transmission:			
Fueltype:			
Battery functioning	Yes		
Type of rims (mounted)	Steel		
Certificate of Conformity	Yes		
Category	Light Commercial Vehicle		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Type of Tow bar	No Tow bar
Type of Maintenance book	Maintenancebook present		
Type of GPS storage	N.A.		

Tyres

205/60/16/96 H				
Summer tyres:	Fr.L.	Continental: 5 mm	Fr.R.	Continental: 5 mm
	Re.L.	Continental: 5 mm	Re.R.	Continental: 5 mm
Tyre profile depth FL				5.0
Tyre profile depth FR				5.0
Tyre profile depth RL				5.0
Tyre profile depth RR				5.0
Tyre size FL				205/60 R 16 96 H
Tyre size FR				205/60 R 16 96 H
Tyre size RL				205/60 R 16 96 H
Tyre size RR				205/60 R 16 96 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				256
Tyre make FR				256
Tyre make RL				256
Tyre make RR				256

Assistance equipment

Spare wheel	Yes	Jack	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Air vent, mid-dashboard, Broken, Replace



Dashboard, Hole, Smart repair



Centre console, Hole, Acceptable



Engine insulation, Tear, Replace



Bumper F, Broken, Replace




Bonnet, Scratch(es), Acceptable



Bumper F, Scratch(es), Acceptable



Wheel cover FL, Missing, Replace

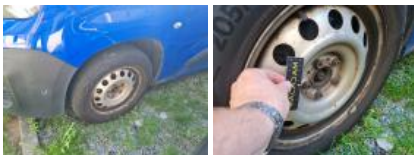

Tyre FL, Tear, Replace



Wing FL, Scratch(es), Repair and paint (complete)



Door FL, Dent(s) and scratch(es), Repair and paint (complete)



Outside rear-view mirror housing L, Scratch(es), Replace



Wheel cover RL, Missing, Replace



Wing RL, Dent(s) and scratch(es), Repair and paint (complete)



Boot door panel RL, Dent(s) and scratch(es), Repair and paint (complete)



Bumper R, Scratch(es), Replace



Rear light R, Scratch(es), Replace



Boot door panel RR, Dent(s) and scratch(es), Repair and paint (complete)



Bumper R, Scratch(es), Forfeit



Wheel cover RR, Missing, Replace




Wheel cover FR, Missing, Replace



Wing RR, Deformed / Strained, Replace and paint



Sliding door R, Dent(s) and scratch(es), Repair and paint (complete)

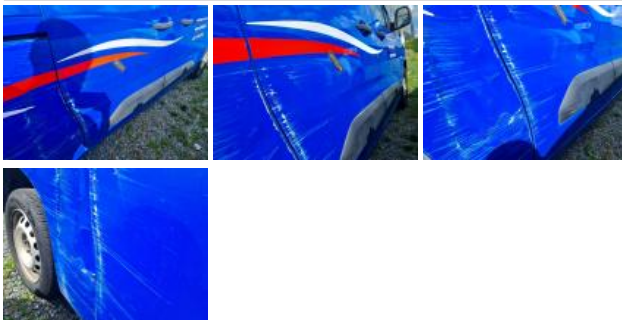

Door trim RR, Scratch(es), Replace




Outside rear-view mirror housing R, Scratch(es), Replace



Outside rear-view mirror base R, Broken, Replace



Door FR, Dent(s) and scratch(es), Acceptable

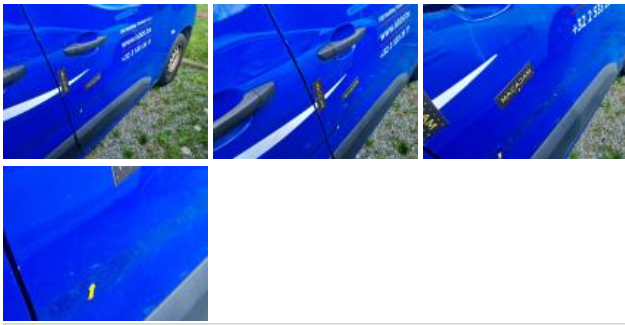

Door trim FR, Scratch(es), Acceptable



Outer sill R, Dent(s) and scratch(es), Repair and paint (complete)



Bodywork, Not original part, Remove lettering



Bodywork, Not original part, Check

