



Peugeot 508 (KKL): 2AUF783

Vinnumber:	VR3FCYH2TMY520282	Versionname:	508 SW GT Pack 1.5 BlueHDi 130pk/cv S&S 5p EAT8
First Registrationdate:	20/07/2021	Fiscalpower:	
Expertise Mileage:	83257	Power Kw:	96
Bodytype:		Type of rims (mounted)	Aluminium
Gearbox:	Automatic		
Transmission:			
Fueltype:			
Battery functioning	Yes		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Luggage cover	
GPS		Type of Tow bar	No Tow bar
Type of Maintenance book	Maintenancebook present		
Type of GPS storage	HD		

Tyres

	235/40/19/96 Y			
Summer tyres:	Fr.L.	Michelin: 5 mm	Fr.R.	Michelin: 5 mm
	Re.L.	Michelin: 7 mm	Re.R.	Michelin: 6 mm
Tyre profile depth FL				5.0
Tyre profile depth FR				5.0
Tyre profile depth RL				7.0
Tyre profile depth RR				6.0
Tyre size FL				235/40 ZR 19 96 Y
Tyre size FR				235/40 ZR 19 96 Y
Tyre size RL				235/40 ZR 19 96 Y
Tyre size RR				235/40 ZR 19 96 Y
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				261
Tyre make FR				261
Tyre make RL				261
Tyre make RR				261

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Interior, Not original part, Repair/replace (lump sum)




Bumper F, Dent(s) and scratch(es), Repair and paint (complete)



Alloy rim FL polished, Scratch(es), Repair and paint (complete)



Tyre FL, Tear, Acceptable

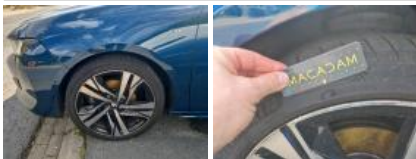

Alloy rim RL polished, Scratch(es), Repair and paint (complete)



Wing RL, Scratch(es), Acceptable



Door RL, Dent(s), Acceptable



Door FL, Dent(s) and scratch(es), Acceptable



Bumper R, Scratch(es), Repair and paint (complete)



Tailgate / Boot, Scratch(es), Repair and paint (complete)



Rear spoiler, Scratch(es), Repair and paint (complete)



Alloy rim RR polished, Scratch(es), Repair and paint (complete)



Alloy rim FR polished, Scratch(es), Repair and paint (complete)



Wing RR, Scratch(es), Acceptable



Door FR, Dent(s), Acceptable



Outside rear-view mirror R, complete, Scratch(es), Acceptable



Wing FR, Scratch(es), Acceptable



Tyre FR, Tear, Replace



Door RR, Dent(s), Paintless dent repair

