



Expertise

Protocol number: 41294593
Order No. / Reference: 25157262
Inspection date: 27 Aug 2025

Manufacturer: Opel	Model: Corsa 1.2 Direct Injection Turbo Start/Stop Edition
VIN: VXXUPHNEKM4359755	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Corsa 1.2 Direct Injection Turbo Start/Stop Edition	
Vehicle Identification number	VXXUPHNEKM4359755
Mileage (Read)	126,869 km
First registration	11 Mar 2022
Number of holders	1
Next periodical technical inspection	06/2027
(Report on hand)	
Power / Engine displacement	74 kw / 1,199 ccm
Fuel type / Cylinder	Petrol / 3
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Diamant Schwarz Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	Available / incomplete	Next maintenance in	13,620 km
Last maintenance on / at	10/2024 at 101,066 km		
Key is / should be	1 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	GF957869
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
Manufacturer key number/ type code number	1889 / ABU 00237		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	1,620 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	195/55 R16 91H	Summer tyres on Steel rim with wheel cover	Michelin	5mm / 5mm
2)	195/55 R16 91H	Summer tyres on Steel rim with wheel cover	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	195/55 R16 87H	Winter tyres on Light alloy	Semperit	7mm / 7mm
2)	195/55 R16 87H	Winter tyres on Light alloy	Semperit	7mm / 8mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2026		

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

Equipment

Standard equipment

- Storage compartments (storage compartment in the center console, front and rear - cup holders in the center console - glove compartment - storage compartment in the front doors, suitable for 1.5-liter drinks bottles - storage compartment in the rear doors, suitable for 0.5-liter drinks bottles)
- Anti-lock braking system (ABS) (with cornering brake control (CBC) and brake assist)
- Hill Start Assist
- On-board computer
- headliner, gray
- Electronic brake force distribution (EBD)
- Driver information display 3.5"
- Forward collision warning with automatic emergency braking and pedestrian detection (Active between 5 and 85 km/h. Monitors the distance to the vehicle ahead. If the vehicle approaches a vehicle ahead or a pedestrian too quickly, the driver is informed via a warning tone and a message in the driver information display. If there is a risk of collision, the braking system is prepared and, if necessary, emergency braking is initiated to minimize the consequences of a potential collision.)
- Steering wheel: Comfort steering wheel (flattened bottom)
- Headlight range adjustment, manual
- Fatigue detection (Detects signs of driver fatigue based on steering behavior and driving time and issues a visual and audible warning (3-stage warning).)
- Radio: Digital radio reception DAB+
- Tire pressure warning
- Wheels: Tire repair kit (tire sealant - 12 volt compressor (without jack))
- Wheels: Steel 6.5 J x 16 with 195/55 R16 tires (low rolling resistance tires)
- Seat belts: Three-point seat belts on all seats (belt force limiters and pretensioners on the front and outer rear seats - warning audible and illuminated warning lights for unfastened seat belts on all seats)
- Seats: Rear seat backrest 60:40 split, foldable
- Start/Stop system (reinforced starter - high-performance battery - switch to deactivate the start/stop function)
- 12V socket in the center console, front
- Traction Control (TC) Plus (traction control with engine and brake intervention)
- Ambient lighting
- Pre-installation for ISOFIX child seat fastening system (rear outside)
- Immobiliser
- Heat-insulating glazing, tinted
- Ignition keys (2) (one with radio remote control and foldable)
- Adaptive brake light
- Airbag: Front airbags, driver and front passenger (front passenger airbag can be deactivated manually)
- Airbag: Head airbags front and rear
- Airbag: Side airbag for driver and passenger side (side airbag, passenger, deactivatable)
- Exterior mirrors for driver and passenger side, electrically adjustable and heated (manually folding - exterior mirror housing in black)
- Brake light, third
- tachometer
- Electronic Stability Program Plus (ESP Plus)
- Electric front windows (tap function - anti-pinch protection)
- Pedestrian protection
- Intelligent speed controller and limiter
- Transmission: 6-speed manual transmission
- Back window, heater
- Rear window wiper (with interval control)
- Child safety lock in the rear doors, manual
- Air conditioning (manual recirculation - footwell heating, rear)
- Headrests (5) (Height adjustable)
- Steering column, height and length adjustable
- Make-up mirrors (driver and passenger side)
- Gasoline particulate filter (maintenance-free)
- Pollen filter
- Radio BT (5" monochrome touchscreen - Bluetooth audio streaming - hands-free system via Bluetooth interface - phone book and call log display - voice control of the paired smartphone possible - USB interface - steering wheel remote control - 4 speakers)
- Side impact protection
- Power steering (speed-dependent)
- Seats: Comfort passenger seat (4-way manually adjustable (length and backrest angle))
- Seats: Comfort driver's seat (6-way manually adjustable (length, height, backrest angle))
- Lane Keeping Assist (Warning if the driver unintentionally drifts out of the lane (between 65 km/h and 180 km/h) via a warning light in the driver information display. Lane Keeping Assist also alerts the driver by gently countersteering, but does not steer the vehicle continuously.)
- Traffic sign recognition (detection of speed limits and their cancellation as well as display of the recognized sign in the driver information display (depending on visibility and weather conditions))
- Central locking with radio remote control

Extra equipment



- | | |
|---|---|
| <ul style="list-style-type: none"> • Heated leather steering wheel • Navigation system: Multimedia navigation system with 7" touchscreen color display (multimedia radio, automatic music recognition, Bluetooth hands-free system, Apple CarPlay, Android Auto, voice control, 1 USB, DAB+ steering wheel remote control, navigation system with integrated memory, road map of Europe (incl. Russia and Türkiye), 3D map display, dynamic route guidance, display of special destinations, tour planning, GPS module) | <ul style="list-style-type: none"> • Paint finish: metallic • Parking pilot, rear parking aid (with acoustic warning signal when reversing) • Seat heating, driver and front passenger (multi-stage switchable) • Solar Protect heat-insulating glazing (in the rear, heavily tinted) |
|---|---|

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting trip was carried out on the company premises.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Wheel cover - rear left side - Scratched - Replace
2	Wing mirror - right side	Cap (Folgekosten möglich) - Malposition - Un- / install
3	Wheel / tyres	Wheel cover - rear right side - Scratched - Replace
4	Boot lid / rear door	Boot lid (Spaltmaße) - Malposition - Set / adjust
5	Boot lid / rear door	Boot lid - Glued / labelled - Remove
6	Side panel - rear left side	Elbow - dent(s) - Smart repair
7	Side panel - rear right side	Protection strip (Hinten rechts) - Broken / torn - Replace
8	Side panel - rear left side	Sill - Scratch(es) - Smart repair
9	Side panel - rear right side	Elbow - dent(s) - Smart repair
10	Boot lid / rear door	Boot lid - dent(s) - Smart repair
11	Body	Body (Harz) - Soiled - Conditioning
12	Door - front right side	Door - Dent / paintcoat damage - Smart repair
13	Sill - right side	Sill - Dent / paintcoat damage - Smart repair
14	Side panel - rear right side	Sill - Dent / paintcoat damage - Smart repair
15	Sill - left side	Sill (erhöhter Aufwand; an Kante) - Dent / paintcoat damage - Smart repair
16	Roof	Roof rail - right side - Scratch(es) - Paint
17	Tail light	Tail lamp - right side - Scratch(es) - Replace
18	Door - rear right side	Door - Dent / paintcoat damage - Repair and paint
19	Rear bumper	Rear bumper - Scratch(es) - Paint
20	Door - front left side	Door - Dent / paintcoat damage - Repair and paint
21	Bonnet	Bonnet (Verätzungen + Kratzer) - Paint defect - Repair and paint
22	Front bumper	Front bumper - Scratched - Paint
23	Roof	Roof (3 Dellen) - Dent / paintcoat damage - Repair and paint

Wear and tear



No.	Component group	Description
1	Body	Body - Scratch(es) - Cover / polish
2	Documents	Service book (Service 2025 fehlt) - Incomplete - No deduction
3	2nd wheel set	2 alloy rims (Kein Teil der Ausstattung) - Scratched - No deduction
4	Tail light	Tail lamp - left side - Scratch(es) - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Missing parts

Description

Roof - Stub aerial

Equipment - Vehicle key with remote control

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Apparently, no repaired previous damage could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

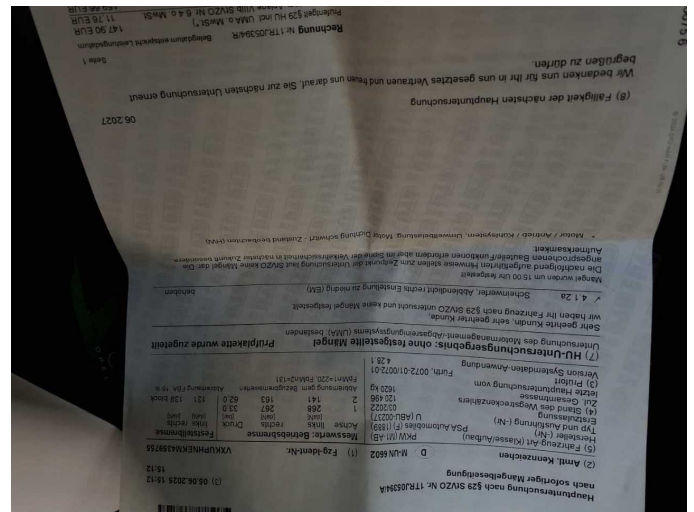


Figure 14: Documents



Figure 15: Documents

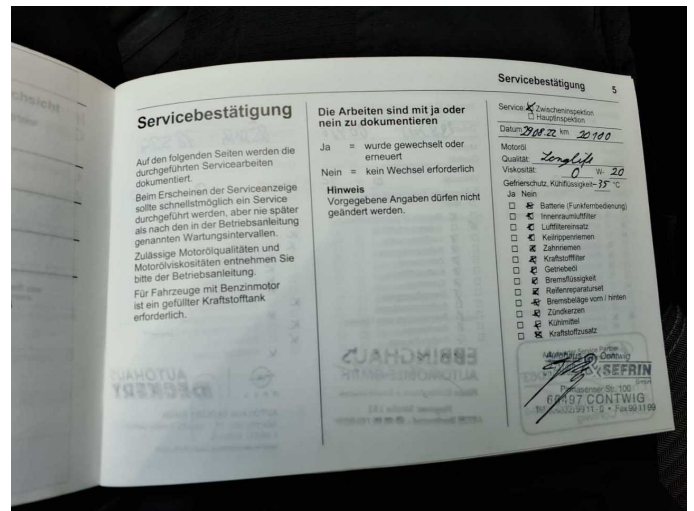


Figure 16: Documents

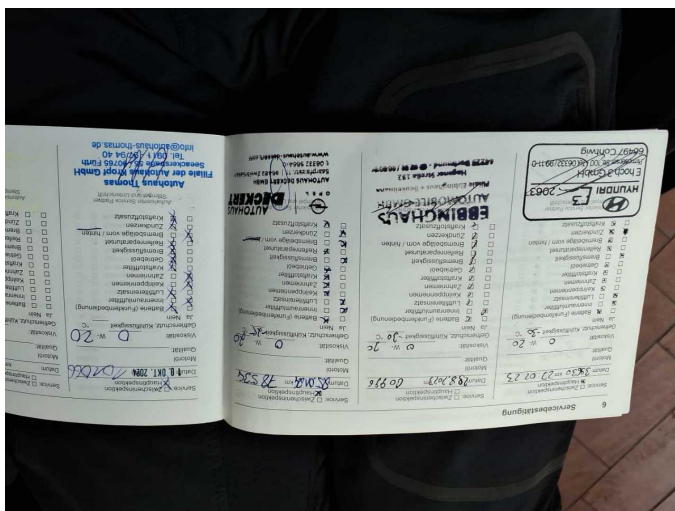


Figure 17: Documents



Figure 18: Documents



Figure 19: Additional tyres

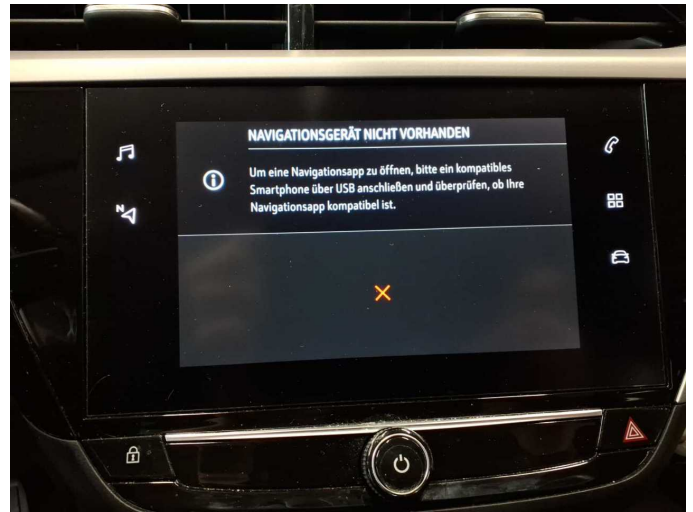


Figure 20: Navigation



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

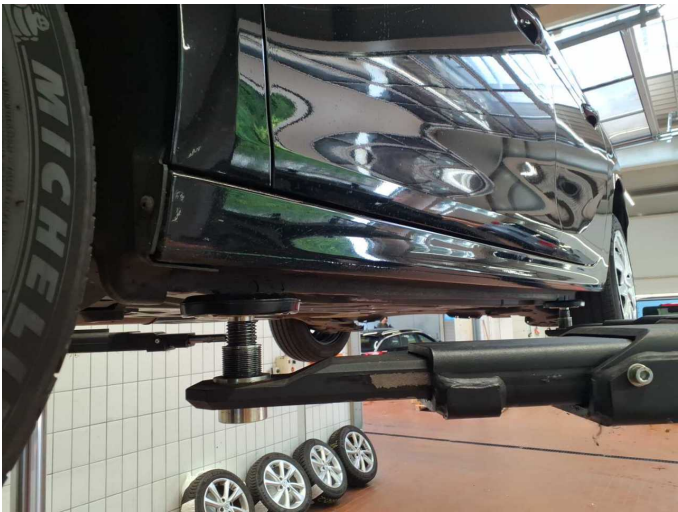


Figure 30: Misc.



Figure 31: Misc.




Damage 1: Wheel / tyres: Wheel cover - rear left side - Scratched - Replace




Damage 1: Wheel / tyres: Wheel cover - rear left side - Scratched - Replace




Damage 1: Wheel / tyres: Wheel cover - rear left side - Scratched - Replace

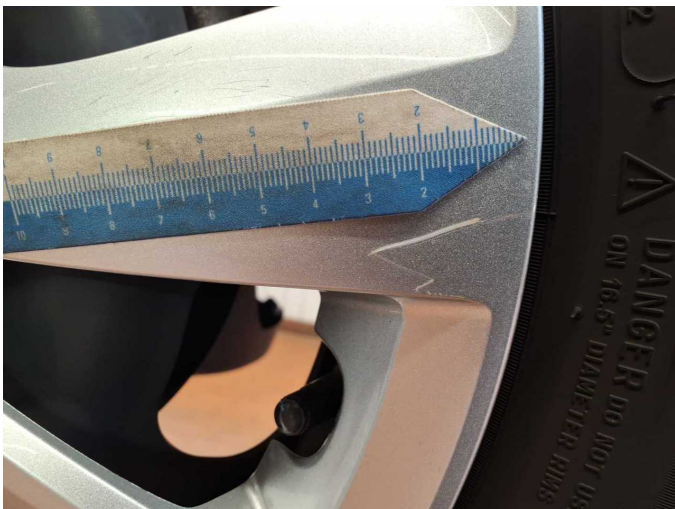

Damage 1: Wheel / tyres: Wheel cover - rear left side - Scratched - Replace

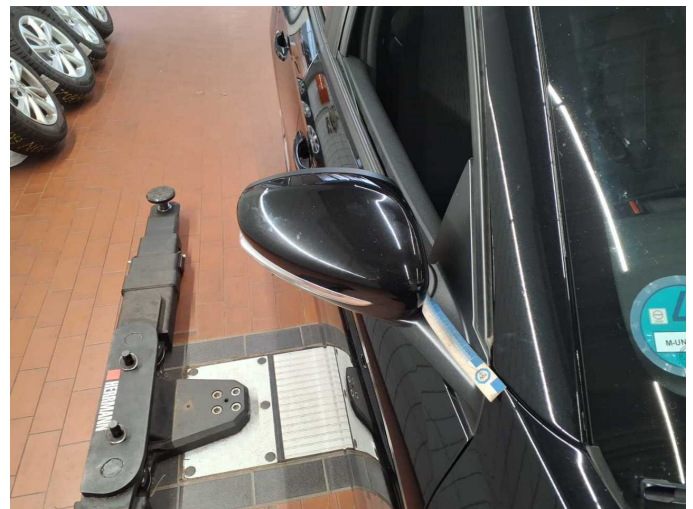

Damage 2: Wing mirror - right side: Cap (Folgekosten möglich) - Malposition - Un- / install

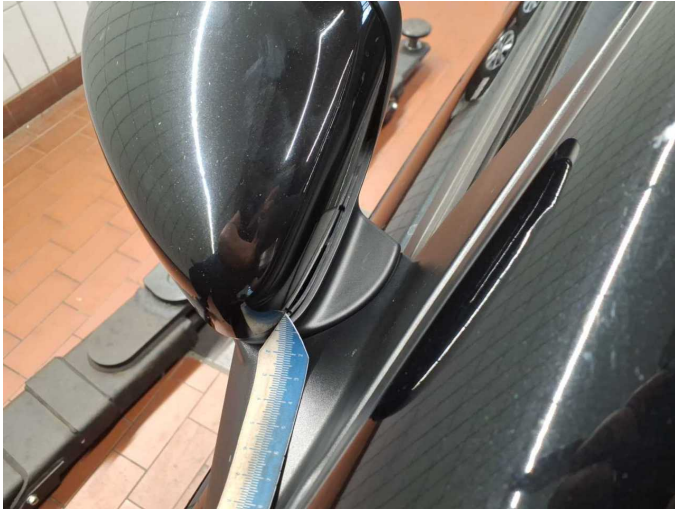

Damage 2: Wing mirror - right side: Cap (Folgekosten möglich) - Malposition - Un- / install




Damage 2: Wing mirror - right side: Cap (Folgekosten möglich) - Malposition - Un- / install



Damage 3: Wheel / tyres: Wheel cover - rear right side - Scratched - Replace



Damage 3: Wheel / tyres: Wheel cover - rear right side - Scratched - Replace

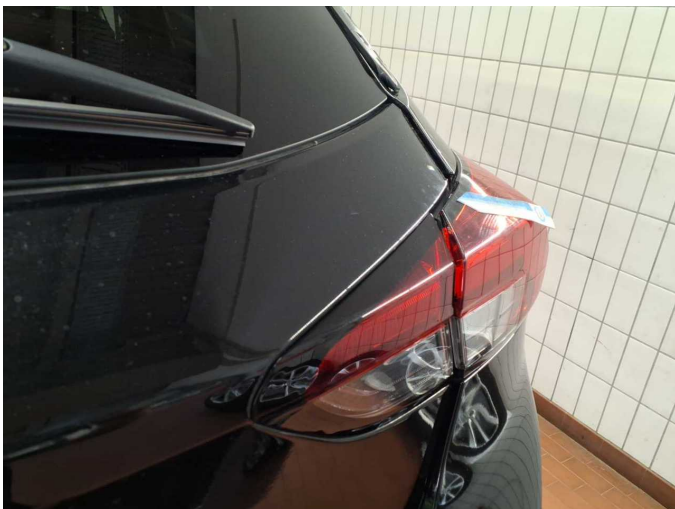

Damage 4: Boot lid / rear door: Boot lid (Spaltmaße) - Malposition - Set / adjust



Damage 4: Boot lid / rear door: Boot lid (Spaltmaße) - Malposition - Set / adjust



Damage 4: Boot lid / rear door: Boot lid (Spaltmaße) - Malposition - Set / adjust



Damage 5: Boot lid / rear door: Boot lid - Glued / labelled - Remove




Damage 5: Boot lid / rear door: Boot lid - Glued / labelled - Remove



Damage 6: Side panel - rear left side: Elbow - dent(s) - Smart repair



Damage 6: Side panel - rear left side: Elbow - dent(s) - Smart repair

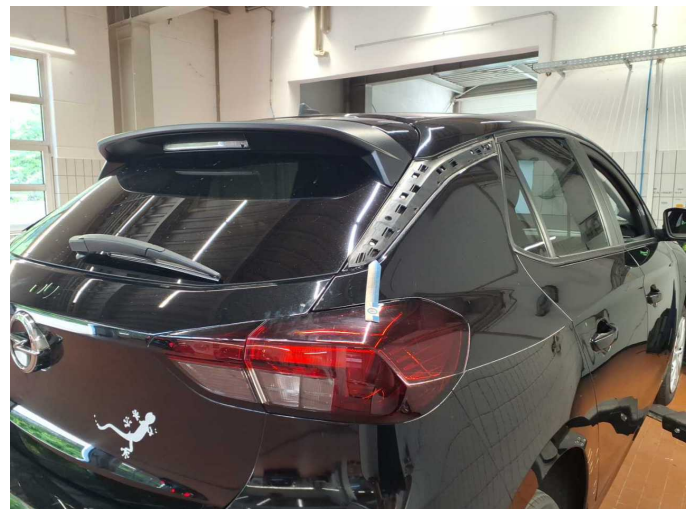

Damage 7: Side panel - rear right side: Protection strip (Hinten rechts) - Broken / torn - Replace



Damage 7: Side panel - rear right side: Protection strip (Hinten rechts) - Broken / torn - Replace



Damage 7: Side panel - rear right side: Protection strip (Hinten rechts) - Broken / torn - Replace



Damage 7: Side panel - rear right side: Protection strip (Hinten rechts) - Broken / torn - Replace




Damage 8: Side panel - rear left side: Sill - Scratch(es) - Smart repair



Damage 8: Side panel - rear left side: Sill - Scratch(es) - Smart repair




Damage 9: Side panel - rear right side: Elbow - dent(s) - Smart repair

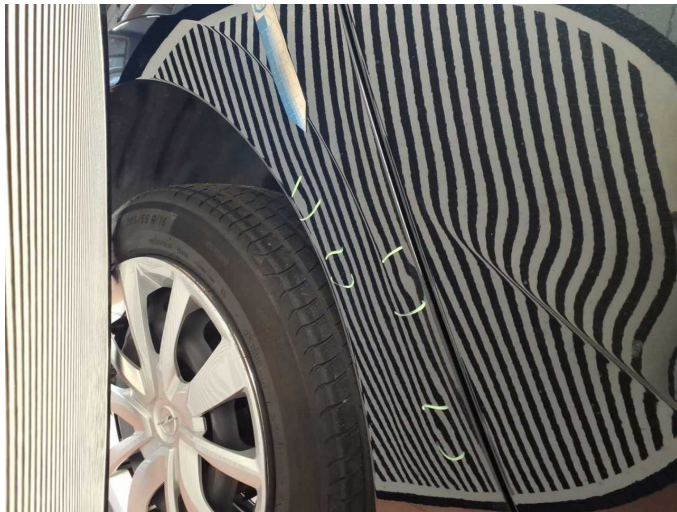


Damage 9: Side panel - rear right side: Elbow - dent(s) - Smart repair



Damage 10: Boot lid / rear door: Boot lid - dent(s) - Smart repair

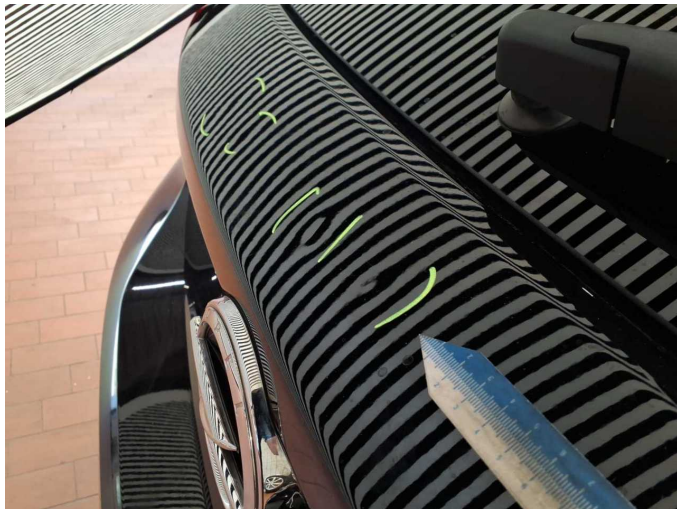

Damage 10: Boot lid / rear door: Boot lid - dent(s) - Smart repair

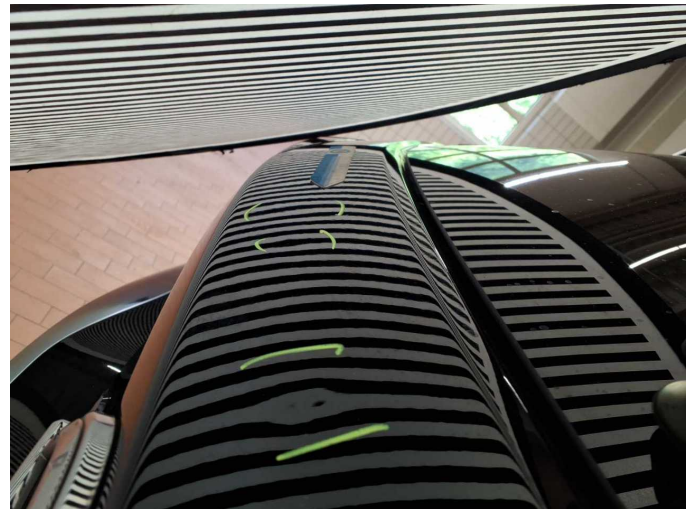

Damage 10: Boot lid / rear door: Boot lid - dent(s) - Smart repair



Damage 11: Body: Body (Harz) - Soiled - Conditioning



Damage 11: Body: Body (Harz) - Soiled - Conditioning



Damage 11: Body: Body (Harz) - Soiled - Conditioning



Damage 11: Body: Body (Harz) - Soiled - Conditioning



Damage 11: Body: Body (Harz) - Soiled - Conditioning



Damage 11: Body: Body (Harz) - Soiled - Conditioning



Damage 11: Body: Body (Harz) - Soiled - Conditioning



Damage 11: Body: Body (Harz) - Soiled - Conditioning



Damage 11: Body: Body (Harz) - Soiled - Conditioning



Damage 11: Body: Body (Harz) - Soiled - Conditioning




Damage 11: Body: Body (Harz) - Soiled - Conditioning



Damage 12: Door - front right side: Door - Dent / paintcoat damage - Smart repair



Damage 12: Door - front right side: Door - Dent / paintcoat damage - Smart repair

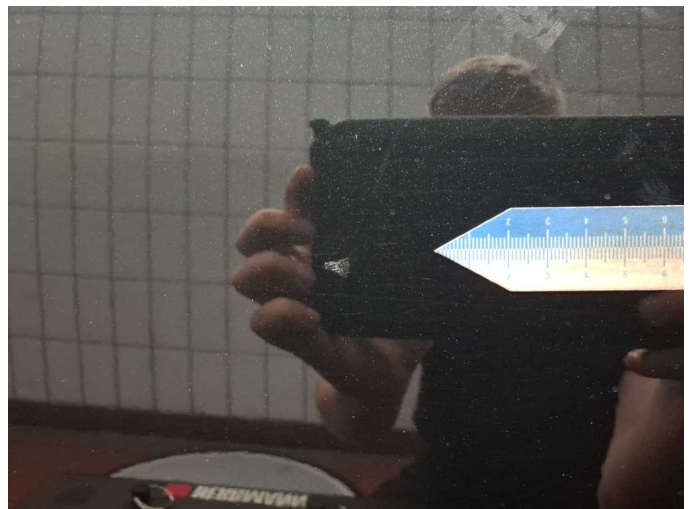

Damage 12: Door - front right side: Door - Dent / paintcoat damage - Smart repair



Damage 13: Sill - right side: Sill - Dent / paintcoat damage - Smart repair



Damage 13: Sill - right side: Sill - Dent / paintcoat damage - Smart repair



Damage 13: Sill - right side: Sill - Dent / paintcoat damage - Smart repair



Damage 14: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 14: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 14: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 14: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 15: Sill - left side: Sill (erhöhter Aufwand; an Kante) - Dent / paintcoat damage - Smart repair



Damage 15: Sill - left side: Sill (erhöhter Aufwand; an Kante) - Dent / paintcoat damage - Smart repair



Damage 15: Sill - left side: Sill (erhöhter Aufwand; an Kante) - Dent / paintcoat damage - Smart repair



Damage 15: Sill - left side: Sill (erhöhter Aufwand; an Kante) - Dent / paintcoat damage - Smart repair




Damage 15: Sill - left side: Sill (erhöhter Aufwand; an Kante) - Dent / paintcoat damage - Smart repair



Damage 16: Roof: Roof rail - right side - Scratch(es) - Paint



Damage 16: Roof: Roof rail - right side - Scratch(es) - Paint

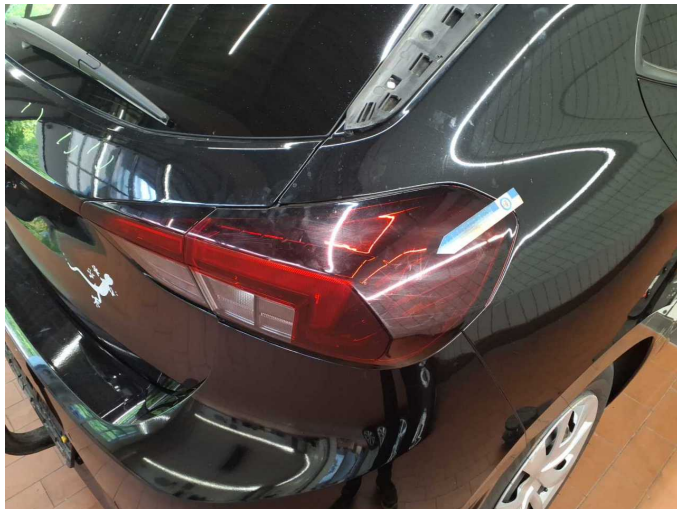

Damage 17: Tail light: Tail lamp - right side - Scratch(es) - Replace



Damage 17: Tail light: Tail lamp - right side - Scratch(es) - Replace




Damage 17: Tail light: Tail lamp - right side - Scratch(es) - Replace




Damage 18: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage 18: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

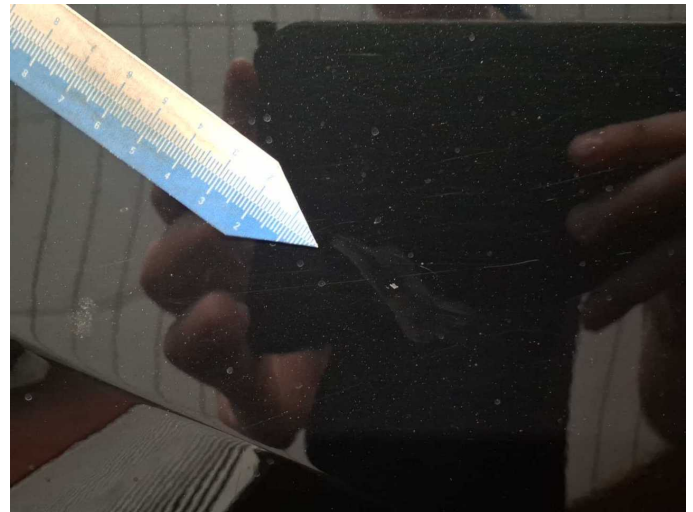

Damage 18: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint

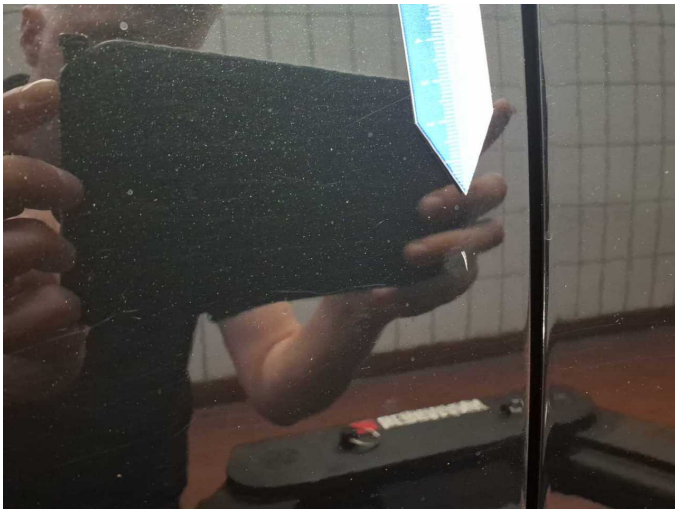

Damage 18: Door - rear right side: Door - Dent / paintcoat damage - Repair and paint



Damage 19: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 19: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 19: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 19: Rear bumper: Rear bumper - Scratch(es) - Paint

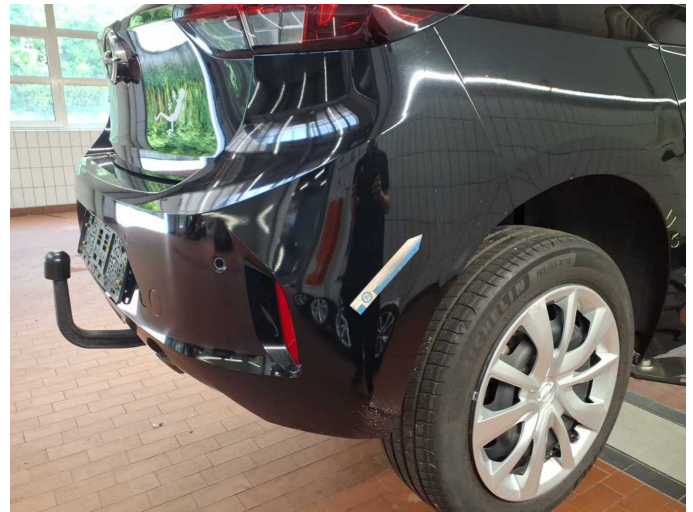

Damage 19: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 19: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 19: Rear bumper: Rear bumper - Scratch(es) - Paint




Damage 19: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 20: Door - front left side: Door - Dent / paintcoat damage - Repair and paint




Damage 20: Door - front left side: Door - Dent / paintcoat damage - Repair and paint

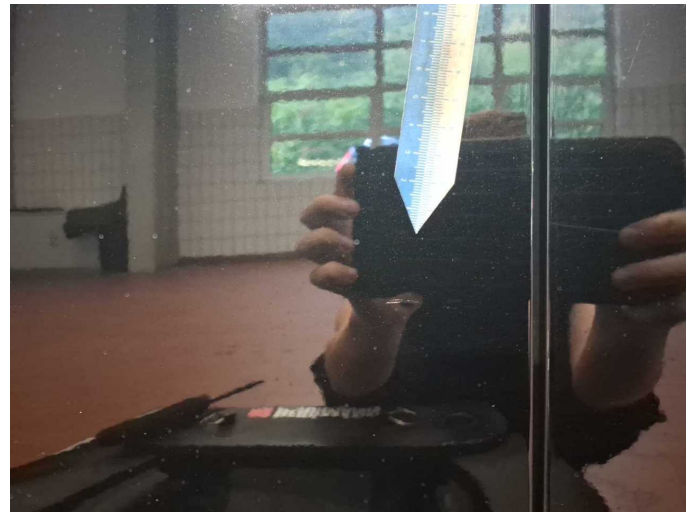

Damage 20: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 20: Door - front left side: Door - Dent / paintcoat damage - Repair and paint

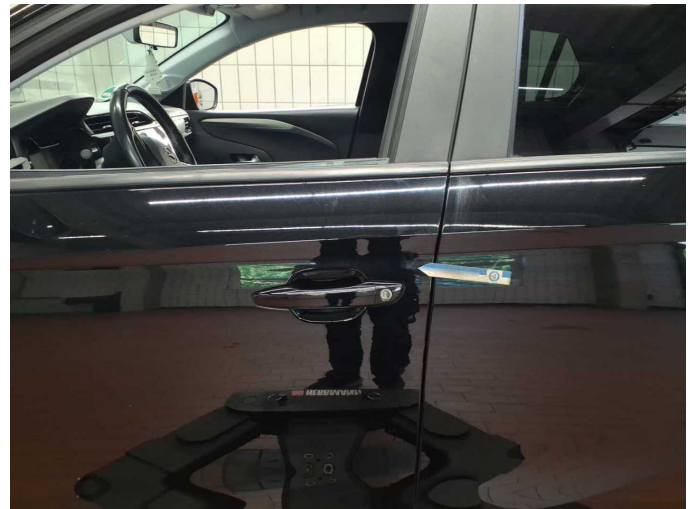

Damage 20: Door - front left side: Door - Dent / paintcoat damage - Repair and paint




Damage 20: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 20: Door - front left side: Door - Dent / paintcoat damage - Repair and paint




Damage 21: Bonnet: Bonnet (Verätzungen + Kratzer) - Paint defect - Repair and paint

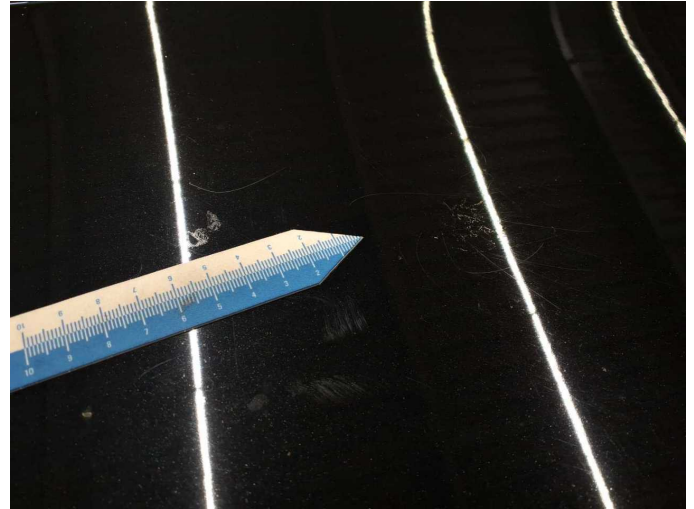


Damage 21: Bonnet: Bonnet (Verätzungen + Kratzer) - Paint defect - Repair and paint




Damage 21: Bonnet: Bonnet (Verätzungen + Kratzer) - Paint defect - Repair and paint

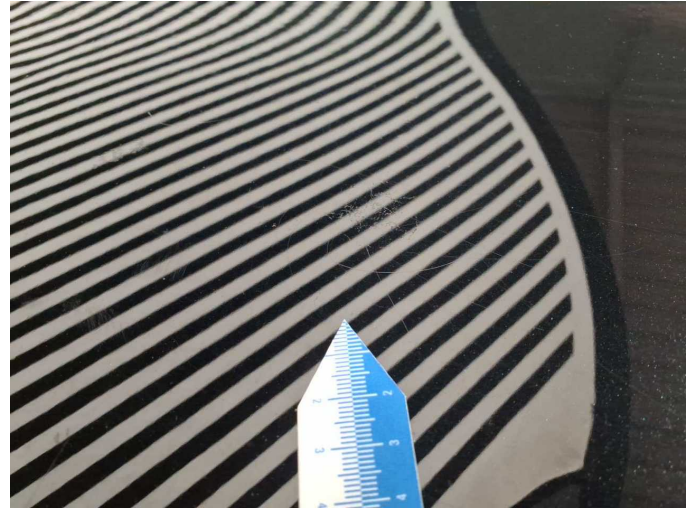

Damage 21: Bonnet: Bonnet (Verätzungen + Kratzer) - Paint defect - Repair and paint

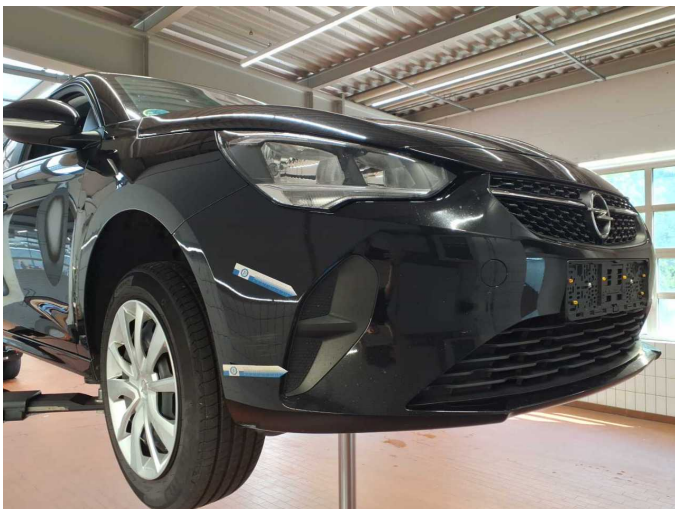

Damage 22: Front bumper: Front bumper - Scratched - Paint

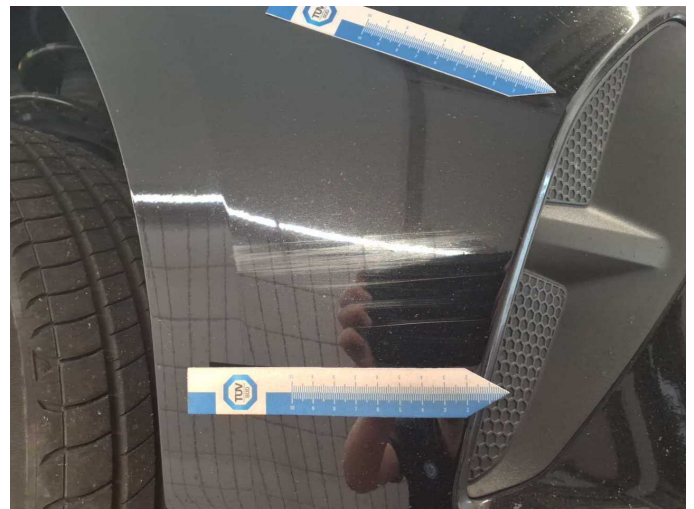

Damage 22: Front bumper: Front bumper - Scratched - Paint



Damage 22: Front bumper: Front bumper - Scratched - Paint



Damage 23: Roof: Roof (3 Dellen) - Dent / paintcoat damage - Repair and paint



Damage 23: Roof: Roof (3 Dellen) - Dent / paintcoat damage - Repair and paint




Damage 23: Roof: Roof (3 Dellen) - Dent / paintcoat damage - Repair and paint



Damage 23: Roof: Roof (3 Dellen) - Dent / paintcoat damage - Repair and paint



Damage 23: Roof: Roof (3 Dellen) - Dent / paintcoat damage - Repair and paint

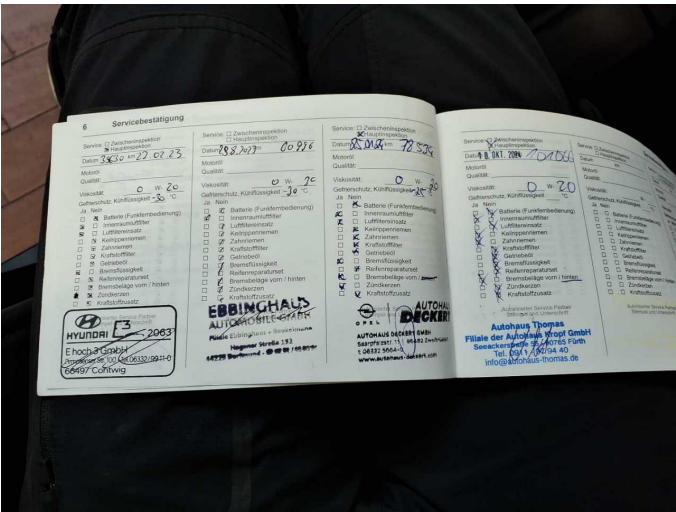

Wear and tear 2: Documents: Service book (Service 2025 fehlt) - Incomplete - No deduction



Wear and tear 3: 2nd wheel set: 2 alloy rims (Kein Teil der Ausstattung) - Scratched - No deduction