

Vehicle details

VIN	VXKUPHNKS L4374569	Brand	OPEL	Maintenance date	-
Licence Plate	J1-05-RN	Model	CORSA 1.2 TURBO ELEGANCE AUTO 74KW ACTI ELEGANCE A	Maintenance mileage	-
Registration date	05/11/2020	Year	2020	Exterior Color	Orange Metallic
Odometer	87 835 km	Engine size	1199	interior Color	Grey
Fuel	Petrol	Body Type	-	Next technical inspection	-
Seats	-	Transmission	Automatic	CO2	-
Doors	5	Gears	-		

Inspection Details

Inspection date	06/10/2025	Inspection loc.	Dekra Ayvens
-----------------	------------	-----------------	--------------



Generic equipment

Manual air-conditioning	✓
Cruise control	✓
Alloy wheel rims	✓
Automatic Gearbox	✓
Metallic paint	✓
Central locking	✓
Electric windows	✓
Mixed upholstery	✓
Park Distance Control	✓
Audio System	✓
Led lighting	✓

Removable element


Spare wheel (wheel & tyre)	✓
Rear parcel shelf	✓

Technical Document

User manual	✓
Warranty booklet	✓
Spare key	✓
Remote key	✓

Tyres

Pirelli 195/55/16 Summer 7.0 mm

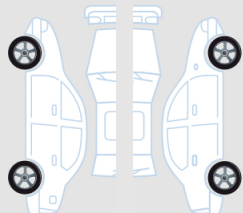

Pirelli 195/55/16 Summer 7.0 mm



Pirelli 195/55/16 Summer 7.0 mm

Pirelli 195/55/16 Summer 7.0 mm

Exterior

1



Part	Alloy wheel 16"
Position	Front left
Damages	Scratched
Severity	-
Repair mode	Lumpsum repair

3



Part	Step plate
Position	Back left
Damages	Scratched
Severity	-
Repair mode	For info

5




Part	Tipper body
Position	Back
Damages	Stained/dirty
Severity	-
Repair mode	Cleaning

6



Part	Wing
Position	Back right
Damages	Dent & Chips
Severity	Diameter (mm) > 20
Repair mode	Repair

7

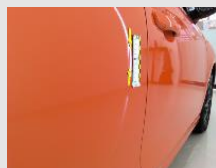

Part	Door
Position	Back right
Damages	Dented
Severity	Diameter (mm) > 20
Repair mode	Smart Repair

8



Part	Bumper
Position	Front
Damages	Scratched
Severity	-
Repair mode	Repair

9



Part	Bonnet
Position	-
Damages	Stone impact
Severity	Diameter (mm) > 4
Repair mode	Lumpsum repair

10



Part	Roof
Position	-
Damages	Dent & Chips
Severity	-
Repair mode	Repair

11



Part	Upper tailgate / Boot
Position	-
Damages	Dented
Severity	Diameter (mm) > 20
Repair mode	Smart Repair


12



Part	Alloy wheel 16"
Position	Front right
Damages	Scratched
Severity	-
Repair mode	Lumpsum repair

Interior damage

2

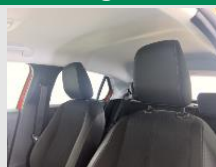

Part	Interior roof lining
Position	-
Damages	Stained/dirty
Severity	-
Repair mode	Cleaning

4



Part	Interior tailgate lining
Position	Down
Damages	Scratched
Severity	-
Repair mode	Smart Repair