



Expertise

Protocol number: 41347039  
Order No. / Reference: 25046816  
Inspection date: 28 Aug 2025

|                        |                                      |
|------------------------|--------------------------------------|
| Manufacturer: Opel     | Model: Crossland 1.5 Diesel Ultimate |
| VIN: W0V7H9EN8N4117279 |                                      |



| Vehicle details                         |   |
|---|---|
| Manufacturer / Type / Model / Equipment |   |
| Opel Crossland 1.5 Diesel Ultimate      |   |
| Vehicle Identification number           | W0V7H9EN8N4117279                             |
| Mileage (Read)                          | 39,314 km                                     |
| First registration                      | 25 Feb 2022                                   |
| Number of holders                       | 1   |
| Next periodical technical inspection    | 01/2027                                       |
| (Report on hand)                        |   |
| Power / Engine displacement             | 81 kw / 1,499 ccm                             |
| Fuel type / Cylinder                    | Diesel / 4                                    |
| Gearbox / Number of gears               | Manual / 6                                    |
| Type of drive                           | Front drive                                   |
| Type of vehicle                         | SUV   |
| Colour / colour code                    | Nautic Blau Metallic /<br>Dach Diamantschwarz |
| Doors / Seats                           | 5 / 5   |
| Upholstery type                         | Alcantara / Leather                           |
| Colour of upholstery                    | Black   |



## Vehicle details

|  |                              |                                |   |
|--|------------------------------|--------------------------------|---|
| <b>Maintenance booklet / proof</b>               | digital proof / complete     | <b>Next maintenance in</b>     | 28,640 km   |
| <b>Last maintenance on / at</b>                  | 03/2025 at 37,967 km         |                                |   |
| <b>Key is / should be</b>                        | 2 / 2                        | <b>FZG documents</b>           | ZB#2 (B) was available (copy), ZB#1 (S) was not available |
|  |                              | <b>Letter No.</b>              | GJ632522  |
| <b>Previous damage / Accident</b>                | None detectable              | <b>Repainting</b>              | None detectable   |
| <b>Inspection conditions</b>                     | sufficient                   | <b>Lifting equipment / pit</b> | yes   |
| <b>Test drive</b>                                | Not performed                | <b>Engine function test</b>    | Performed   |
| <b>Manufacturer key number/ type code number</b> | 1844 / AMH 00092             |                                |   |
| <b>Emission standard</b>                         | EURO6;WLTP;AP;PI/CI; M, N1 I | <b>Fine dust sticker</b>       |   |
| <b>Permitted total weight</b>                    | 1,835 kg                     | <b>Empty weight</b>            |   |

## Tyres

### Mounted tyres

| #  | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
|----|----------------|-----------------------------|--------------|-------------|
| 1) | 215/50 R17 95H | Summer tyres on Light alloy | Bridgestone  | 5mm / 5mm   |
| 2) | 215/50 R17 95H | Summer tyres on Light alloy | Bridgestone  | 6mm / 6mm   |

### Additional tyres

| #  | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
|----|----------------|-----------------------------|--------------|-------------|
| 1) | 195/60 R16 93H | Winter tyres on Light alloy | Goodyear     | 5mm / 5mm   |
| 2) | 195/60 R16 93H | Winter tyres on Light alloy | Goodyear     | 7mm / 7mm   |

### Replacement

| Typ | Tyre size | Type of tyre            | Manufacturer | Tread depth |
|-----|-----------|-------------------------|--------------|-------------|
|     | Tirefit   | Expiration date 09/2026 |              |             |

**Legend:** Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel

## Equipment

### Standard equipment

- Storage compartments (storage compartment in the instrument panel, driver's side; storage compartment in the center console; storage compartment in the front doors, suitable for 1.5-liter drinks bottles; storage compartment in the rear doors, suitable for 0.5-liter drinks bottles; 2 cup holders in the center console; lashing eyes in the luggage compartment; bag hooks, on the side of the luggage compartment)
- Exterior mirrors for driver and passenger side, electrically adjustable, heated, and foldable (exterior mirror housing in black)
- Roof design line, above, in chrome
- Roof spoiler
- tachometer
- Electronic brake force distribution (EBD)
- Electronic Stabilization Program (ESP - Plus)
- Electric rear windows (tap function - anti-pinch protection - comfort closing function via radio remote control of the central locking system)
- Functional equipment (rear seats with 60:40 adjustment - rear seat backrest with tilt adjustment - rear center armrest with through-loading option from the luggage compartment - luggage compartment floor with 2-way height adjustment)
- Head-Up Display (projects speed, cruise control and speed limiter settings, traffic signs with speed limits, forward collision warning, and navigation into the driver's direct field of vision)
- Headrests (3) rear (height adjustable)
- Front headrests (height adjustable)
- Paintwork: Metallic Nautic Blue with roof and exterior mirrors in contrasting color
- LED taillights
- LED headlights
- Steering wheel: Heated leather steering wheel and seat heating, multi-stage, driver and front passenger
- Headlight range adjustment, manual
- Navigation system: Multimedia Navi Pro with 8" touchscreen color display, voice control for audio, telephone, and navigation (Bluetooth audio streaming, hands-free system via Bluetooth interface, phone book and call log display, FM/AM, Autostore, RDS-EON, automatic music recognition, image display via USB port, Apple CarPlay, Android Auto, text message reading and dictation, up to 10 mobile phones can be connected, navigation with integrated memory, European road map (including Russia and Turkey), 3D map display, dynamic route guidance, 2 USB ports, 3.5" color driver information display)
- Proactive driver assistance system (front collision warning with automatic emergency braking and pedestrian detection - fatigue detection)
- Quickheat rapid heating system
- Airbag for driver and passenger side (passenger airbag can be deactivated manually)
- Airbag: Head airbag front and rear outside
- Airbag: Side airbag for driver and passenger side (side airbag, passenger, deactivatable)
- Anti-lock braking system (ABS) (with cornering brake control (CBC) and brake assist)
- Armrest, driver
- Hill Start Assist
- On-board computer
- Brake light, third
- Roof rails, silver
- Maintenance-free diesel particulate filter (DPF) (exhaust gas aftertreatment through SCR (Selective Catalytic Reduction) catalyst with AdBlue (urea injection). Vehicles with BlueInjection technology require AdBlue topping up between regular service intervals. A display in the vehicle provides timely information about the refill time.)
- Electric front windows (tap function - anti-pinch protection - comfort closing function via radio remote control of the central locking system)
- Speed controller with limiter
- Transmission: 6-speed manual transmission
- Back window, heater
- Rear window wiper
- Interior lighting (front and rear)
- Automatic climate control Two zones (with separate temperature control for driver and front passenger, manual air recirculation, automatic air distribution, sun position sensor, activated carbon filter)
- LED ambient lighting (in the center console and in the doors, front)
- LED daytime running lights
- Steering wheel: Leather steering wheel with chrome elements and steering wheel remote control
- Center armrest, front
- Fog light
- OpelConnect (with telematics services: - Emergency/Breakdown call - Vehicle status and information - Route and trip information plus live navigation services, e.g.: - Real-time traffic information - Online POI search - Map updates (via USB))



- Radio: Digital radio reception DAB/DAB+/DMB-R (reception of digital radio stations - reception of digital traffic information (TPEG))
- Tire repair kit (including tire sealant and 12-volt compressor (without jack))
- Keyless locking and starting system Keyless Open & Start (for driver and passenger doors as well as the luggage compartment)
- Visibility features (rain sensor, front - automatic dimming headlights with tunnel detection - interior rearview mirror, automatically dimming - illuminated vanity mirrors in both sun visors - rear reading lights - high beam assistant)
- Solar Protect heat-insulating glazing (in the rear, heavily tinted)
- Lane assistant (warning if the vehicle unintentionally leaves the lane at speeds of 60 km/h or more via a warning tone and indicator light in the driver information display)
- 12V socket in the center console
- Underbody protection look, front and rear, in silver
- Pre-installation for ISOFIX child seat mounting system (including top tether attachment points, rear outside)
- Immobiliser
- Heated windshield, ThermoTec
- Central locking with radio remote control (and interior switch)
- Upholstery: Alcantara interior (seat contact surface, seat cushions and door trim in Alcantara, headrest and outer seat cushions in premium leather look, ergonomic active seat (AGR), driver/front passenger (length, height and backrest angle manually adjustable, seat angle electrically adjustable, lumbar support electrically adjustable in height and length, thigh support manually adjustable, storage compartment with roller blind in the rear center console, 12V socket), functional equipment (rear seats 60:40 adjustable, rear seat backrest angle adjustable, rear center armrest with through-loading, 3rd rear center headrest, luggage compartment floor 2-way)
- Tire pressure warning
- Wheels: Light alloy wheels 6.5 J x 17 with tires 215/50 R17, in BiColor/Black (5 double spokes)
- Power steering (speed-dependent)
- Seat belts: Three-point seat belts on all seats (belt force limiters, front and rear outside - double belt pretensioners, front - belt pretensioners, rear outside - warning audible signal and light for unfastened belts, front and rear)
- Seats: Seat backrest 60:40 split, foldable (and movable, tilt adjustable - with center armrest, rear, - with through-loading option from the luggage compartment - luggage compartment floor 2-way height adjustable)
- Start/Stop system (reinforced starter - high-performance battery - switch to deactivate the start/stop function)
- Traction control (TC Plus)
- Traffic Sign Assistant (detection of speed limits and their cancellation as well as display of the detected sign in the driver information display (depending on visibility and weather conditions))
- Heat-insulating glazing, tinted

#### Extra equipment

- Radio accessories: Premium Sound System (6 speakers, 1 subwoofer in the luggage compartment)

#### Brief expert findings

|                      |  |
|----------------------|--|
| Documents submitted  | At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)         |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned. |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>Lifting equipment and a pit were available for examining the vehicle.                    |
| Test drive           | No test drive/maneuvering was carried out during the inspection of the vehicle.  |
| Engine function test | An engine test run was performed.  |

#### Value reducing factors

| No. | Component group      | Description  |
|-----|----------------------|--|
| 1   | Boot lid / rear door | Boot lid - Glued / labelled - De-glue / neutralise |

#### Wear and tear



| No. | Component group | Description                             |
|-----|-----------------|---|
| 1   | Vehicle glazing | Windscreen - Stone chips - No deduction |
| 2   | Roof            | Roof - dent(s) - No deduction           |

The vehicle shows signs of wear commensurate with its age and use.

## Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features  
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.  
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle

## Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

Apparently, no repaired previous damage could be found on the vehicle.

## Comments

- Der angegebene Winterradsatz ist kein Bestandteil der Fahrzeugausstattung.





Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear





Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: interior 360° view



Figure 10: Cargo area

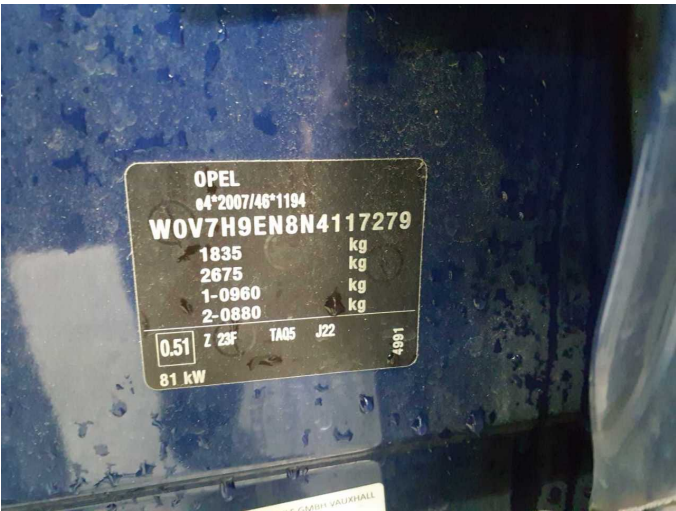


Figure 11: VIN



Figure 12: Mounted tyres





**Figure 14: Additional tyres**



**Figure 16: Misc.**



**Figure 18: Misc.**





Figure 19: Misc.



Figure 20: Misc.

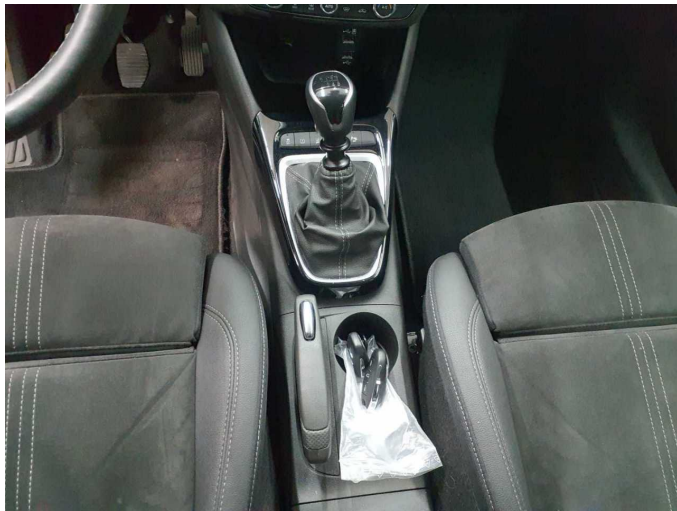


Figure 21: Misc.

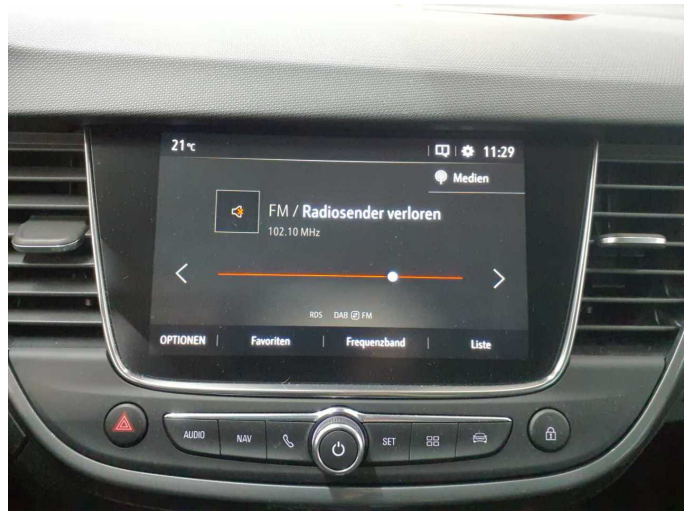


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.





Figure 25: Misc.



Figure 26: Misc.

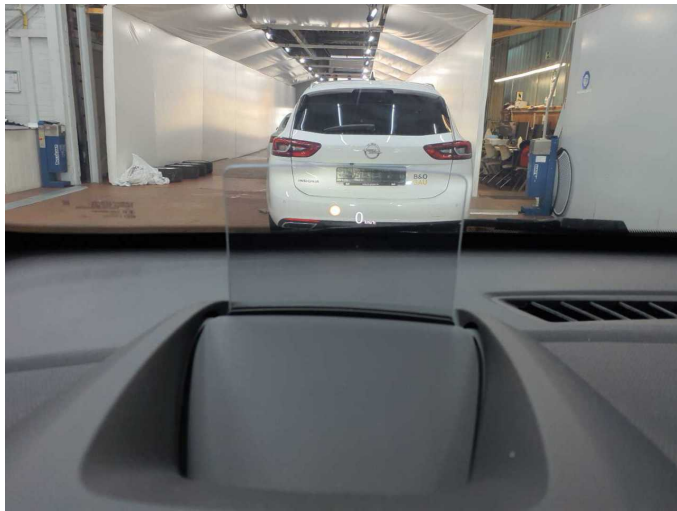


Figure 27: Misc.



Figure 28: Misc.

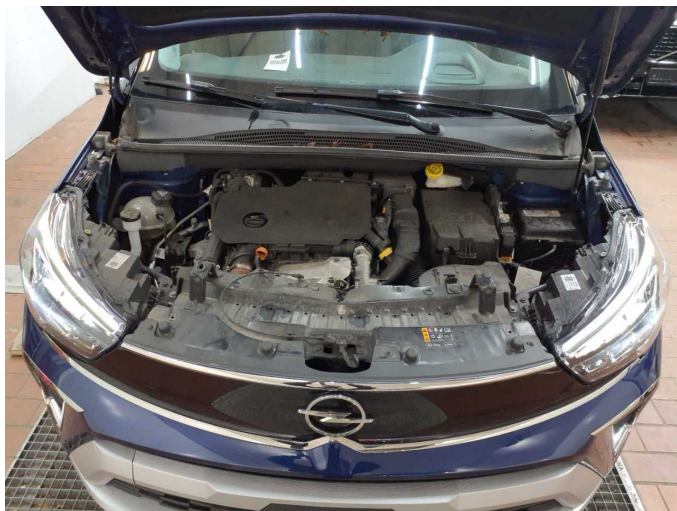


Figure 29: Misc.



Figure 30: Misc.





Figure 31: Misc.



Figure 32: Misc.

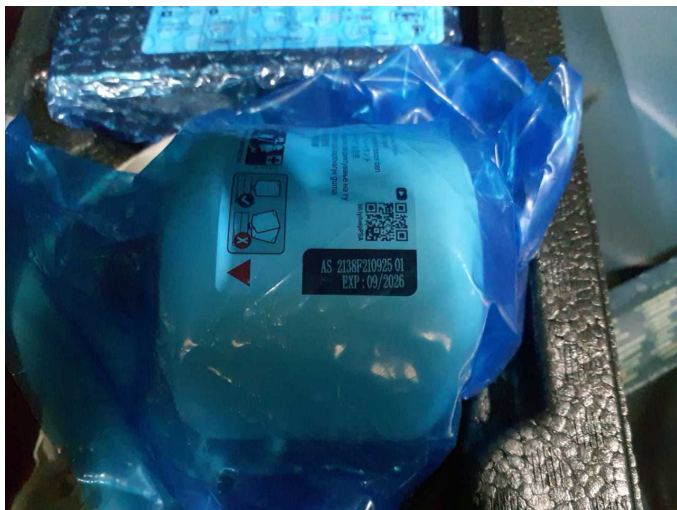


Figure 33: Misc.



Figure 34: Misc.

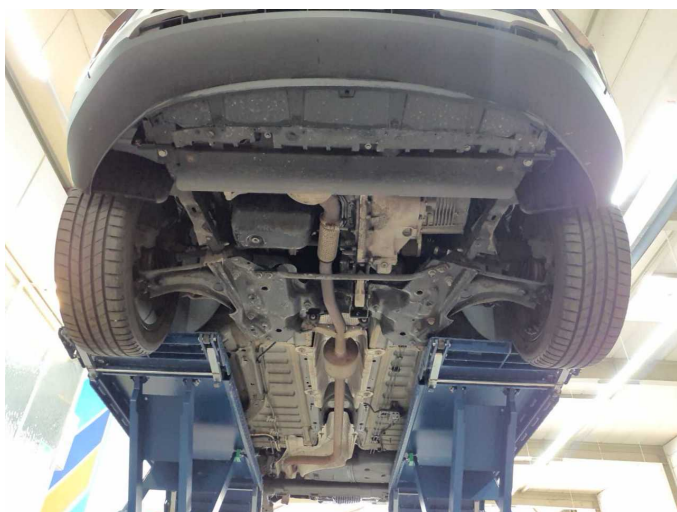


Figure 35: Misc.



Damage 1: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise





**Damage 1:** Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



# Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0V7H9EN8N4117279  
Hersteller / Modell: OPEL OPEL Crossland 1.5 Diesel Ultimate

| Datum      | KM-Stand | Beschreibung   |
|------------|----------|--|
| 14.03.2025 | 37.967   | Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges   |
| 24.01.2025 | 37.429   | AU   |
| 21.02.2024 | 23.688   | Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges |
| 13.02.2023 | 14.386   | Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges   |