



Expertise

Protocol number: 41663030
Order No. / Reference: 25233669
Inspection date: 22 Sept 2025

Manufacturer: Opel

Model: Insignia Sports Tourer 1.5 Diesel Elegance

VIN: W0VZT8ENXN1010222



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Insignia Sports Tourer 1.5 Diesel Elegance	
Vehicle Identification number	W0VZT8ENXN1010222
Mileage (Read)	134,733 km
First registration	20 Jun 2022
Number of holders	1
Next periodical technical inspection	07/2027
(Report on hand)	
Power / Engine displacement	90 kw / 1,496 ccm
Fuel type / Cylinder	Diesel / 3
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Jade Weiß
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	88 %
Last maintenance on / at	07/2025 at 132,270 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	GJ665489
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AME 00249		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,175 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94V	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	215/55 R17 94V	Summer tyres on Light alloy	Michelin	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 11/2025		

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



Equipment

Standard equipment

- | | |
|--|---|
| <ul style="list-style-type: none"> • Storage compartments • Airbag: front airbags and side airbags, driver and front passenger • Anti-lock braking system (ABS) • Hill Start Assist • Brake light, third • Roof rails, silver anodized • diesel particulate filter • Electronic brake force distribution (EBD) • Driver information display, 3.5" • Forward collision warning with pedestrian detection and automatic emergency braking • Noise-reducing, laminated front side windows • Transmission: 6-speed manual transmission • Rear window wiper • Automatic climate control two zones • Headrests, rear (3 pieces) • LED headlights • LED daytime running lights including LED indicators, front and LED taillights • Center armrest, front • Quickheat rapid heating system • Tire repair kit • Wheels: Light alloy wheels 7.5 J x 17 in 5 double-spoke design • Seat belts: Three-point seat belts on all seats • Visual equipment • Lane Keeping Assist • Bumpers painted in body color • Pre-installation for ISOFIX child seat retention system • Heat-insulating glazing, green tinted | <ul style="list-style-type: none"> • Adaptive brake light • Airbag: Head airbag front and rear outside • Ambient lighting • Exterior mirrors for driver and passenger side electrically adjustable and heated • Glasses compartment in the roof lining • Hexagon decorative strip • tachometer • Electronic Stabilization Program (ESP - Plus) • Electric windows front and rear • Pedestrian protection including active bonnet • Luggage compartment cover • Cruise control • Back window, heater • Child safety lock in the rear doors, manual • Front headrests • Paint finish: Uni • LED fog lights • Steering column height/length adjustable • Make-up mirrors in both sun visors, illuminated • Parking brake, electric • Radio: Digital radio reception DAB+ • Tire pressure display • Rear seat backrest folds forward in a 60:40 ratio • Power steering • safety net • Seats: Ergonomic active seat, (AGR) driver • Start/Stop system • Traction Control (TC) Plus • Immobiliser • Central locking with radio remote control |
|--|---|

Extra equipment

- | | |
|---|---|
| <ul style="list-style-type: none"> • Swiveling trailer coupling (including trailer stability program) • Package: Innovations 2 (Head-Up Display - Adaptive Cruise Control (3rd Generation) and front camera - Forward Collision Warning with Pedestrian Detection and Automatic Emergency Braking, active from 4 km/h, range 150 m. If there is a risk of collision, the braking system is prepared and, if necessary, emergency braking / automatic emergency braking is initiated - Traffic Sign Assist) • Radio: Multimedia Navi Pro with 8" color touchscreen display (voice control for audio, phone, and navigation, USB port, Bluetooth audio streaming, navigation system with SD card storage, connected navigation services, predictive navigation, online map updates, real-time traffic information, 8" driver information display, steering wheel remote control, Apple CarPlay and Android Auto) | <ul style="list-style-type: none"> • Package: Easy-Access (Keyless locking and starting system - Sensor-controlled tailgate, electric - Loading sill protection, stainless steel) • Package: Sound (Bose sound system) • Park & Go with digital rear view camera (digital rear view camera - reverse assist - lane change assist - blind spot warning, in both exterior mirrors) |
|---|---|



- Upholstery: Monita fabric/premium leather look including Winter Package 2 (ergonomic active seat, certified by the Campaign for Healthy Backs (AGR), F./B. multi-stage seat heating, F./B. heated leather steering wheel, heated ThermoTec windshield, Seat comfort equipment 1: 8-seater driver's seat, electrically adjustable, lumbar support, electronically adjustable, memory function - driver and outside mirror, massage function, F., exterior mirrors electrically adjustable, heated, including rear seat backrest with FlexFold function, folds forward in a 40:20:40 ratio, charging package: wireless charging, 2 USB ports).

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Floor mats (Vorne links) - Holes - Replace
2	Side panel - rear right side	Sill ((Keine Kratzer nur Dreck)) - dent(s) - Smart repair
3	Door - front right side	Door - Dent / paintcoat damage - Smart repair
4	Body	Body (Umrandungen-Schriftzug) - Glued / labelled - De-glue / neutralise
5	Seat - front	Seat cover - left side (+verschmutzt) - Holes - Smart repair
6	Boot lid / rear door	Boot lid - Deformed - Repair and paint
7	Front bumper	Front bumper - Scratch(es) - Paint
8	Body	Body - Damage by hail - repair according to calculation

Wear and tear

No.	Component group	Description
1	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - No deduction
2	Rear bumper	Rear bumper - Scratch(es) - No deduction

The vehicle shows signs of wear commensurate with its age and use.



Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(Functional tests of driver assistance systems are not included in the scope of services!)
- a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Apparently, no repaired previous damage could be found on the vehicle.

Comments

Die beigefügte Reparaturkostenkalkulation wurde nach bestem Wissen und Gewissen im demontagefreien Zustand erstellt. Es können Mehrkosten und somit Abweichung der für den Hagelschaden ausgewiesener Reparaturkosten nicht ausgeschlossen werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

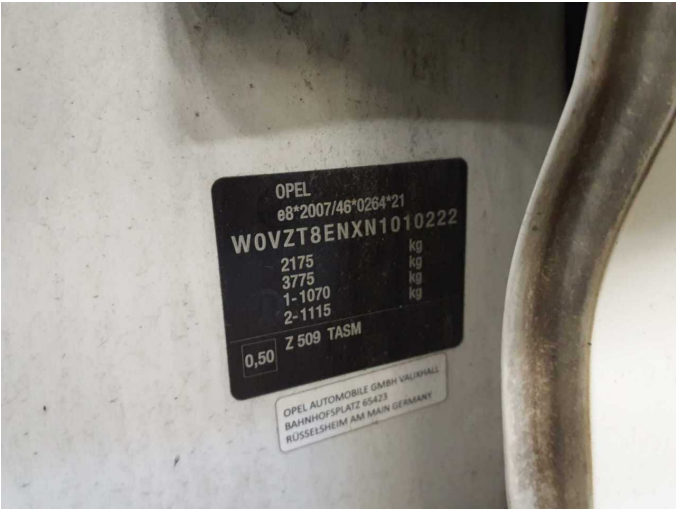


Figure 11: VIN



Figure 12: Mounted tyres

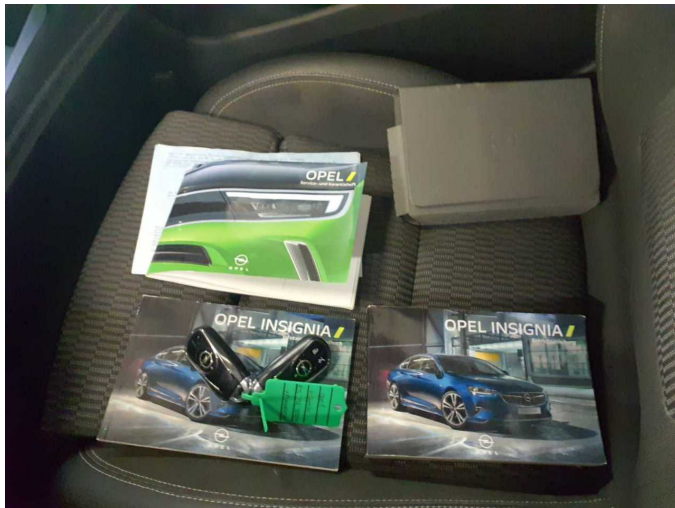


Figure 13: Documents

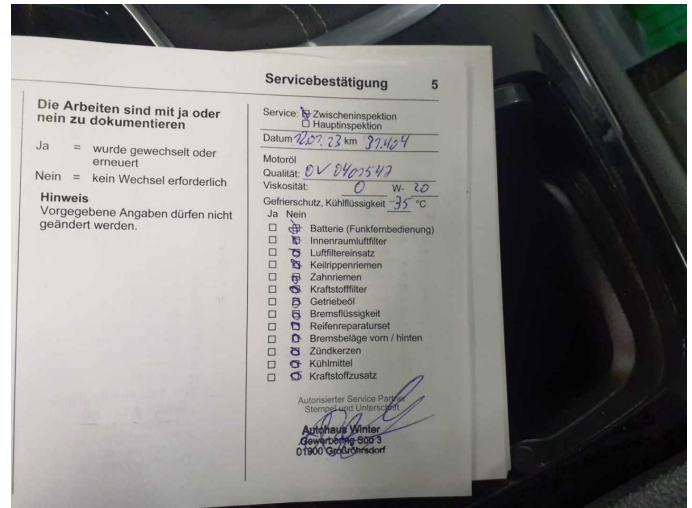


Figure 14: Documents

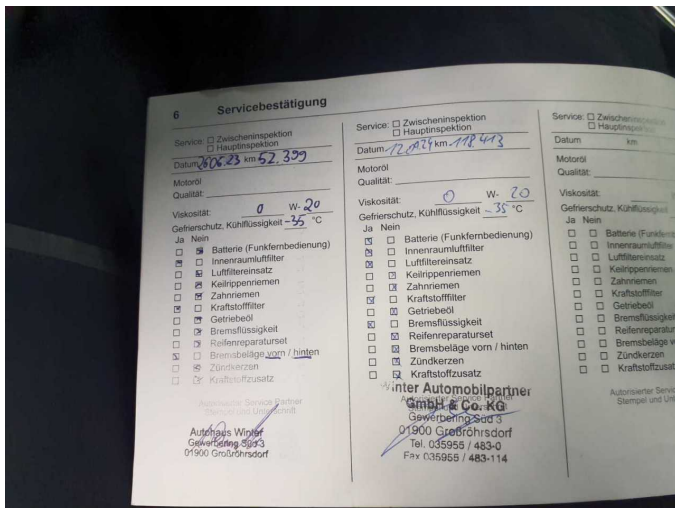


Figure 15: Documents



Figure 16: Documents

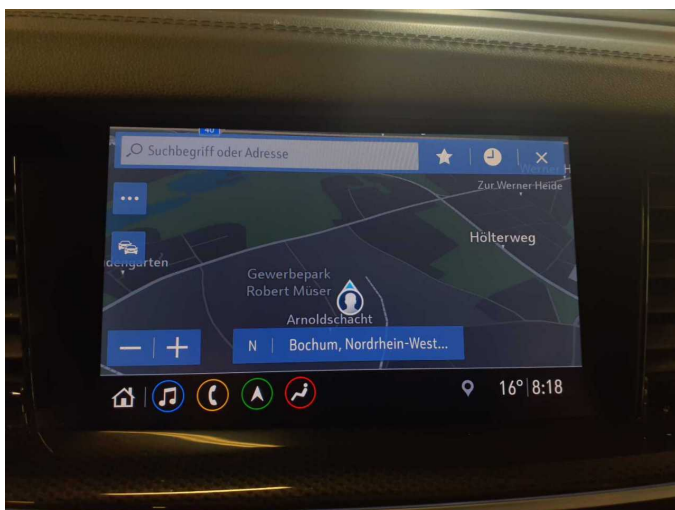


Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.

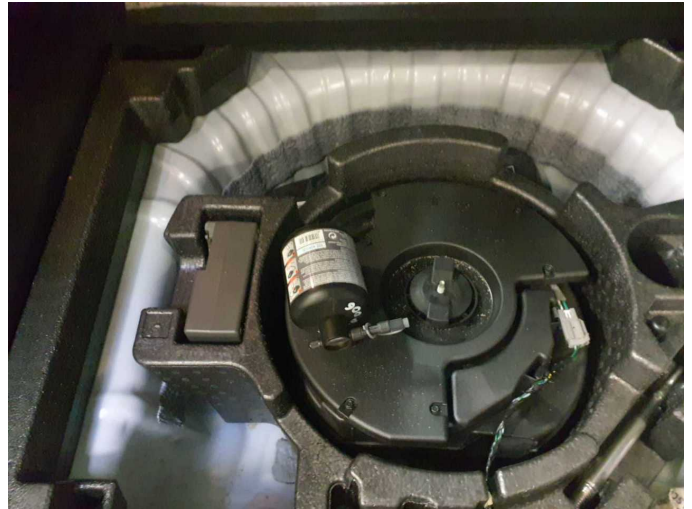


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

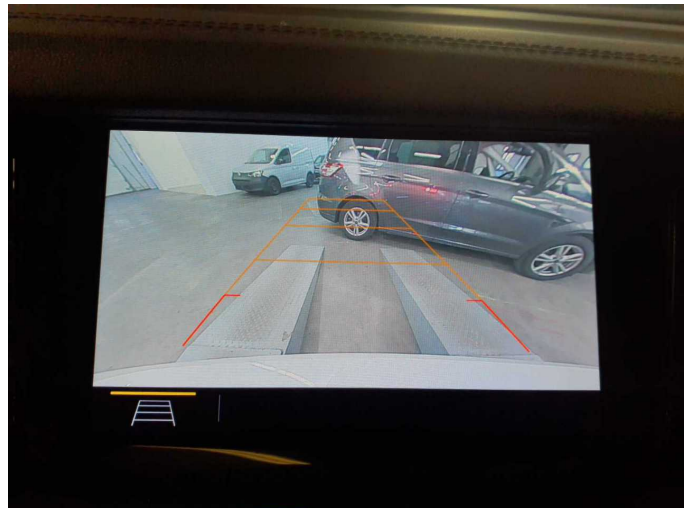


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.




Figure 31: Misc.



Damage 1: Trim / covers: Floor mats (Vorne links) - Holes - Replace



Damage 1: Trim / covers: Floor mats (Vorne links) - Holes - Replace

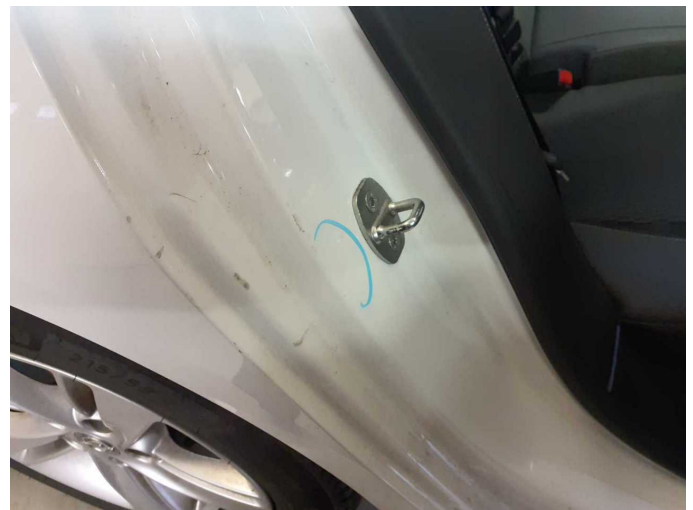

Damage 2: Side panel - rear right side: Sill ((Keine Kratzer nur Dreck)) - dent(s) - Smart repair



Damage 2: Side panel - rear right side: Sill ((Keine Kratzer nur Dreck)) - dent(s) - Smart repair



Damage 2: Side panel - rear right side: Sill ((Keine Kratzer nur Dreck)) - dent(s) - Smart repair



Damage 3: Door - front right side: Door - Dent / paintcoat damage - Smart repair



Damage 3: Door - front right side: Door - Dent / paintcoat damage - Smart repair



Damage 3: Door - front right side: Door - Dent / paintcoat damage - Smart repair



Damage 4: Body: Body (Umrandungen-Schriftzug) - Glued / labelled - De-glue / neutralise



Damage 4: Body: Body (Umrandungen-Schriftzug) - Glued / labelled - De-glue / neutralise



Damage 4: Body: Body (Umrandungen-Schriftzug) - Glued / labelled - De-glue / neutralise



Damage 4: Body: Body (Umrandungen-Schriftzug) - Glued / labelled - De-glue / neutralise




Damage 4: Body: Body (Umrandungen-Schriftzug) - Glued / labelled - De-glue / neutralise



Damage 4: Body: Body (Umrandungen-Schriftzug) - Glued / labelled - De-glue / neutralise



Damage 4: Body: Body (Umrandungen-Schriftzug) - Glued / labelled - De-glue / neutralise

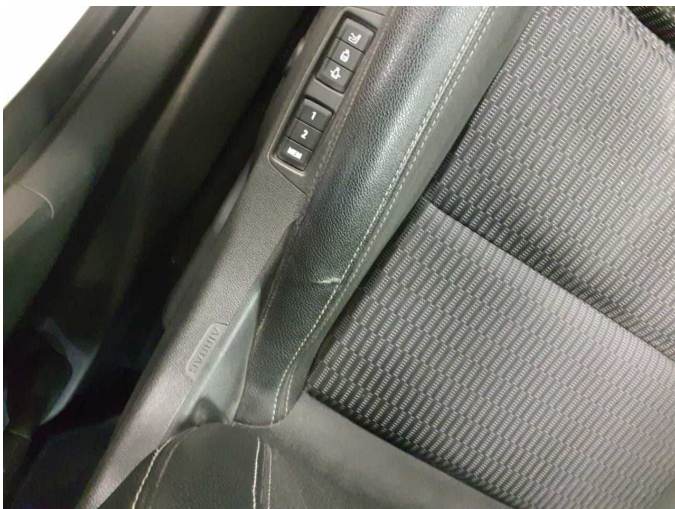

Damage 5: Seat - front: Seat cover - left side (+verschmutzt) - Holes - Smart repair



Damage 5: Seat - front: Seat cover - left side (+verschmutzt) - Holes - Smart repair



Damage 5: Seat - front: Seat cover - left side (+verschmutzt) - Holes - Smart repair



Damage 5: Seat - front: Seat cover - left side (+verschmutzt) - Holes - Smart repair



Damage 5: Seat - front: Seat cover - left side (+verschmutzt) - Holes - Smart repair



Damage 6: Boot lid / rear door: Boot lid - Deformed - Repair and paint



Damage 6: Boot lid / rear door: Boot lid - Deformed - Repair and paint



Damage 6: Boot lid / rear door: Boot lid - Deformed - Repair and paint



Damage 6: Boot lid / rear door: Boot lid - Deformed - Repair and paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 7: Front bumper: Front bumper - Scratch(es) - Paint




Damage 7: Front bumper: Front bumper - Scratch(es) - Paint



Damage 8: Body: Body - Damage by hail - repair according to calculation



Damage 8: Body: Body - Damage by hail - repair according to calculation

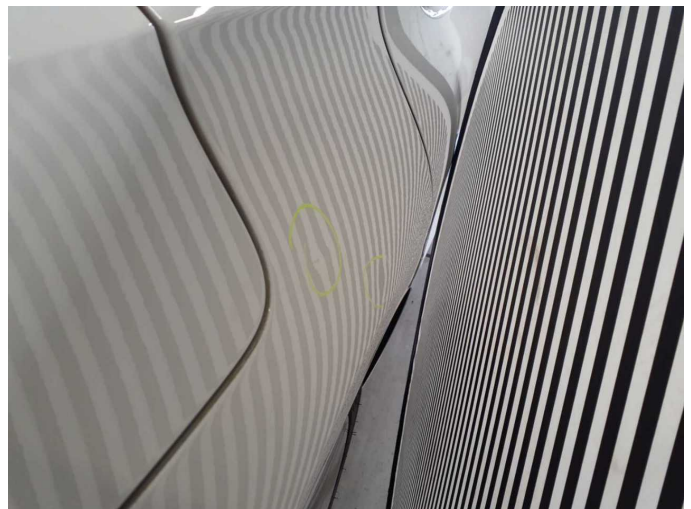

Damage 8: Body: Body - Damage by hail - repair according to calculation



Damage 8: Body: Body - Damage by hail - repair according to calculation




Damage 8: Body: Body - Damage by hail - repair according to calculation



Damage 8: Body: Body - Damage by hail - repair according to calculation



Damage 8: Body: Body - Damage by hail - repair according to calculation

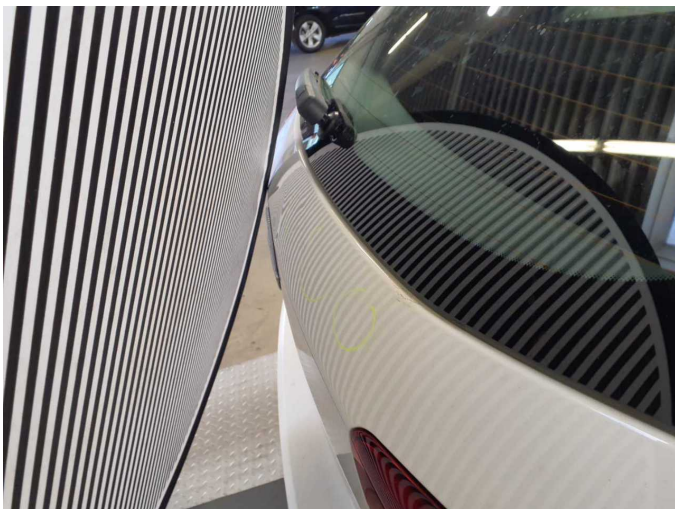

Damage 8: Body: Body - Damage by hail - repair according to calculation




Damage 8: Body: Body - Damage by hail - repair according to calculation



Damage 8: Body: Body - Damage by hail - repair according to calculation



Damage 8: Body: Body - Damage by hail - repair according to calculation

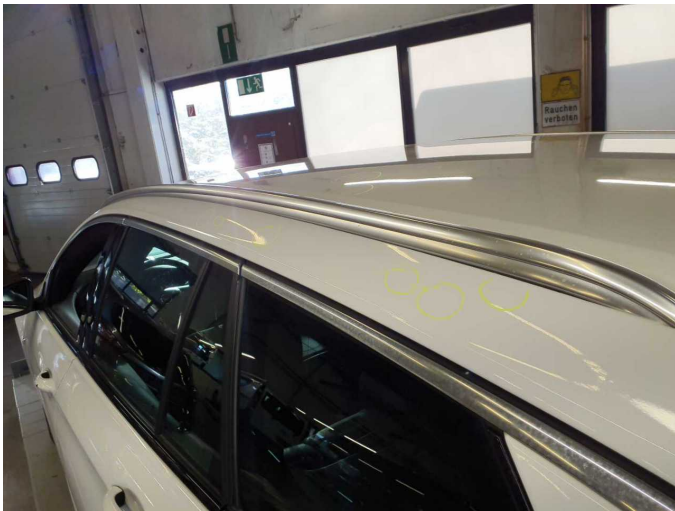

Damage 8: Body: Body - Damage by hail - repair according to calculation



Damage 8: Body: Body - Damage by hail - repair according to calculation



Damage 8: Body: Body - Damage by hail - repair according to calculation



Damage 8: Body: Body - Damage by hail - repair according to calculation



Damage 8: Body: Body - Damage by hail - repair according to calculation



Damage 8: Body: Body - Damage by hail - repair according to calculation



Damage 8: Body: Body - Damage by hail - repair according to calculation



Damage 8: Body: Body - Damage by hail - repair according to calculation



Damage 8: Body: Body - Damage by hail - repair according to calculation



Damage 8: Body: Body - Damage by hail - repair according to calculation



Damage 8: Body: Body - Damage by hail - repair according to calculation



Damage 8: Body: Body - Damage by hail - repair according to calculation



Damage 8: Body: Body - Damage by hail - repair according to calculation



Damage 8: Body: Body - Damage by hail - repair according to calculation



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VZT8ENXN1010222
Hersteller / Modell: OPEL OPEL Insignia Sports Tourer 1.5 Diesel Elegance

Datum	KM-Stand	Beschreibung
12.08.2025	133.521	Systemtest/Eigendiagnose
24.07.2025	132.270	HU + AU; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
27.06.2025	131.638	Bremsflüssigkeit; Bremsflüssigkeit ern; Kupplung ern; Systemtest/ Eigendiagnose
12.09.2024	118.412	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
29.02.2024	87.426	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Systemtest/Eigendiagnose
23.02.2024	86.596	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
16.11.2023	71.753	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
26.06.2023	52.399	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze v; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
12.01.2023	31.404	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges