



Expertise

Protocol number: 41294054
Order No. / Reference: 25128542
Inspection date: 29 Aug 2025

Manufacturer: Mercedes-Benz	Model: CLA 200 d Shooting Brake 8G-DCT Progressive
VIN: W1K1186121N146966	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz CLA 200 d Shooting Brake 8G-DCT Progressive	
Vehicle Identification number	W1K1186121N146966
Mileage (Read)	31,667 km
First registration	14 Aug 2020
Number of holders	1
Power / Engine displacement	110 kw / 1,950 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	POLARWEISS - UNILACK
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	White-Beige
Driving readiness	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / incomplete	Next maintenance in	-365 Tag(e)
Last maintenance on / at	08/2023 at 24,912 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	FT828144
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Performed	Engine function test	Performed
Driving readiness	Roadworthy		
Manufacturer key number/ type code number	2222 / AGV 00007		
Emission standard	EURO6;WLTP;AM;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,120 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 91W	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	225/45 R18 91W	Summer tyres on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R17 95V	Winter tyres on Light alloy	Dunlop	6mm / 6mm
2)	205/55 R17 95V	Winter tyres on Light alloy	Dunlop	7mm / 7mm

Legend: Tread depth information for tires on the left is in the first place, for tires on the right is in the second place on the axle in the direction of travel



Equipment

Standard equipment

- | | |
|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <ul style="list-style-type: none"> • ADAPTIVE BRAKE with HOLD function, hill start assist, pre-filling and dry braking in wet conditions • Airbag: Kneebag for driver • Airbag: Windowbag for driver and front passenger • Traction control (ASR) • ATTENTION ASSIST • Basic services • Brake assist, active • Double cup holders at the front • Third brake light in LED technology • ECO start-stop function • Electronic Stability Program (ESP) • 4-way electric window lifter • Luggage net on driver and passenger backrest • Transmission: Automatic 8G-DCT • Lockable glove compartment • Interior headliner fabric black • THERMATIC automatic climate control • Front headrests height adjustable • Steering wheel shift paddles • Mercedes-Benz emergency call system • Net in the passenger footwell • Package: Seat comfort • Radio: MBUX multimedia system • Radio accessories: Communication module (LTE) for the use of Mercedes me connect services • Tire pressure monitoring (TPMS) • Windscreen wipers with rain sensor • Seats: iSize child seat anchorages with Top Tether on the outer seats • Lane Keeping Assist, active • socket (12 V) • Cruise control • Pre-installation for vehicle monitoring • High-visibility vest for drivers • Central locking | <ul style="list-style-type: none"> • Airbag for driver and front passenger • Airbag: Automatic passenger airbag deactivation • Airbag: Sidebag for driver and front passenger • Anti-lock braking system (ABS) • Armrest for driver and passenger foldable • Exterior mirrors left and right, heated and electrically adjustable, painted in body color • diesel particulate filter • tachometer • DYNAMIC SELECT • Door sills with "Mercedes-Benz" lettering • Chassis: Comfort chassis • Electric parking brake • Speed Limit Assistant • Halogen headlights with integrated LED daytime running lights • KEYLESS-GO start function • Rear headrests (3) • Paint finish: Uni • Steering wheel: Multifunction sports steering wheel in leather • Package: Light and Vision Package • Radio: Advanced functions MBUX • Radio accessories: Digital radio (DAB) • Radio accessories: USB interface in spontaneous storage & 2 USB interfaces in the rear center console • Gear lever with additional elements in silver chrome • CLA-Class seat belts • Seats: Comfort seats • Seats: Seat backrests in the rear can be folded down 40:20:40 • Bumpers in body color • Touchpad • Pre-installation for vehicle setup • Electronic immobilizer • Carbon-look decorative elements |
|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|--------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|

Extra equipment

- | | |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| <ul style="list-style-type: none"> • Storage compartment in center console with roller blind • Velour floor mats in black • Package: KEYLESS-GO Comfort (ShB) (with KEYLESS-GO and HANDS-FREE ACCESS - EASY-PACK tailgate with electric operation for opening and closing) • Package: Cargo compartment (consisting of: - 12V socket - Cargo position of the rear seat backrests - Net on the left and right sides - Reversible mat) • Upholstery: ARTICO man-made leather for sports seat | <ul style="list-style-type: none"> • Vehicle key in white high gloss with decorative frame • Package: Business (Hard Drive Navigation - Smartphone Integration - Traffic Sign Assistant - Car Sharing Pre-installation - Navigation Connectivity Package - Seat Heating for Driver and Front Passenger - Active Parking Assist with PARKTRONIC) |
|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|-------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|



- Radio accessories: Advanced sound system (with 10 speakers and 225 watts of system power)
- Seats: Driver's seat electrically adjustable with memory function (including exterior mirrors with parking position)
- Seat heating for driver and front passenger
- Phone accessories: Smartphone integration (consisting of Apple CarPlay and Android Auto)
- Blind Spot Assist
- Partition net for luggage compartment separation and occupant protection
- Package: Multicontour Seat Package (multicontour seats with inflatable air chambers in the lower seat backrest and side restraints - massage effect in the lumbar region through pulsating air chambers of the lumbar support - electrically adjustable lumbar support provides additional support for the spine - recommended by the Campaign for Healthy Backs (AGR))
- Phone accessories: Multifunctional telephony (wireless charging system in front - connects smartphone to the vehicle's external antenna - Near Field Communication (NFC))
- Traffic sign recognition
- Elimination of type marking on the trunk lid

Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate Part 2 (letter) was available, but the registration certificate Part 1 (certificate) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was verified during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and a pit were available for examining the vehicle.
Test drive	A test drive was performed with the described vehicle.
Engine function test	An engine test run was performed.
Driving readiness	The vehicle was drivable at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Side panel - rear left side	Side panel - dent(s) - Smooth repair work
2	Headlight	Headlight - left side - Scratch(es) - Loss in value
3	Headlight	Headlight - right side - Scratch(es) - Loss in value
4	Misc.	Inspection / maintenance - Due - Replace
5	Front bumper	Front bumper - Dent / paintcoat damage - Repair and paint
6	Rear bumper	Rear bumper (Verformt) - Scratched - Repair and paint

Wear and tear

No.	Component group	Description
1	Door - front left side	Door edge - Scratch(es) - No deduction
2	Vehicle glazing	Windscreen with lane departure assistant - Stone chips - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side right, Provided by user / customer, from 8 Sept 2021	9.161,98 €

Repainting

No.	Repainting
1	Door - front right side, Professionally carried out, Invoice of repair done Non-existent



Paint coat thickness measurement

Door - front right side

173 µm

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(Functional tests of driver assistance systems are not included in the scope of services!)
- a photo documentation of the vehicle

Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: interior 360° view



Figure 10: Cargo area

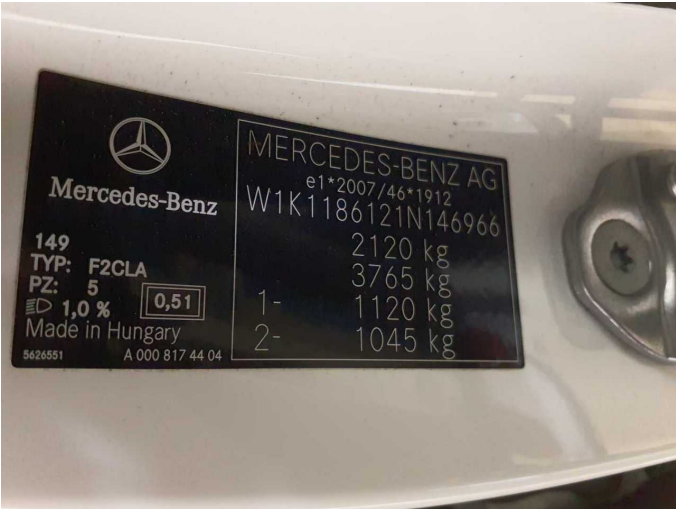


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.




Figure 24: Misc.



Figure 25: Misc.




Damage 1: Side panel - rear left side: Side panel - dent(s) - Smooth repair work

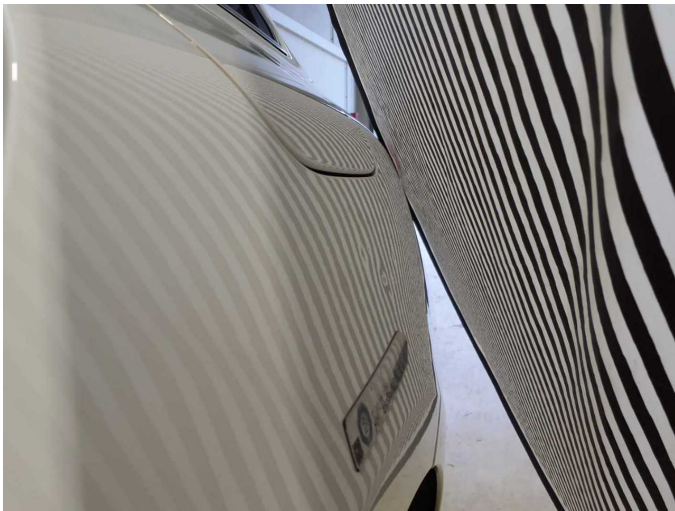


Damage 1: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 1: Side panel - rear left side: Side panel - dent(s) - Smooth repair work

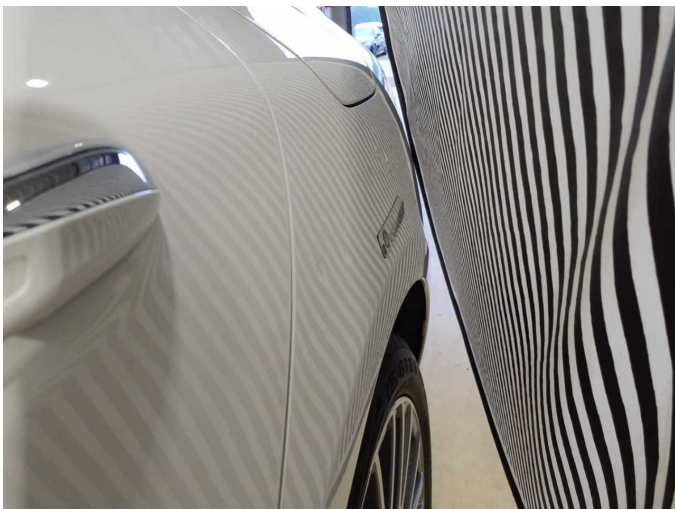


Damage 1: Side panel - rear left side: Side panel - dent(s) - Smooth repair work

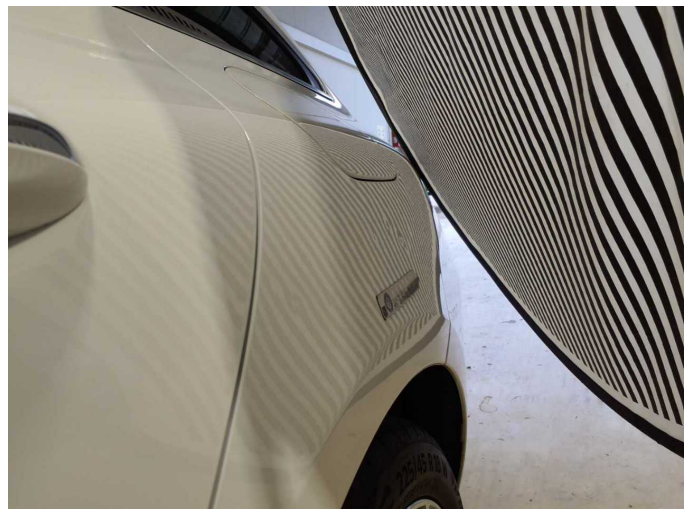

Damage 1: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 2: Headlight: Headlight - left side - Scratch(es) - Loss in value

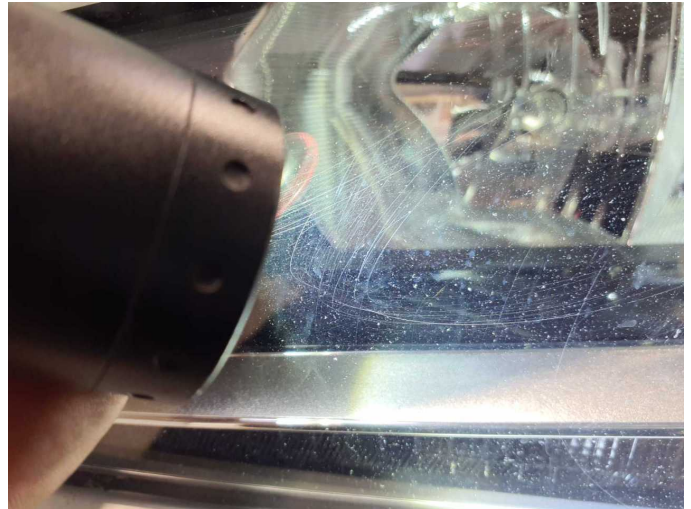

Damage 2: Headlight: Headlight - left side - Scratch(es) - Loss in value



Damage 3: Headlight: Headlight - right side - Scratch(es) - Loss in value



Damage 3: Headlight: Headlight - right side - Scratch(es) - Loss in value



Damage 4: Misc.: Inspection / maintenance - Due - Replace



Damage 5: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Damage 5: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Damage 5: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint




Damage 5: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Damage 5: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint



Damage 5: Front bumper: Front bumper - Dent / paintcoat damage - Repair and paint

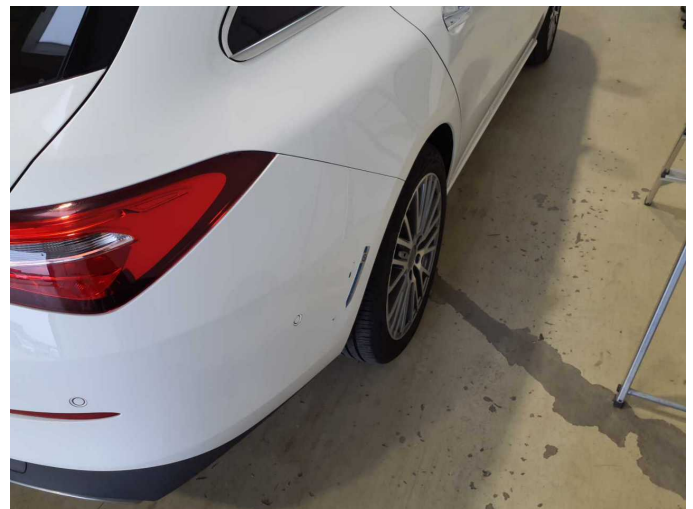

Damage 6: Rear bumper: Rear bumper (Verformt) - Scratched - Repair and paint



Damage 6: Rear bumper: Rear bumper (Verformt) - Scratched - Repair and paint




Damage 6: Rear bumper: Rear bumper (Verformt) - Scratched - Repair and paint



Damage 6: Rear bumper: Rear bumper (Verformt) - Scratched - Repair and paint



Damage 6: Rear bumper: Rear bumper (Verformt) - Scratched - Repair and paint

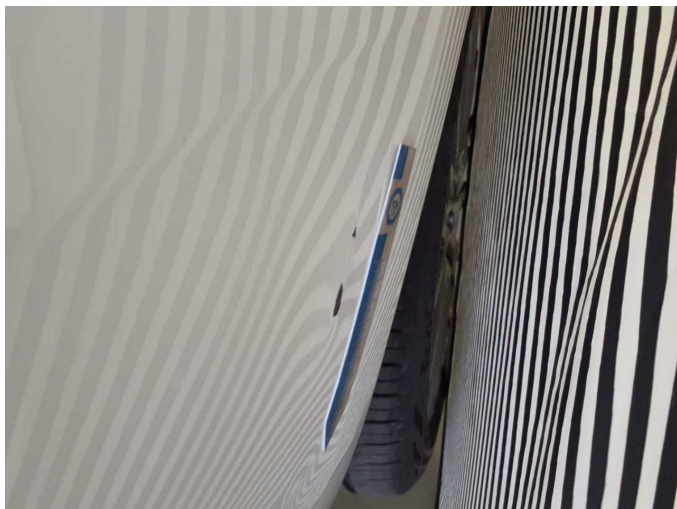

Damage 6: Rear bumper: Rear bumper (Verformt) - Scratched - Repair and paint



Repainting 1: Door - front right side



Repainting 1: Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1K1186121N146966

Hersteller / Modell: MERCEDES-BENZ MB CLA 200 d Shooting Brake 8G-DCT
Progressive

Datum	KM-Stand	Beschreibung
29.09.2023	24.912	HU + AU
28.08.2023	24.912	Regelwartungsdienst