



MERCEDES A-Klasse: 1XMY280

Vinnnumber:	W1K1770031J201932	Versionname:	A-Klasse A 180 d Business Solution 85kW/116pk
First Registrationdate:	14/02/2020	Fiscalpower:	5D/P Auto-7
Expertise Mileage:	111570	Power Kw:	
Bodytype:		Body colour	Dark Grey
Gearbox:	Automatic	Type of rims (mounted)	Aluminium
Transmission:	Front	Parking lot	b210
Fueltype:	Diesel		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		
Bodywork	Clean		
Interior	Clean		

Options

Number of keys total	2	Radio
Number keys remote	2	Front parking sensors
Windows electric F		Rear parking sensors
Windows electric R		
Cruise Control		
Steering wheel multifunctional		
Seats F heated		
Alarm		
Navigation with screen		
Airco electronic		
Rims alloy		

Limited Technical Inspection

Idle position	OK	Sound engine	OK
Engine startingtime	OK	Clutch test	OK
Exhaust gass	OK	Transmission	OK

Degree of wear

	205/60/16/96 H			
Summer tyres:	Fr.L.	Uniroyal: 1 mm	Fr.R.	Uniroyal: 1 mm
	Re.L.	Uniroyal: 2 mm	Re.R.	Uniroyal: 2 mm
Tyre profile depth FL				1.0
Tyre profile depth FR				1.0
Tyre profile depth RL				2.0
Tyre profile depth RR				2.0
Tyre size FL				205/60 R 16 96 H
Tyre size FR				205/60 R 16 96 H
Tyre size RL				205/60 R 16 96 H
Tyre size RR				205/60 R 16 96 H
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				All seasons
Tyre type RR				All Seasons
Tyre make FL				265
Tyre make FR				265
Tyre make RL				265
Tyre make RR				265

Assistance equipment

Number of charging cables (normal)	0	Compressor	No
------------------------------------	---	------------	----

Seat cover FL, Worn, Acceptable




Interior, Smell, Ozone treatment



Floor covering FL, Burned, Smart repair



Interior, Dirty, Cleaning

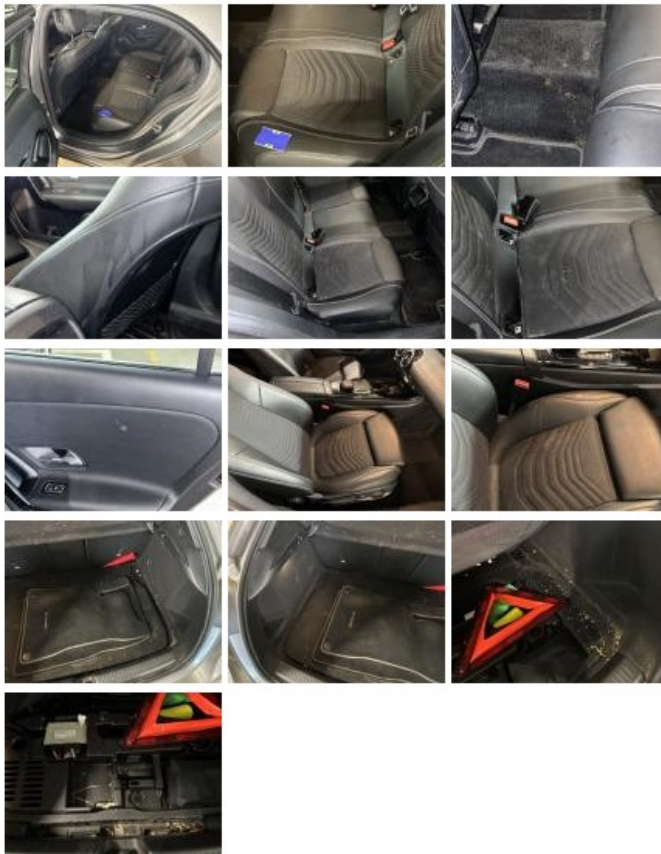

Door panel RR, Scratch(es), Acceptable



Backrest cover FR, Tear, Check



Door panel FR, Scratch(es), Acceptable



Bumper F, Scratch(es), Repair and paint (complete)



Wing RL, Dent(s), Acceptable




Roof pillar L, Dent(s), Acceptable




Compressor, Missing, Replace



Boot lid covering R, Scratch(es), Smart repair

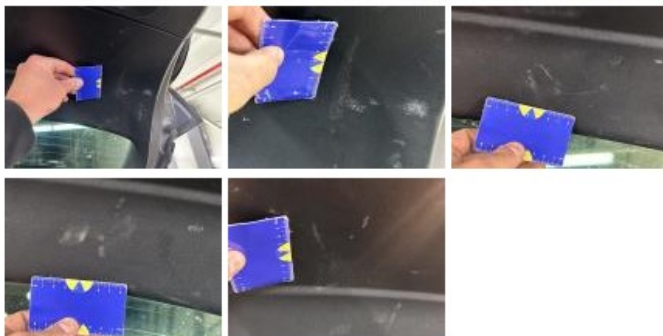

Bumper R, Deformed / Strained, Repair and paint (complete)

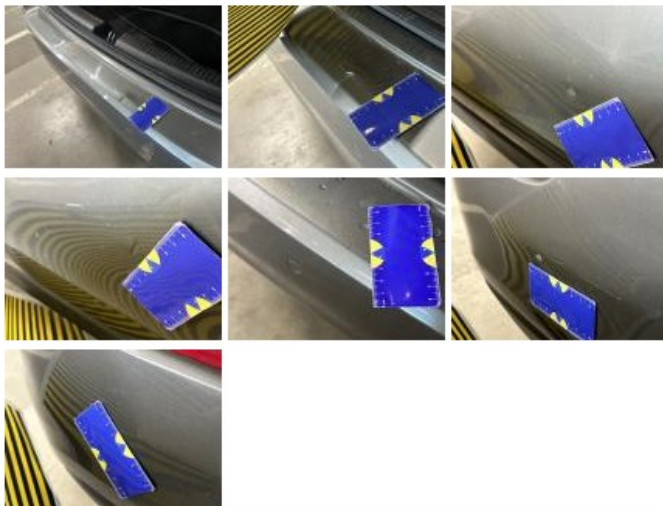

Tailgate / Boot, Dent(s), Paintless dent repair






Wing FR, Dent(s), Spot repair



Outside rear-view mirror housing R, Scratch(es), Acceptable

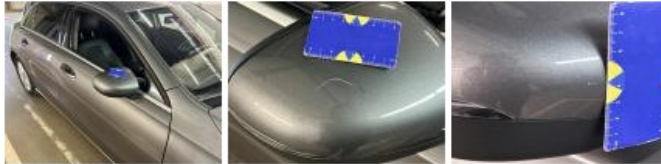


Outside rear-view mirror base R, Scratch(es), Acceptable




Outer sill R, Dent(s) and scratch(es), Spot repair




Door RR, Dent(s), Acceptable

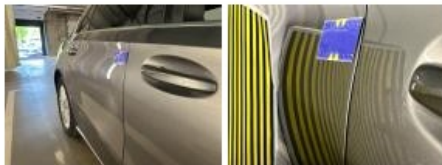


Wing RR, Bad repair, Check

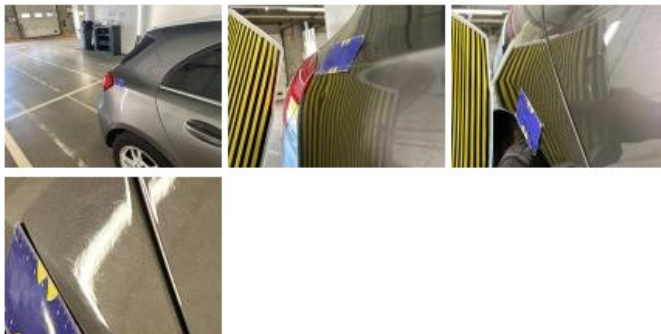

Roof pillar R, Dent(s), Acceptable

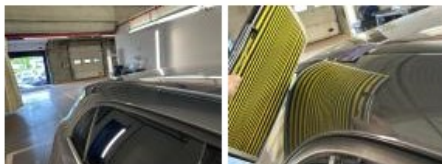

Roof, Chemical polution, Polish

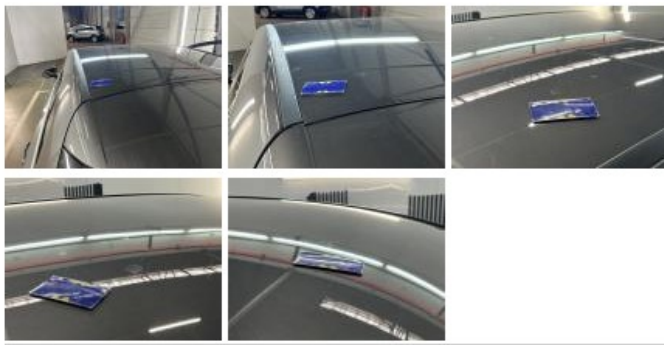

Bodywork, Not original part, Check



Bodywork, Damaged, Check

