



Expertise

Protocol number: 39177877
Order No. / Reference: 24611579
Inspection date: 3 Apr 2025

Manufacturer: Mercedes-Benz	Model: GLA 180 d 8G-DCT
VIN: W1N2477101J376341	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLA 180 d 8G-DCT	
Vehicle Identification number	W1N2477101J376341
Mileage (Read)	75,010 km
First registration	8 Mar 2022
Number of holders	1
Power / Engine displacement	85 kw / 1,950 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Polarweiß
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Grey
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	296 Tag(e)
Last maintenance on / at	01/2025 at 73,368 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available
		Letter No.	GF807624
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	Sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / ATH 00049		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	Fine dust sticker	
Permitted total weight	2,135 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tyres on Light alloy	Pirelli	3mm / 3mm
2)	215/65 R17 99H	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99V	Summer tyres on Light alloy	Michelin	3mm / 3mm
2)	215/65 R17 99V	Summer tyres on Light alloy	Michelin	5mm / 5mm

Legend: Tread depth indication for left-hand tires in first place, for right-hand tires in second place on the axle in the direction of travel

Equipment

Standard equipment

- ADAPTIVE BRAKE with HOLD function, hill start assist, pre-filling and dry braking in wet conditions
- Airbag: Kneebag for driver
- Airbag: Windowbags (left/right)
- Active Brake Assist
- Anti-lock braking system (ABS)
- Armrest in center console for driver and front passenger with integrated storage compartment
- Outside temperature display
- roof rails in polished aluminum
- diesel particulate filter
- tachometer
- DYNAMIC SELECT (DYNAMIC SELECT rocker switch in the center console for selecting four different driving programs: ECO, Comfort, Sport and Individual - the driving programs affect the engine, transmission, steering, ECO start-stop function, air conditioning or, depending on the equipment/model, the chassis (with adjustable damping) - additional off-road driving program, adjustable via DYNAMIC SELECT, which adjusts the power delivery and ABS control for light terrain away from paved roads, only in conjunction with the off-road technology package (430))
- Transmission: 8G-DCT dual clutch transmission automatic 8-speed
- halogen headlights including integrated LED daytime running lights
- glove compartment illuminated
- Rear window wiper with interval control (and automatic activation when reversing)
- Interior headliner fabric crystal grey
- KEYLESS-GO start function
- Climate: THERMATIC automatic climate control (1-zone air conditioning - automatically controlled air distribution - recirculation function - tunnel circuit in conjunction with navigation system - fine dust filter)
- 5-way headrests (height and length adjustable for driver and front passenger, height adjustable and middle retractable in the rear)
- Steering wheel: Multifunction sports steering wheel in leather (The elegant leather cover makes the multifunction sports steering wheel even more high-quality. This makes it a highlight in the interior. As a driver, you benefit in two ways: what looks good must also feel good. The touch control buttons on the left and right operate a wide range of functions such as navigation, telephony or entertainment. Last but not least, you can set the speed or distance control: everything under control without taking your hands off the steering wheel.)
- Package: Non-smoking (incl. 12 V socket and storage compartment at the front)
- Upholstery: ARTICO imitation leather/fabric
- Adaptive brake light flashing
- Airbag for driver and front passenger
- Airbag: Sidebag for driver and front passenger (combined thorax/pelvis bag)
- Active Lane Keeping Assist
- Traction control (ASR)
- Automatic passenger airbag deactivation
- Heated exterior mirrors on the left and right, electrically adjustable from the inside (with aspherically curved mirror glass and integrated indicator light)
- double cup holder
- Third brake light in LED technology
- ECO start-stop function
- door sills with "Mercedes-Benz" lettering
- Electronic Stability Program (ESP) (ESP Curve Dynamics Assistant)
- Chassis: Comfort chassis
- 4-way electric window lifter
- electric parking brake
- windshield laminated glass
- Velour floor mats
- Speed limit assistant (The speed limit assistant makes it easy for you to comply with the regulations and avoid unnecessary traffic tickets. The system shows what is permitted: It can detect the current speed limit via the camera and display it in the instrument cluster. Additional restrictive signs in special weather situations such as wet conditions are also detected.)
- Heated rear window with timer control
- ISOFIX child seat anchors with TopTether in the rear
- Mechanical child safety lock (in the rear doors and electric for rear window lifters)
- Communication module (LTE) for the use of Mercedes me connect services (communication module with permanently installed SIM card of the LTE mobile communications standard - two mobile communications antennas)
- Load compartment cover
- Steering column mechanically adjustable in height and length
- Steering: parameter steering (with speed-dependent steering power assistance)
- Mercedes-Benz emergency call system
- Navigation accessories: Advanced functions MBUX (personalization (profiles) and prediction functions - LINGUATRONIC with natural language understanding - activation via "Hey Mercedes" - WiFi hotspot - Internet radio)



- Radio: MBUX multimedia system (instrument display with 17.78 cm diagonal - media display with 17.78 cm diagonal and touch function - touch control buttons on the steering wheel - radio - USB interface in the center console under the armrest - Bluetooth telephony with contact transfer and audio streaming of music files - display of vehicle functions (driver assistance systems, driving programs and vehicle settings) - favorites storage - smartphone-related voice control - activated by long pressing the voice button on the steering wheel)
- Remote Services Plus (The Remote Services Plus package turns mobility into a new experience and brings more comfort and safety. Status queries provide information about the range. You can operate certain functions remotely and locate your vehicle. Services such as maintenance management coordinate service appointments and save you valuable time.)
- Seats: Folding seat backrests in the rear (40/20/40 split)
- Seats: Front seats mechanically adjustable (Good seating comfort for you as standard - the standard seat is upholstered in a high-quality fabric combination. You can adjust your individual seating position manually in the longitudinal direction and in height.)
- High-visibility vest for drivers
- Electronic immobilizer (including locking system with radio remote control in the electronic key in chrome look, optical locking feedback and emergency opening (recognized by AZT and TÜV))
- carbon-look trim elements

Extra equipment

- Active Parking Assistant with PARKTRONIC (The Active Parking Assistant with PARKTRONIC can not only find parking spaces - it also supports you when parking and reversing. It assists you with steering and, in vehicles with automatic transmission, also with accelerating, braking and changing gear.)
- Package: Business (hard drive navigation - smartphone integration - traffic sign assistant - preparation for digital key handover - connectivity package navigation - seat heating for driver and front passenger - parking assistant with PARKTRONIC - preparation for live traffic information)

- Package: Light and visibility package (roof control unit "4 light stones" (including glasses compartment) - interior light/reading light in rear in holding plate (rear/left/right) - touch pad lighting (front) - reading lights (front/left/right), console lighting - make-up lights (front/left/right) - signal and ambient light - signal exit light (front/left/right) - handle shell/pull handle lighting (front/rear/left/right) - footwell lighting (front/left/right) - cup holder/storage compartment lighting - spontaneous storage compartment lighting)
- Radio accessories: Digital radio
- Radio accessories: Touchpad
- rain-light sensor
- Tire pressure control (constantly monitors the pressure of all four tires)
- Wheels: 43.2 cm (17") light alloy wheels 4-way in 10-spoke design (vanadium silver painted with 215/65 R 17 on 6.5 J x 17 ET 44)
- Service interval display ASSYST
- GLA-Class seat belts (3-point seat belts including mechanical belt height adjustment - pyrotechnic retractor tensioning and belt force limitation - electrically reversible belt retractor tensioner)
- Cruise control (Drive in a relaxed and fuel-efficient manner, especially on longer journeys. To do this, select your desired speed and your vehicle will take over the cruise control. In addition to the travel speed, the limiter helps you to adhere to a maximum speed. This increases road safety and protects you from expensive traffic tickets.)
- Heat-insulating glass, green all around (rear window tempered safety glass (ESG))
- Central locking (with interior switch, automatic locking (can be switched off) and crash sensor with emergency opening)

- trailer hitch with ESP trailer stabilization
- Paintwork: Special paintwork Uni
- LED high-performance headlights (with high beam and low beam in LED technology, multifunctional light guide with daytime running light, position light and direction indicator, "Coming Home" function with blue welcome light and rear lights in LED technology with lower glare effect)
- heated windshield washer system
- Elimination of type marking on the luggage compartment lid



Brief expert findings

Documents submitted	At the time of the inspection, the registration certificate part 2 (letter) was available, but the registration certificate part 1 (certificate) was not available. (Copy)
VIN comparison	The vehicle identification number (VIN) was read and its conformity with the documents submitted was established during the inspection by the undersigned.
Inspection	The inspection conditions were sufficient to assess the vehicle. The inspection was carried out using the lighting conditions provided by the photo system included in the report. Lifting equipment and a pit were available for examining the vehicle.
Test drive	No test drive/maneuvering was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair

Wear and tear

No.	Component group	Description
1	Wheel / tyres	Tyre - front - Does not meet the leasing specifications - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Front bumper	Front bumper - Stone chips - No deduction
4	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear commensurate with its age and use.

Order/Scope of order

The order was placed to prepare a sales report for the vehicle described. This includes the following:

- Description of core relevant information about the vehicle
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of previous damage, unrepaired previous damage, repainting
- a brief visual or functional inspection of the equipment details if possible.
(*Functional tests of driver assistance systems are not included in the scope of services!*)
- a photo documentation of the vehicle



Basis for the order

This product is based on the Alphabet Fuhrpark GmbH guidelines for vehicle returns and valuations. The expert makes the explicit findings in each individual case objectively within the framework of the specified standards based on his or her own expertise.

The vehicle inspection takes place in a disassembled state.

Damage or defects that can only be detected during disassembly/diagnosis work or through advanced knowledge remain within the scope of the prognosis risk. An extended risk exists for concealed defects caused by fraudulent deception and not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted according to the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which in their nature and severity slightly exceed normal use but do not constitute unacceptable damage will be documented and identified under signs of use if necessary.

Damage or defects which, according to the underlying standard, can no longer be attributed to normal use or wear and tear are listed in the product under "Depreciating Factors".

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Neither repaired nor non-repaired previous damage to the vehicle could be determined.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

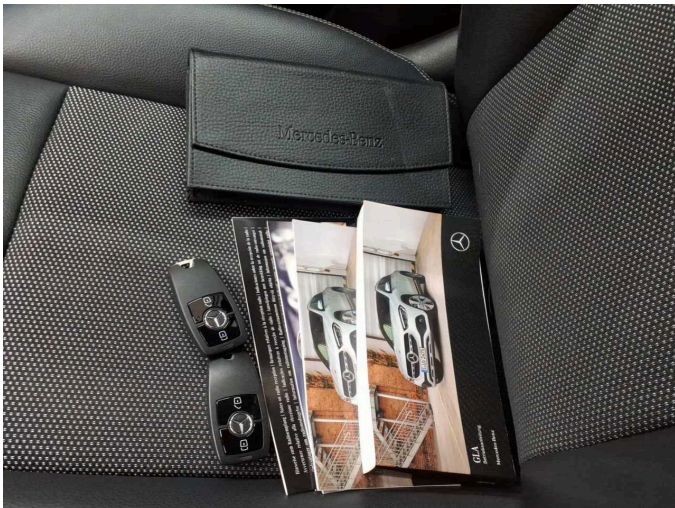


Figure 13: Documents

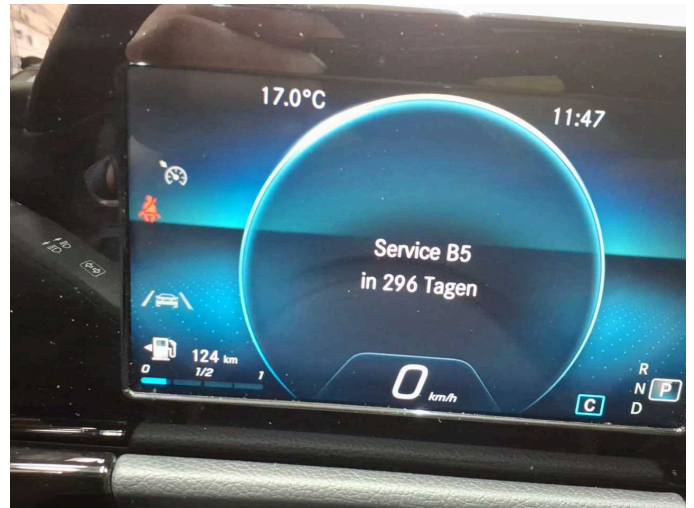


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

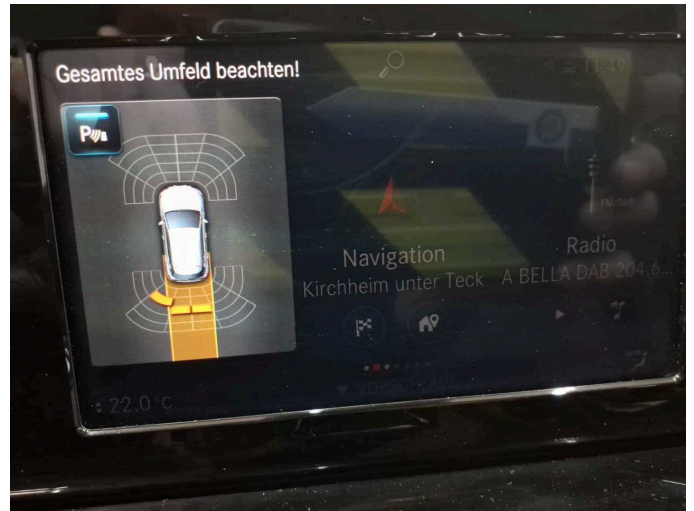


Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.




Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.

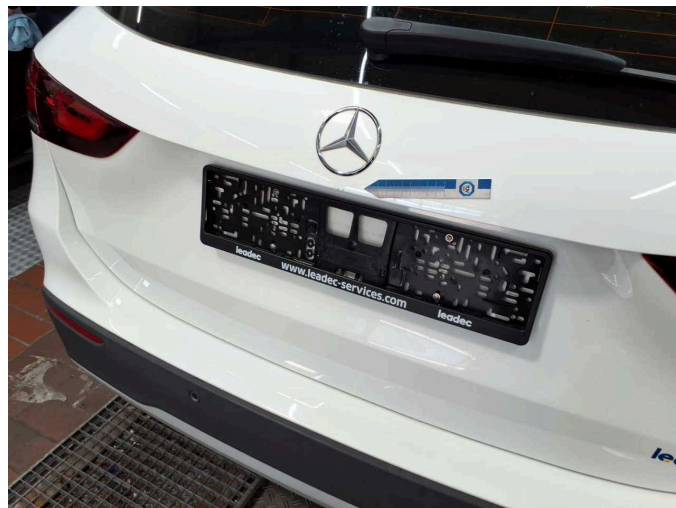

Damage 1: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 1: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair