



# AUDI Q5

## Q5 3.0 TFSI quattro tiptronic

VIN NO WA1D7AFPXGA040382  
Registration Number PXGA040382



|              |                      |                         |                          |
|--------------|----------------------|-------------------------|--------------------------|
| MOT Date     | Number of Owners     | Number of Keys          | Odometer Reading         |
| 2025-06-01   | 3                    | 1                       | 141629 km                |
| Last Service | Last Service Mileage | First Registration Date | Country First Registered |
| 2022-03-09   | 98220                | 2015-11-03              | Germany                  |

### Inspection Report Summary

|                         |                        |                |                 |
|-------------------------|------------------------|----------------|-----------------|
| Customer                | BCA Online             | Report Number  | P20250826095518 |
| Inspection Date / Place | 2025-08-26 / BCA Neuss | Cosmetic Grade | 5               |

### Vehicle Summary



|                    |        |                        |                           |
|--------------------|--------|------------------------|---------------------------|
| Vehicle Condition  | Runner | VAT Type               | Margin                    |
| Fuel Type          | Petrol | Gearbox Type           | Automatic                 |
| Colour             | Grey   | Engine Size (cc)       | 2995                      |
| Engine Size        | 3.0    | No of Doors            | 5                         |
| Body Type          | SUV    | Drive Train            | All-Wheel-Drive permanent |
| Seat Colour        |        | No of Seats            | 5                         |
| Seat Covering Name | Braun  | Seat Covering          | Synthetic Leather         |
| Charging Cables    |        | NEDC CO2 Rating (q/km) | 199                       |

### Vehicle History & Documents

|                        |         |                      |               |
|------------------------|---------|----------------------|---------------|
| Service Book Available | Present | Next Service Mileage | km            |
| Previous Usage         |         | Imported             | United States |
| Manufacturer Warrenty  |         |                      |               |





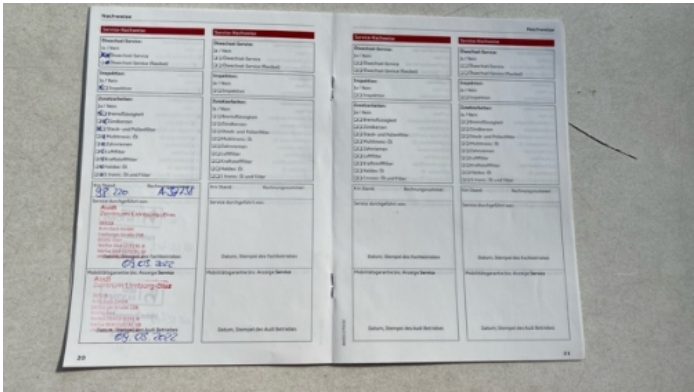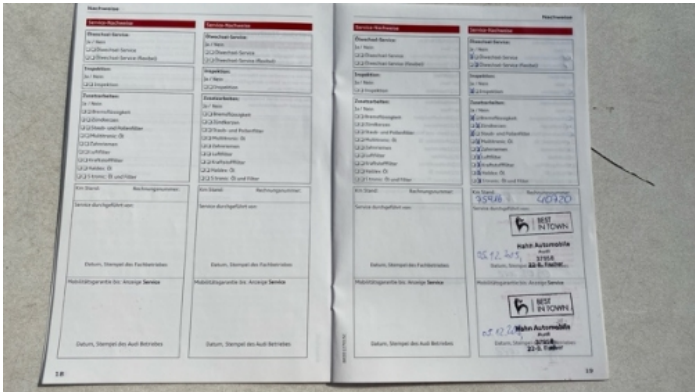



Equipment

|                               |                                   |                               |                       |
|-------------------------------|-----------------------------------|-------------------------------|-----------------------|
| Tinted Glass                  | Alloys wheels                     | Bluetooth telephone interface | Front fog lamps       |
| Heated wing mirrors           | Remote central locking            | Roof rails                    | Stability control     |
| Xenon headlamps               | Electrically adjustable seats     | Electrictailgate              | Radio                 |
| Airbag Status                 | Anti-lock braking                 | Cruise control                | Front parking sensors |
| Remote adjusting wing mirrors | Reversing Camera                  | Satellite navigation          | Sunroof               |
| CD Player                     | Electrically folding wing mirrors | Leather steering wheel        | Rear parking sensors  |


Equipment Details

|                  |                           |                  |                   |
|------------------|---------------------------|------------------|-------------------|
| Air Conditioning | Dual Zone Climate Control | Alloy Wheel Size | 19                |
| Seat Heating     | Front                     | Sunroof Type     | Opening Panoramic |


Wheels & Tyres

|                        |   |                       |   |
|------------------------|---|-----------------------|---|
| Right Front Tyre Depth | 2 | Left Front Tyre Depth | 2 |
| Right Rear Tyre Depth  | 3 | Left Rear Tyre Depth  | 3 |

## 22 Schäden

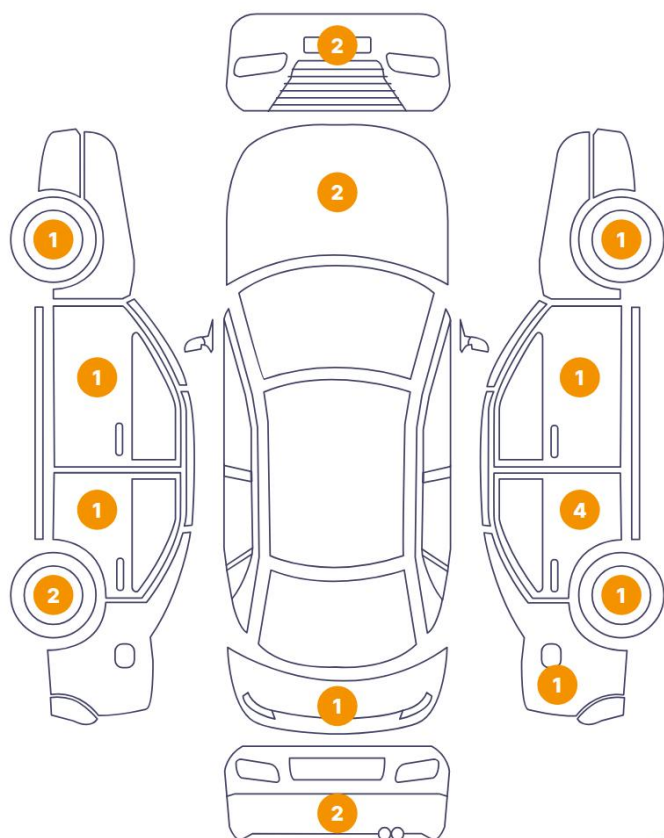

## 2 Schäden

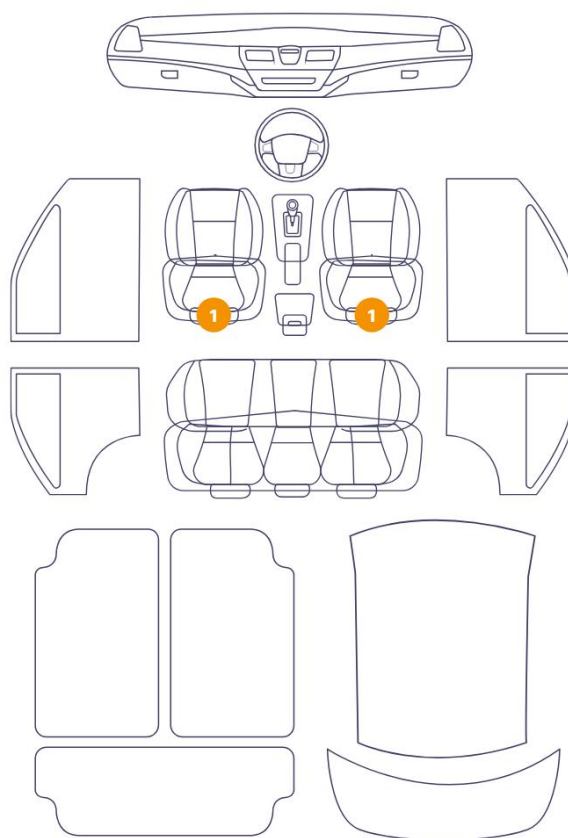

2

7/14 - Report Number P20250826095518

|    |                            |                                 |
|----|----------------------------|---------------------------------|
| 14 | Rim / Back Left            | Out of Bodywork / Scratch       |
| 15 | Corner Bumper / Back Left  | Paint / Scratch / Scuff         |
| 16 | Tailgate                   | Paint / Scratch / Scuff         |
| 17 | Corner Bumper / Back Right | Paint / Scratch / Scuff         |
| 18 | Rim / Back Right           | Out of Bodywork / Scratch       |
| 19 | Side Panel / Back Right    | Bodywork / Dent / Dent          |
| 20 | Door / Back Right          | Paint / Scratch / Scuff         |
| 21 | Door / Back Right          | Paint / Scratch / Scuff         |
| 22 | Door / Back Right          | Bodywork / Dent / Dent          |
| 23 | Rim / Front Right          | Out of Bodywork / Scratch       |
| 24 | Tire / Back Left           | Bodywork / Poor Previous Repair |



1. Seat / Front Left  
Interior / Scratched -



2. Seat / Front Right  
Interior / Scratched -



3.  
Bodywork / Breakage -



4.  
Bodywork / Breakage -



5. Hood  
Paint / Poor Previous Repair -



6. Door / Front Left  
Paint / Poor Previous Repair -




7. Door / Back Left  
Paint / Poor Previous Repair -



8. Door / Back Right  
Paint / Poor Previous Repair -



9. Door / Front Right  
Paint / Poor Previous Repair -

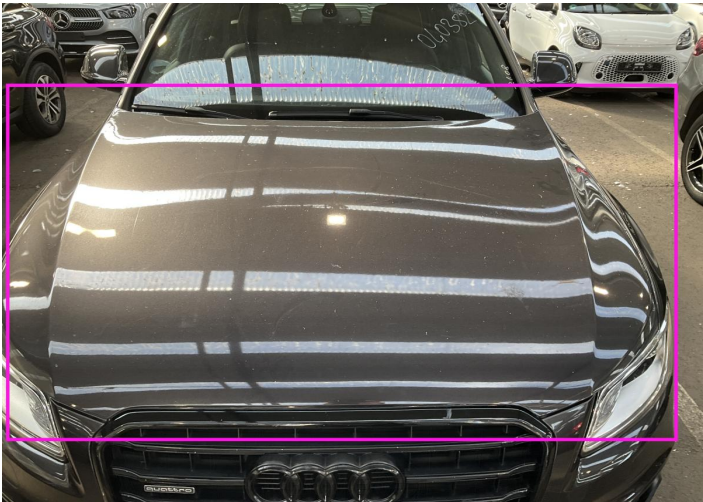

10. Hood  
Paint / Stone Chip -



11. Corner Bumper / Front Right  
Paint / Scratch / Scuff -



12. Corner Bumper / Front Right  
Bodywork / Dent / Dent -



13. Rim / Front Left  
Out of Bodywork / Scratch -



14. Rim / Back Left  
Out of Bodywork / Scratch -



15. Corner Bumper / Back Left  
Paint / Scratch / Scuff -



16. Tailgate  
Paint / Scratch / Scuff -



17. Corner Bumper / Back Right  
Paint / Scratch / Scuff -



18. Rim / Back Right  
Out of Bodywork / Scratch -



19. Side Panel / Back Right  
Bodywork / Dent / Dent -



20. Door / Back Right  
Paint / Scratch / Scuff -



21. Door / Back Right  
Paint / Scratch / Scuff -



22. Door / Back Right  
Bodywork / Dent / Dent -



23. Rim / Front Right  
Out of Bodywork / Scratch -



24. Tire / Back Left  
Bodywork / Poor Previous Repair -

## Mechanical Condition

### Control Lights

|                                              |   |                      |   |
|----------------------------------------------|---|----------------------|---|
| Display Defect                               | ✓ | ABS Warning Light    | ✓ |
| ESP Fault/Traction Control Malfunction Light | ✓ | Airbag Warning Light | ✓ |
| Oil Pressure Warning Light                   | ✓ | Brake Warning Light  | ✓ |
| Power Steering Warning Light                 | ✓ | Alternator / Battery | ✓ |
| All - wheel Drive                            | ✓ | No Dashboard Lights  | ✓ |

### Equipments Test

|                                       |   |                     |   |
|---------------------------------------|---|---------------------|---|
| Main & Spare Keys Functioning         | ✓ | Electric Windows    | ✓ |
| Navigation System                     | ✓ | Audio Equipment     | ✓ |
| Parking Sensors / Cameras Functioning | ✓ | AC / Heating System | ✓ |

### Engine

|                     |   |                     |   |
|---------------------|---|---------------------|---|
| Engine Status / EML | ✓ | Engine Leak Visible | ✓ |
| Engine Starts       | ✓ |                     |   |

### Gearbox

|          |   |
|----------|---|
| Gear Box | ✓ |
|----------|---|

### Levels

|              |    |               |   |
|--------------|----|---------------|---|
| Brakes Fluid | NA | Coolant Fluid | ✓ |
|--------------|----|---------------|---|

## Test Drive Inspection

| Steering Wheel                                                                                       |   |                                               |   |
|------------------------------------------------------------------------------------------------------|---|-----------------------------------------------|---|
| Steering   Noise / Anomaly                                                                           |   | ✓                                             |   |
| Engine                                                                                               |   |                                               |   |
| Engine Noise                                                                                         | ✓ | The Gears Scratch / Skip / Abnormal Operation | ✓ |
| Fume Quantity                                                                                        | ✓ | Power Loss                                    | ✓ |
| Brake                                                                                                |   |                                               |   |
| Brake System Anomaly                                                                                 |   | ✓                                             |   |
| General                                                                                              |   |                                               |   |
| Test Driven Status                                                                                   |   | ✓                                             |   |
| ✓ <i>No troubles detected, good condition or correct tests, according to vehicle age and mileage</i> |   |                                               |   |
| ! <i>Damages or malfunction detected that requires repairs by the buyer</i>                          |   |                                               |   |
| NA <i>Not applicable</i>                                                                             |   |                                               |   |
| = <i>Not tested</i>                                                                                  |   |                                               |   |

## Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description.

[User Guide](#)