



AUDI A6
A6 Avant 2.5 TDI
VIN NO WAUZZZ4B34N008662
Registration Number B34N008662



MOT Date

2025-06-01

Last Service

2023-02-17

Number of Owners

2

Last Service Mileage

350848

Number of Keys

1

First Registration Date

2003-07-07

Odometer Reading

390505 km

Country First Registered

Germany

Inspection Report Summary

Customer	BCA Online	Report Number	P20250820102907
Inspection Date / Place	2025-08-20 / BCA Oberndorf	Cosmetic Grade	5

Vehicle Summary

Vehicle Condition	Runner	VAT Type	Margin
Fuel Type	Diesel	Road Worthy	Yes
Colour	Blue	Engine Size (cc)	2496
Engine Size	2.5	No of Doors	5
Body Type	Stationwagon / Estate	Drive Train	Front
Seat Colour		No of Seats	5
Seat Covering Name	Schwarz	Seat Covering	Cloth
Charging Cables		NEDC CO2 Rating (q/km)	217
Gearbox Type	Automatic		

Vehicle History & Documents

Service Book Available	Present	Next Service Mileage	km
Previous Usage		Imported	No
Manufacturer Warrenty			





Service-Nachweis

Datum: 12.03 km-Stand: 300 843

Durchgeführt wurde¹⁾

	ja	nein
LongLife Service	☒	☐
Inspektions Service	☒	☐
Ölwechsel	☒	☐
Inspektion	☒	☐

Zusätzlich → Seite 11

alle 60.000 km	☒	☐
alle 90.000 km	☒	☐

Zusätzlich → Seite 12

alle 2 Jahre	☒	☐
alle 4 Jahre	☒	☐
alle 30.000 km	☒	☐

Reparaturleistung

Rech.-Nr. 1241

Service-Nachweis

Datum: _____ km-Stand: _____

Durchgeführt wurde¹⁾

	ja	nein
LongLife Service	☐	☐
Inspektions Service	☐	☐
Ölwechsel	☐	☐
Inspektion	☐	☐

Zusätzlich → Seite 11


alle 60.000 km	☐	☐
alle 90.000 km	☐	☐

Zusätzlich → Seite 12


alle 2 Jahre	☐	☐
alle 4 Jahre	☐	☐
alle 30.000 km	☐	☐

Reparaturleistung

Rech.-Nr. _____



22380
bhp Autohandelsgesellschaft mbH
72458 Albstadt
Stempel des Audi-Partners



22380
bhp Autohandelsgesellschaft mbH
72458 Albstadt
Stempel des Audi-Partners

¹⁾Bitte jede Zeile ankreuzen.

Equipment

Airbag Status	Anti-lock braking	Front fog lamps	Remote central locking
Split folding rear seats	CD Player	Radio	Alloys wheels
Cruise control	Remote adjusting wing mirrors	Roof rails	Stability control
Central locking	Rear parking sensors		


Equipment Details

Air Conditioning	Dual Zone Climate Control	Alloy Wheel Size	16
Extra Wheel / Tyre Set	Winter Tyres - Steel	Seat Heating	Front

Wheels & Tyres


Right Front Tyre Depth	2	Left Front Tyre Depth	2
Right Rear Tyre Depth	4	Left Rear Tyre Depth	4
Extra Wheel - 1 Tyre Depth	5	Extra Wheel - 2 Tyre Depth	5
Extra Wheel - 3 Tyre Depth	5	Extra Wheel - 4 Tyre Depth	5

Cosmetic Damage

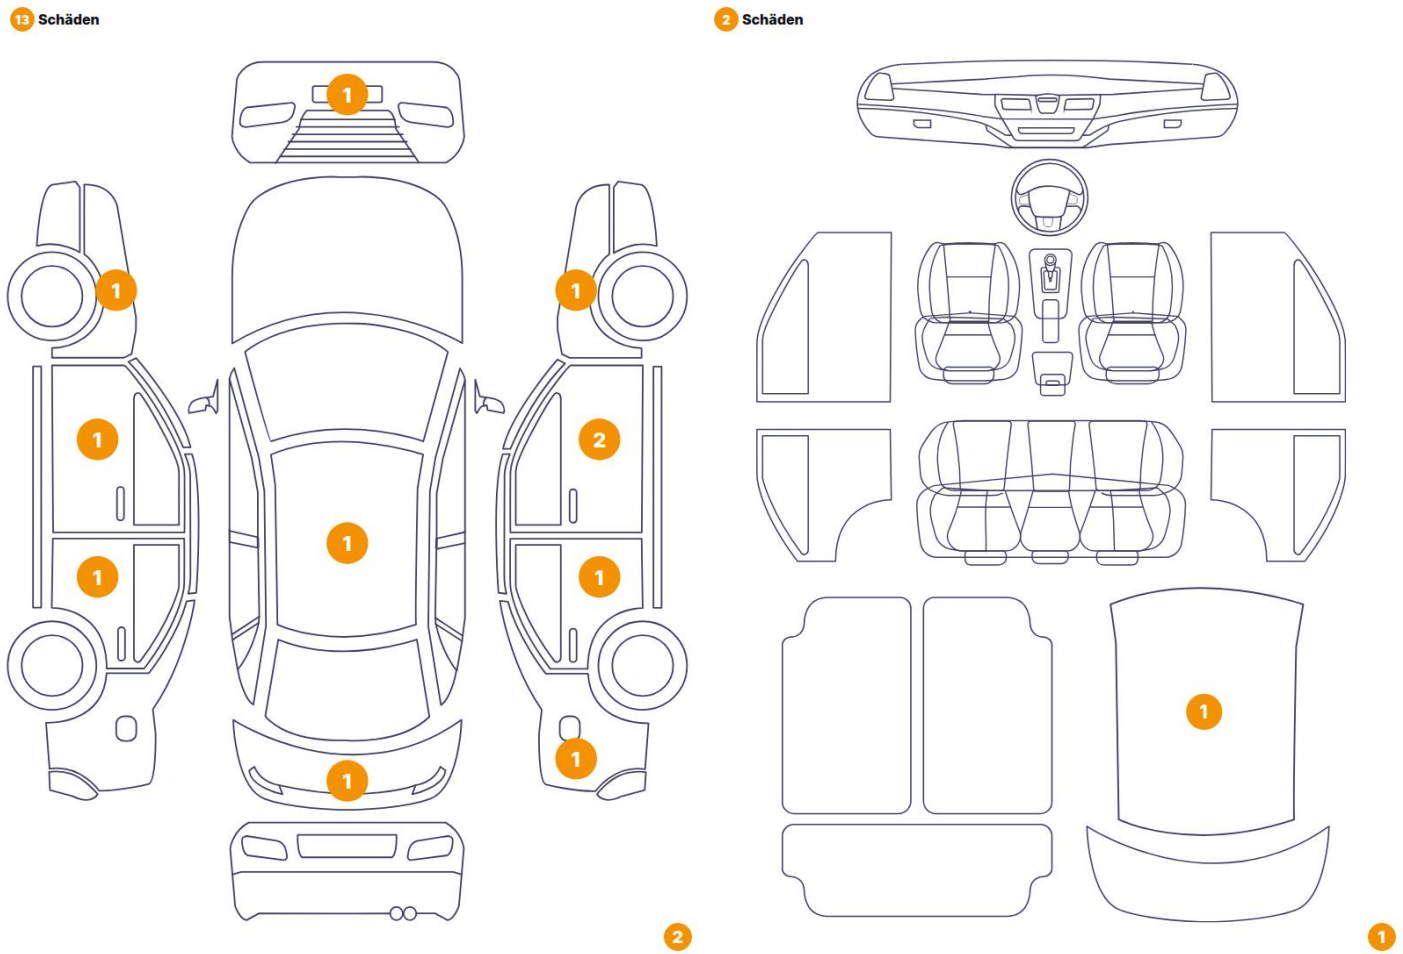

Component		Damage	Comments
1	Other	Anomalyon Element	
2	Bumper / Front	Paint / Scratch / Scuff	
3	Roof	Bodywork / Dent / Dent	
4	Other	Interior / Broken	
5	Roof Upholstery	Interior / Loose	
6	Fender / Front Left	Paint / Corrosion	
7	Door / Front Left	Paint / Corrosion	
8	Door / Back Left	Paint / Scratch / Line	
9	Other	Bodywork / Breakage / Hole	
10	Tailgate	Paint / Scratch / Line	
11	Side Panel / Back Right	Paint / Corrosion	
12	Door / Back Right	Paint / Scratch / Line	

13	Door / Front Right	Paint / Corrosion
14	Fender / Front Right	Paint / Corrosion
15	Mirror / Front Right	Paint / Scratch / Scuff

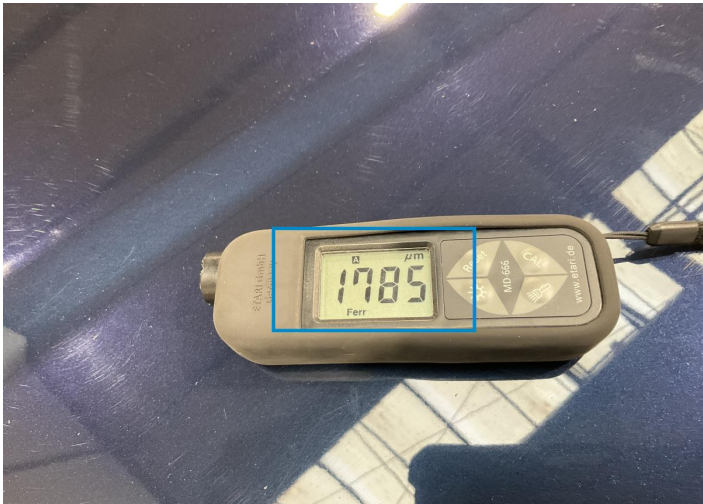

1.
Anomalyon Element -



2. Bumper / Front
Paint / Scratch / Scuff -



3. Roof
Bodywork / Dent / Dent -




4.
Interior / Broken -



5. Roof Upholstery
Interior / Loose -



6. Fender / Front Left
Paint / Corrosion -

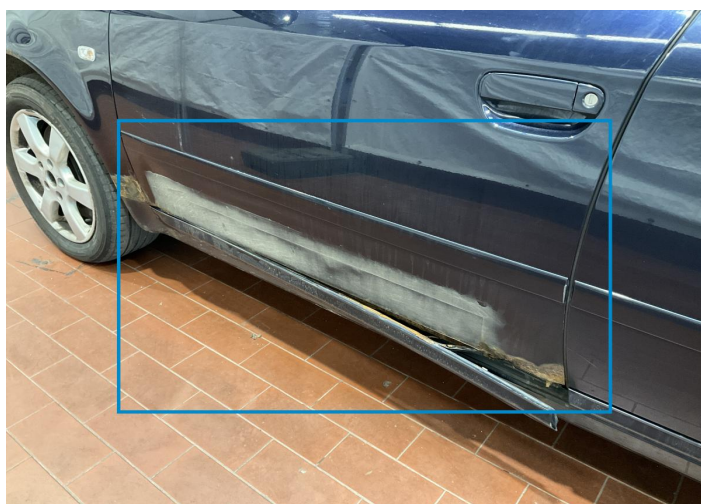

7. Door / Front Left
Paint / Corrosion -



8. Door / Back Left
Paint / Scratch / Line -



9.
Bodywork / Breakage / Hole -



10. Tailgate
Paint / Scratch / Line -



11. Side Panel / Back Right
Paint / Corrosion -



12. Door / Back Right
Paint / Scratch / Line -



13. Door / Front Right
Paint / Corrosion -



14. Fender / Front Right
Paint / Corrosion -



15. Mirror / Front Right
Paint / Scratch / Scuff -

Mechanical Condition

Control Lights

Display Defect	✓	Service Light	✓
ABS Warning Light	✓	ESP Fault/Traction Control Malfunction Light	✓
Airbag Warning Light	✓	Oil Pressure Warning Light	✓
Brake Warning Light	✓	Power Steering Warning Light	✓
Alternator / Battery	✓	No Dashboard Lights	✓

Equipments Test

Central Locking	✓	Main & Spare Keys Functioning	✓
Electric Windows	✓	Audio Equipment	✓
Parking Sensors / Cameras Functioning	✓	AC / Heating System	✓
Other Equipments	✓		

Engine

Engine Status / EML	✓	Engine Leak Visible	!
Engine Starts	✓		

Gearbox

Gear Box	✓
----------	---

Levels

Brakes Fluid	✓	Coolant Fluid	✓
--------------	---	---------------	---

Test Drive Inspection

Steering Wheel			
Steering Noise / Anomaly		✔	
Engine			
Engine Noise	✔	The Gears Scratch / Skip / Abnormal Operation	✔
Fume Quantity	✔	Power Loss	✔
Brake			
Brake System Anomaly		✔	
General			
Test Driven Status		Not Performed	
✔ <i>No troubles detected, good condition or correct tests, according to vehicle age and mileage</i>			
❗ <i>Damages or malfunction detected that requires repairs by the buyer</i>			
NA <i>Not applicable</i>			
☐ <i>Not tested</i>			

Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description.

[User Guide](#)