



Audi A6 (MKL): 2BDZ020

Vinnumber:	WAUZZZF24NN013870	Versionname:	A6 Avant Business Edition 35 2.0TDI 163pk/cv 5p S-Tronic
First Registrationdate:	18/10/2021	Fiscalpower:	
Expertise Mileage:	93864	Power Kw:	120
Bodytype:		Type of rims (mounted)	Aluminium
Gearbox:	Automatic		
Transmission:			
Fueltype:			
Maintenance	OK		
Battery functioning	Yes		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Luggage cover	
GPS		Type of Tow bar	No Tow bar
Type of Maintenance book	Digital maintenance		
Type of GPS storage	HD		

Tyres

	225/55/18/102 V			
Winter tyres:	Fr.L.	Toyo: 5 mm	Fr.R.	Toyo: 5 mm
	Re.L.	Toyo: 6 mm	Re.R.	Toyo: 6 mm
Tyre profile depth FL				5.0
Tyre profile depth FR				5.0
Tyre profile depth RL				6.0
Tyre profile depth RR				6.0
Tyre size FL				225/55 R 18 102 V
Tyre size FR				225/55 R 18 102 V
Tyre size RL				225/55 R 18 102 V
Tyre size RR				225/55 R 18 102 V
Tyre type FL				Winter
Tyre type FR				Winter
Tyre type RL				Winter
Tyre type RR				Winter
Tyre make FL				2483
Tyre make FR				2483
Tyre make RL				2483
Tyre make RR				2483

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Ignition key, Missing, Replace



Door panel FL, Scratch(es), Replace



Seat cover FL, Worn, Acceptable




Centre console, Scratch(es), Acceptable



Windscreen, Stone chip(s), Replace




Bumper F, Repaired, Check

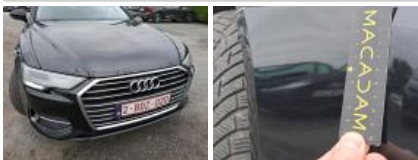

Bumper F, Dent(s) and scratch(es), Spot repair



Wing RL, Scratch(es), Acceptable

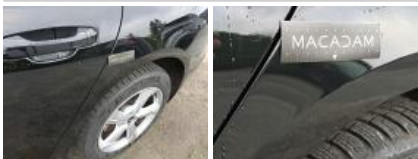

Bumper R, Dent(s) and scratch(es), Repair and paint (complete)



Reflector, Broken, Replace



Bumper moulding R, Broken, Replace



Bumper trim R, Scratch(es), Replace



Sill trim R, Scratch(es), Repair and paint (complete)



Alloy rim FR, Scratch(es), Repair and paint (complete)



Alloy rim RR, Scratch(es), Acceptable

