



AUDI A6
A6 Avant 50 TDI quattro tiptronic

VIN NO WAUZZZF28NN043079
Registration Number 28NN043079



MOT Date	Number of Owners	Number of Keys	Odometer Reading
2027-06-01	1	2	92793 km
Last Service	Last Service Mileage	First Registration Date	Country First Registered
-	-	2022-04-06	Germany

Inspection Report Summary

Customer	BCA Online	Report Number	P20250922105720
Inspection Date / Place	2025-09-22 / BCA Neuss	Cosmetic Grade	2

Vehicle Summary



Vehicle Condition	Runner	VAT Type	Qualifying
Fuel Type	Diesel	Gearbox Type	Automatic
Colour	Black	Engine Size (cc)	2967
Engine Size	3.0	No of Doors	5
Body Type	Stationwagon / Estate	Drive Train	All-Wheel-Drive permanent
Seat Colour		No of Seats	5
Seat Covering Name	anthrazit	Seat Covering	Cloth/Leather
Charging Cables		WLTP CO2 Emissions	

Vehicle History & Documents

Service Book Available	Incomplete	Next Service Mileage	km
Previous Usage		Imported	No
Manufacturer Warrenty			





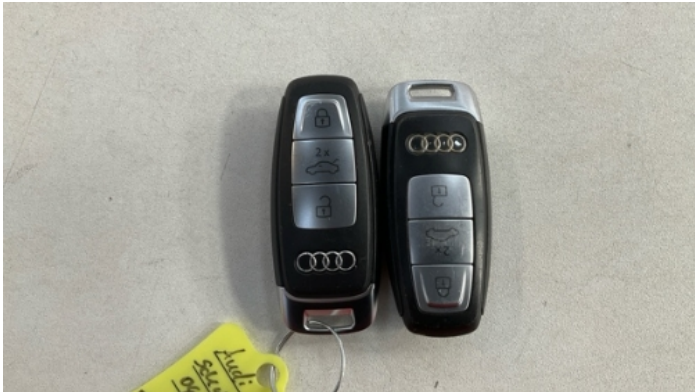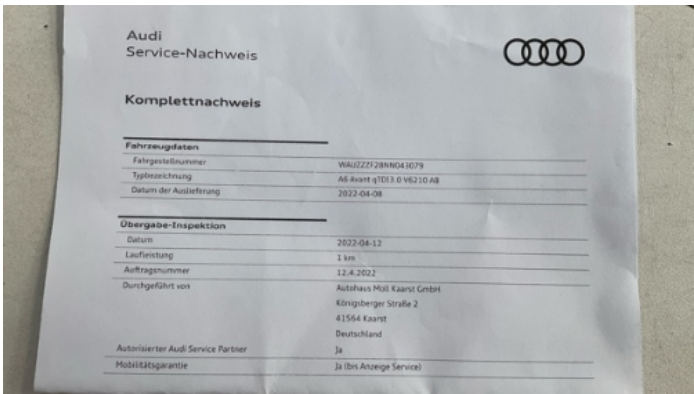



Equipment

Traffic sign recognition	Airbag Status	Anti-lock braking	Cruise control
Digital Radio	Heated wing mirrors	Remote central locking	Satellite navigation
Sunroof	Electric tailgate	LED Headlamps	Rear parking sensors
USB Socket	Alloys wheels	Bluetooth telephone interface	Diesel particulate filter
Front parking sensors	Remote adjusting wing mirrors	Roof rails	Stability control
Electrically folding wing mirrors	Leather steering wheel	Rain sensitive windscreen wipers	

Equipment Details


Tow Ball Type	Pivoted	Air Conditioning	Four Zone Climate Control
Alloy Wheel Size	19	Extra Wheel / Tyre Set	Winter Tyres - Alloy
Seat Heating	Front	Sunroof Type	Opening Panoramic

Wheels & Tyres


Extra Wheel - 1 Tyre Depth	3	Extra Wheel - 2 Tyre Depth	3
Extra Wheel - 3 Tyre Depth	3	Extra Wheel - 4 Tyre Depth	3
Right Front Tyre Depth	5	Left Front Tyre Depth	5
Right Rear Tyre Depth	5	Left Rear Tyre Depth	5

Cosmetic Damage

4 Schäden

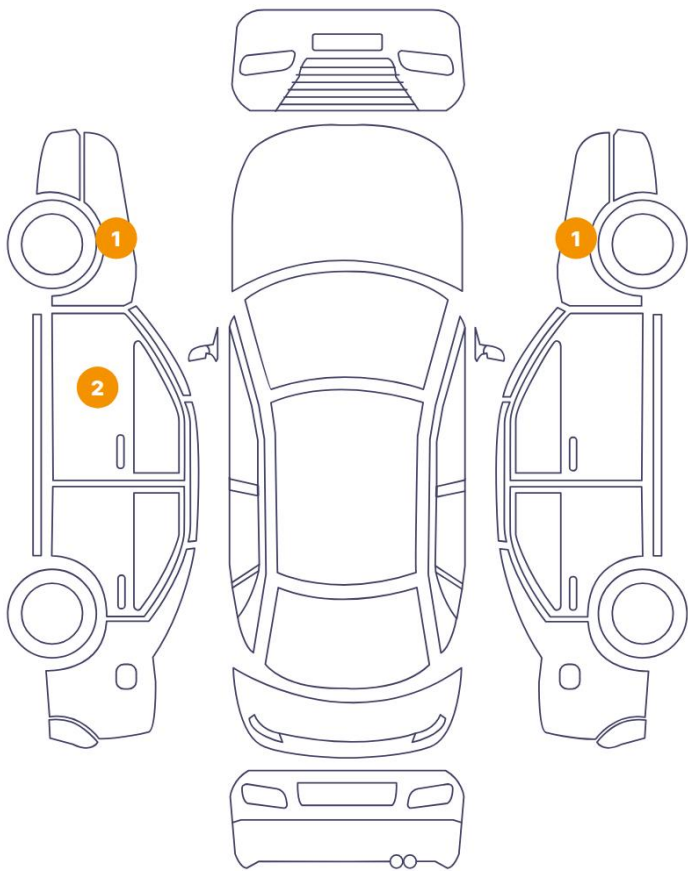

2 Schäden

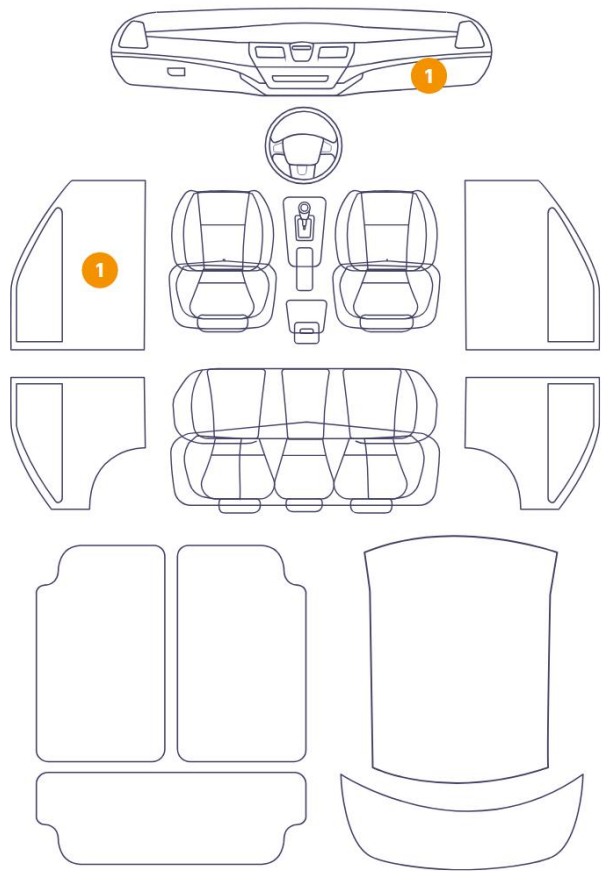

Component	Damage	Comments
1 Fender / Front Left	Paint / Poor Previous Repair	
2 Fender / Front Right	Paint / Poor Previous Repair	
3 Door / Front Left	Bodywork / Dent / Dent	
4 Door Handle / Front Left	Paint / Scratch / Scuff	
5 Panel Filling / Front Left	Interior / Scratched	
6 Center Console	Interior / Scratched	



1. Fender / Front Left
Paint / Poor Previous Repair -



2. Fender / Front Right
Paint / Poor Previous Repair -



3. Door / Front Left
Bodywork / Dent / Dent -



4. Door Handle / Front Left
Paint / Scratch / Scuff -



5. Panel Filling / Front Left
Interior / Scratched -



6. Center Console
Interior / Scratched -

Mechanical Condition

Control Lights

ABS Warning Light	✓	ESP Fault/Traction Control Malfunction Light	✓
Diesel Particulate Filter Light	✓	Airbag Warning Light	✓
Oil Pressure Warning Light	✓	Brake Warning Light	✓
Power Steering Warning Light	✓	Alternator / Battery	✓
All - wheel Drive	✓	No Dashboard Lights	✓
Display Defect	✓	Service Light	✓
Tire Pressure Monitoring System	✓		

Engine

Engine Status / EML	✓	Engine Leak Visible	✓
Engine Starts	✓		

Gearbox

Gear Box	✓
----------	---

Levels

Brakes Fluid	NA	Coolant Fluid	NA
--------------	----	---------------	----

Equipments Test

Main & Spare Keys Functioning	✓	Electric Windows	✓
Navigation System	✓	Audio Equipment	✓
Parking Sensors / Cameras Functioning	✓		

Test Drive Inspection

Steering Wheel

Steering | Noise / Anomaly

Engine

Engine Noise The Gears Scratch / Skip / Abnormal Operation

Fume Quantity Power Loss

Brake

Brake System Anomaly

General

Test Driven Status

- No troubles detected, good condition or correct tests, according to vehicle age and mileage
- Damages or malfunction detected that requires repairs by the buyer
- Not applicable
- Not tested

Disclaimer

Please also note the "UserGuide condition report", which shows the scope of the vehicle description. [User Guide](#)